COUNTY OF HUMBOLDT, CALIFORNIA

COMMUNITY CORRECTIONS RESOURCE CENTER

ADA ACCESS COMPLIANCE ASSESSMENT



404 H STREET, EUREKA CA (COUNTY LEASED FACILITY)



Sacramento Office 770 L Street, Suite 950 Sacramento, CA 95814 Email: Info@szs.engineering

Tel: 916.669.8750 Fax: 888.211.7441

Silicon Valley Office 2225 E. Bayshore Road, Suite 200 Palo Alto CA 94303

Tel: 866.694.7637 www.szs.engineering

January 2, 2020



Humboldt County Administrative Office CAO-ADA Compliance Team 825 Fifth Street, Room 112 Eureka, California 95501 Attention: Karen Clower, ADA Coordinator

Re: COMMUNITY CORRECTIONS RESOURCE CENTER – ADA ACCESS COMPLIANCE ASSESSMENT

Dear Ms. Clower,

We are pleased to submit this report as a first step in the process to identify barriers to access for the County of Humboldt. This process will allow the County to apply programmatic accessibility before resorting to physical barrier removal, in order to conserve funds while meeting the goal of improving access.

This has been an informative process. We look forward to creating an updated digital remediation program to facilitate implementation. Please review the report and provide input. We welcome collaboration in this process.

Contact me with any questions you may have.

Regards,

Syroun Z. Sanossian, Principal SZS Engineering Access, Inc.

Syn Z. Somi



TABLE OF CONTENTS

1.	EXECUTI	VE SUMMARY	p. 1
	A.	Private Entities, Public Accommodations and the ADA	p. 3
	B.	Safe Harbor Provisions	p. 7
	C.	Barrier Severity Ratings and Remediation	p. 8
	D.	Official Responsible	p. 9
	E.	Recommended Barrier Removal Priorities	p. 9
	F.	Cost Estimates	p. 11
	G.	Exterior Spaces	p. 11
	Н.	Facility Entrances	p. 12
	I.	Report Format Definitions	p. 13
2.	EXTERIO	R SPACES	p. 16
3.	INTERIOR	R SPACES	p. 16
4.	BARRIER	DATA RECORDS	
	A.	Barrier Data Records	p. 18
	В.	Cost Estimate	p. 94
5.	APPENDI	x	
	Α.	Reference Drawings	p. 95



1. EXECUTIVE SUMMARY

This ADA Access Compliance Assessment was compiled for the facility located at 404 H Street in Eureka, CA. This structure is leased by the County of Humboldt as a location where the County can provide county programs, services and activities. As a privately owned facility in which public activities take place, the facility is defined under the ADA as a public accommodation.

This report was developed to fulfill requirements under the consent decree entered into by the County of Humboldt with the US Department of Justice (DOJ). The United States alleged that Humboldt County has discriminated, and continues to discriminate, against individuals with disabilities by failing to make County facilities, programs, services, and activities accessible to and useable by individuals with disabilities in violation of the ADA.

The DOJ initiated a compliance review of Humboldt County under its Project Civic Access ("PCA") initiative, a wide-ranging effort to ensure that cities, counties, and other public entities throughout the country comply with the ADA by eliminating physical, communication, and other barriers that prevent people with disabilities from participating fully in community life. The DOJ's review of the County included a review of its programs and an accessibility survey of over 50 facilities, although the consent decree governs all facilities in which County programs, services or activities take place¹. As the result of its review, the Department found numerous violations of the ADA, notified the County of the violations and negotiated a settlement agreement in which the County committed to bring its facilities, programs, services and activities into compliance with the ADA.

SZS Engineering Access, Inc. is the Independent Licensed Architect ("ILA"), pre-approved by the DOJ, acting independently to certify whether any alterations, additions, or modifications made by the County during the term of this Consent Decree comply with the applicable standard pursuant to 28 C.F.R. § 35.151(c) and the Appendix to 28 C.F.R. § 35.151(c)².

In issuing certifications pursuant to this Consent Decree, the ILA will impartially prepare reports identifying each violation and demonstrating with photographs each violation that has been remediated. The ILA is considered a neutral inspector for purposes of issuing certifications of compliance.

Under the consent decree, the County agreed not to deny the benefits of its programs, services, and activities³ or discriminate against individuals with a disability, and will not, based on disability provide an unequal, different, or separate opportunity to participate in its programs, services, and activities⁴.

The intent of this assessment report is to identify physical barriers to access, so that design professionals can use the information to ensure that alterations to facilities that house County programs, services and activities result in facilities that are accessible to and usable by people with disabilities. This facility is owned by a private party. Where the owner leases the facility for use as a public accommodation, the facility must comply with requirements to provide access

_



¹ US v. County of Humboldt, US v. County of Humboldt, Civil Action No. 16-5139, Attachment - G, H, I, J

² 28 C.F.R. § 35.151(c) and the Appendix to 28 C.F.R. § 35.151(c)

³ 28 C.F.R. § 35.130(b)(1).

⁴ 28 C.F.R. § 35.130(b)(1), (3).



to a public accommodation. If the County were to vacate this facility, the requirements will remain in place for any other parties leasing the facility that provide public accommodations.

The field investigation began on November 13, 2017. Images of each physical element identified in this report were captured in HD digital photos while manual measurements were taken to establish as-built conditions for the process of cost estimating. Digital photographs are provided within this report for each barrier to access to facilitate the review of the data collected. Technical data can be interpreted more efficiently with a visual component; the photos provide a clear connection between the technical data described in each barrier data record and the physical barrier to access identified.

When taking measurements in exterior areas, visual markers are used to indicate the location or beginning and end of a barrier such as a cross slope. Red cups or the digital level used to take measurements will be used in photos as a visual marker to indicate the location of these exterior barriers within the context of the existing site conditions.

The facility is a structure that appears to have been built before the enforcement of the Americans with Disabilities Act and barriers to access were identified.

ADA Title III holds that no individual shall be discriminated against on the basis of disability in the full and equal enjoyment of the goods, services, facilities, privileges, advantages, or accommodations of any place of public accommodation by any private entity who owns, leases (or leases to), or operates a place of public accommodation. The findings presented are both narrative and technical in nature. Physical barriers to access identified during the field investigation process are documented in two ways:

- 1. <u>Summary and Analysis:</u> An analysis of findings is provided in a narrative form that describes particular barriers identified in the following records to help ensure that the findings for atypical situations can be further explained. The intent of this information is to provide a discussion on the functionality of physical elements. Background reasoning and research behind the identification of barriers is also provided where universal design principles may play a role. This analysis may be accompanied by digital photographs or diagrams, where applicable. Understanding building function and usage is essential when interpreting the findings held in this report. The narrative is intended to facilitate this process.
- 2. <u>Barrier Data Records:</u> Individual barriers to access are entered into the ADA/Access Compliance database so that technical information on each individual barrier can be provided a barrier data record. These barrier data records include detailed information including digital photographs of each barrier identified, code references that determine the barrier to access, as-built measurements, barrier severity ratings, budgetary cost estimates, recommended solutions for barrier removal and a priority for barrier removal will be assigned in the final report. The information is formatted with two barriers on each report page.

Each barrier identified in this report is designated as either required for removal or recommended for removal. State and federal model code provide the basis for most of the barrier identification contained in this report. There are other barriers to access that are dictated by case law precedent, vehicle code, health code, safety code and labor code. Most barriers identified in this report are based on those requirements but additional barriers exist



that are not based on these regulations or statutes. Barriers that are recommended for removal are based on pending regulations or good practices. The associated field provides two options for each barrier: Required or Recommended.

It is important to note that the barriers identified in this report reflect the most stringent requirements from the 2010 ADA Standards, California Code of Regulations/Title 24 and the California edition of the Manual on Uniform Traffic Control Devices (MUTCD). These model codes are not identical and contain conflicting requirements. To ensure ADA Access Compliance is achieved, this report is based on the most stringent requirements taken from these model codes.

In order to consolidate the barrier data, some of the more typical barriers found in multiple locations have been grouped within the barrier data records with a description of the locations in which they were found. For instance, this occurs where barriers were identified in stairways that have existing handrails that continue through multiple floors.

A. PRIVATE ENTITIES, PUBLIC ACCOMMODATIONS AND THE ADA

The landmark Americans with Disabilities Act (ADA), enacted on July 26, 1990 provides comprehensive civil rights protection to individuals with disabilities in the many areas including employment, telecommunications, facilities that offer public accommodations, and state and local governmental services. The ADA is comprised of five parts, or titles. Each title covers a specific area delineated by the ADA, in which the legislation is intended to enhance accessibility for persons with disabilities. The five titles are as follows:

<u>Title I:</u> Employment Practices by units of State and Local Governments

Title II: Programs, Services and Activities of State and Local Governments

<u>Title III:</u> Public Accommodations and Commercial Facilities (private businesses and non-profit service providers)

Title IV: Telecommunications

Title V: Miscellaneous Provisions

Title III of the Americans with Disabilities Act of 1990 (42 U.S.C. 12181) applies to this property. Title III prohibits discrimination on the basis of disability by public accommodations and requires places of public accommodation and commercial facilities to be designed, constructed, and altered in compliance with the construction-related accessibility standards established by Section 36.101 of the Act. The 2010 ADA Standards have updated the original ADA as of March 2012.

Furthermore, ADA Title III holds that no individual shall be discriminated against on the basis of disability in the full and equal enjoyment of the goods, services, facilities, privileges, advantages, or accommodations of any place of public accommodation by any private entity who owns, leases (or leases to), or operates a place of public accommodation. Both the landlord who owns the site that houses a place of public accommodation and the tenant who owns or operates the place of public accommodation are responsible to provide accessible public accommodations subject to the requirements of this Title. As between the parties, allocation of



responsibility for complying with the obligations of this part may be determined by lease or other contract.⁵ The terms of the lease should define the responsibilities.

ACTIVITIES

Public accommodations also cannot deny participation to persons with disabilities, or provide for unequal or separate benefits for persons with disabilities. The basis of the ADA is the integration of persons with disabilities into society, not the expectation of preference or any type of special treatment.

A public accommodation shall afford goods, services, facilities, privileges, advantages, and accommodations to an individual with a disability in the most integrated setting appropriate to the needs of the individual. The maintenance of accessible features is essential. A public accommodation shall maintain in operable working condition those features of facilities and equipment that are required to be readily accessible to and usable by persons with disabilities by the Act, although this Act or section does not prohibit isolated or temporary interruptions in service or access due to maintenance or repairs.

ELIGIBILITY CRITERIA

A public accommodation shall not impose or apply eligibility criteria that screen out or tend to screen out an individual with a disability or any class of individuals with disabilities from fully and equally enjoying any goods, services, facilities, privileges, advantages, or accommodations, unless such criteria can be shown to be necessary for the provision of the goods, services, facilities, privileges, advantages, or accommodations being offered. But, a public accommodation may impose legitimate safety requirements that are necessary for safe operation. Safety requirements must be based on actual risks and not on mere speculation, stereotypes, or generalizations about individuals with disabilities. A public accommodation also may not impose a surcharge on a particular individual with a disability or any group of individuals with disabilities to cover the costs of measures, such as the provision of auxiliary aids, barrier removal, alternatives to barrier removal, and reasonable modifications in policies, practices, or procedures, that are required to provide that individual or group with the nondiscriminatory treatment required by the Act or this section.

MODIFICATIONS IN POLICIES, PRACTICES OR PROCEDURES

A public accommodation shall make reasonable modifications in policies, practices, or procedures, when the modifications are necessary to afford goods, services, facilities, privileges, advantages, or accommodations to individuals with disabilities, unless the public accommodation can demonstrate that making the modifications would fundamentally alter the nature of the goods, services, facilities, privileges, advantages, or accommodations. This is significant in terms of physical alterations made to improve accessibility for persons with disabilities. A public accommodation may refer an individual with a disability to another public accommodation, if that individual is seeking, or requires, treatment or services outside of the referring public accommodation's area of specialization, and if, in the normal

⁵ Department of Justice ADA Title III Regulations 28 CFR Part 36; Sec.36.105 -- 36.199 [Reserved] Subpart B -- General Requirements Sec.36.201 General. (b)



course of its operations, the referring public accommodation would make a similar referral for an individual without a disability who seeks or requires the same treatment or services.

AUXILIARY AIDS AND SERVICES

A public accommodation shall take steps that may be necessary to ensure that no individual with a disability is excluded, denied services, segregated or otherwise treated differently than other individuals because of the absence of auxiliary aids and services, unless the public accommodation can demonstrate that taking those steps would fundamentally alter the nature of the goods, services, facilities, privileges, advantages, or accommodations being offered or would result in an undue burden, i.e., significant difficulty or expense.

REMOVAL OF BARRIERS

A public accommodation shall remove architectural barriers in <u>existing facilities</u>, including communication barriers that are structural in nature, where design and construction for first occupancy started before January 26, 1993, and such removal is readily achievable, i.e., easily accomplishable and able to be carried out without much difficulty or expense⁶. Examples of steps to remove barriers include, but are not limited to, the following actions:

- 1) Installing ramps;
- 2) Making curb cuts in sidewalks and entrances;
- 3) Repositioning shelves;
- 4) Rearranging tables, chairs, vending machines, display racks, and other furniture;
- 5) Repositioning telephones;
- Adding raised markings on elevator control buttons;
- 7) Installing flashing alarm lights;
- 8) Widening doors;
- 9) Installing offset hinges to widen doorways;
- 10) Eliminating a turnstile or providing an alternative accessible path;
- 11) Installing accessible door hardware;
- 12) Installing grab bars in toilet stalls;
- 13) Rearranging toilet partitions to increase maneuvering space;
- 14) Insulating lavatory pipes under sinks to prevent burns;
- 15) Installing a raised toilet seat;
- 16) Installing a full-length bathroom mirror;
- 17) Repositioning the paper towel dispenser in a bathroom;
- 18) Creating designated accessible parking spaces;

SZS ENGINEERING

⁶ Department of Justice ADA Title III Regulations 28 CFR Part 36; Sec..36.105 -- 36.199 [Reserved] Subpart B -- General Requirements Sec.36.304 Removal of barriers.



- 19) Installing an accessible paper cup dispenser at an existing inaccessible water fountain;
- 20) Removing high pile, low density carpeting; or
- 21) Installing vehicle hand controls.

PRIORITIES

It is recommended that a public accommodation take measures to comply with the barrier removal requirements of this section in accordance with the following order of priorities:

- (1) A public accommodation should take measures to provide access to a place of public accommodation from public sidewalks, parking, or public transportation. These measures include, for example, installing an entrance ramp, widening entrances, and providing accessible parking spaces.
- (2) Second, a public accommodation should take measures to provide access to those areas of a place of public accommodation where goods and services are made available to the public. These measures include, for example, adjusting the layout of display racks, rearranging tables, providing Brailled and raised character signage, widening doors, providing visual alarms, and installing ramps.
- (3) Third, a public accommodation should take measures to provide access to restroom facilities. These measures include, for example, removal of obstructing furniture or vending machines, widening of doors, installation of ramps, providing accessible signage, widening of toilet stalls, and installation of grab bars.
- (4) Fourth, a public accommodation should take any other measures necessary to provide access to the goods, services, facilities, privileges, advantages, or accommodations of a place of public accommodation. This may include providing space in the seating area for wheelchair users to maneuver or wait, as able-bodied persons presently do.

No measure shall be taken; however, that poses a significant risk to the health or safety of individuals with disabilities or others. The provision of visual alarms is only required in sites where existing fire alarm systems are provided.

ALTERNATIVES TO BARRIER REMOVAL

Where a public accommodation cannot demonstrate that barrier removal is readily achievable, the public accommodation shall make its goods, services, facilities, privileges, advantages, or accommodations available through alternative methods, if those methods are readily achievable. Examples of alternatives to barrier removal include, but are not limited to, the following:

- (1) Providing curb service or home delivery;
- (2) Retrieving merchandise from inaccessible shelves or racks; and
- (3) Relocating activities to accessible locations.



Accessibility improvements for existing facilities must be viewed on a case-by-case basis; especially where space constraints or other extenuating circumstances may exist. Further, there may be instances where alterations that are otherwise necessary to provide fully compliant accessibility may be technically infeasible. In such cases, it is expected that alterations aimed at full compliance be made to the maximum extent feasible.

What does "maximum extent feasible" mean? In the context of ADA compliance, the "maximum extent feasible" refers to the greatest degree of alterations that can be made to existing sites and structures without adversely affecting:

- (1) the structural integrity of the site or structure;
- (2) the historical fabric of the site or structure; or
- (3) the naturally occurring geographic barriers surrounding the site or structure.

The fact that adding accessibility features during an alteration may increase costs does not, by itself, mean compliance is technically infeasible. Moreover, even if it is technically infeasible to comply with standards for individuals with certain disabilities (for instance, those who use wheelchairs), the alteration must still comply with standards for individuals with other impairments.⁷

ILLUSTRATION 1: A restaurant is undergoing a major renovation. Widening the entrance would affect the site structure because removal of an essential part of the structural frame would be required. In this case, it is "technically infeasible" to widen the entrance and the alteration is not required. However, all other CBC/ADA alterations requirements would apply to the renovation.

BUT: If the only problem with widening the entrance is that it would increase the cost of the renovation, the "technically infeasible" exception does not apply, and the entrance must be widened.

These issues have been taken into consideration while compiling this report. In cases where a facility was constructed since the enforcement of the ADA, full compliance is required.

B. SAFE HARBOR PROVISIONS

The County of Humboldt and private property owners can make use of the *safe harbor* provision contained in the 2010 ADA Standards. This federal rule applies to provisions in the ADA Standards and is applied on an element-by-element basis for elements that complied with the 1991 ADA Standards. The rule includes a general "safe harbor" under which physical elements in facilities used for County programs, activities and services, that were built or altered in compliance with the 1991 Standards, would not be required to be brought into compliance with the 2010 Standards until the elements were subject to a planned alteration. A similar safe harbor applies to elements associated with the "path of travel" to an altered area. The federal Access Board has provided a list of the new

Department of Justice: Americans with Disabilities Act ADA Title III Technical Assistance Manual Covering Public Accommodations and Commercial Facilities. III-6.1000 General.



requirements in the 2010 Standards that are not eligible for the safe harbor in § 35.150(b)(2)(ii)(A) through § 35.150(b)(2)(ii)(L) of the final rule⁸, which includes golf courses, recreation areas, play areas outdoor recreational areas and open spaces not originally covered by the 1990 Standards that are now included in the 2010 Standards.

The most common area where safe harbor applies in this particular facility is within the reach range requirements. Previous requirements under the 1990 ADA Standards allowed high reach range to extend to a maximum of 54 inches high, whereas the 2010 ADA Standards now allow a maximum reach of only 48 inches. Many controls and mechanisms can be granted safe harbor under this federal provision. Safe harbor does not apply to areas where an alteration to the permanent room or space has been performed since 1992, which required the element (e.g. light switch) to comply with the new construction standards in place at the time of the alteration.

C. BARRIER SEVERITY RATINGS AND REMEDIATION

SZS has developed proprietary barrier identification systems to standardize our process and ensure consistency while collecting data, creating reports and recommending implementation removal over time. Our proprietary barrier severity rating system was developed through many years of research and experience, and is integrated into our database, so that each barrier is assigned a rating that defines how severely each barrier affects a person's ability to use the element. We know from experience that without a systematic approach to barrier severity rating, deciding which barriers to remove, and when, can be reduced to guesswork.

There are five barrier severity ratings (BSR) that are assigned to individual barriers:

- 1 Necessary
- 2 Recommended
- 3 Hindrance
- 4 Low Severity
- 5 Technically Infeasible

The affect that the barrier has on a person using the element is important, but the date of construction also plays a role in determining barrier severity ratings. Facilities that are defined under the ADA as new construction are required to be fully compliant and the barrier severity rating assigned to those barriers is 1 – Necessary to Remove. That is a legal requirement that governs our work regardless of how minor a barrier may be in terms of how it affects the user.

In existing facilities, which were constructed prior to the passage of the ADA, barrier removal is not required to achieve new construction standards. The standard for barrier removal is to bring a facility into compliance to the maximum extent feasible. This standard takes into consideration past building standards and practices which did not comply to the current ADA standards. Where barrier severity ratings are 4- Low Severity, these barriers may not require remediation. When barriers are rated as a 5 – Technically Infeasible, they

⁸ Americans with Disabilities Act Title II Regulations, Part 35 Nondiscrimination on the Basis of Disability in State and Local Government Services (as amended by the final rule published on September 15, 2010) http://www.ada.gov/regs2010/titleII_2010/titleII_2010_regulations.htm



cannot be removed due to structural impracticability or other conditions that cannot be altered. Increasing the clear width of an interior stairway in an existing building, or reducing the roadway slope where it corresponds with steep terrain, is technically infeasible to remediate.

Sidewalks, which were constructed prior to 1992, were often constructed intentionally with a cross slope to encourage drainage that is now defined as a code violation. Research shows that the affect that the cross slope of a walking surface between 2.1% and 2.9% is minor, or of a low severity, and can be navigated by a person using a mobility assist device with some extra effort, whereas a cross slope of 5.0% or more is known to cause a wheelchair to tip over which may result in injury. Existing walkways and sidewalks that are identified with a cross slope in the 2.1% and 2.9% range are assigned a low severity BSR with remediation not generally recommended where the duration (linear footage) of the barrier is limited to less than 5 feet and the affect they have for people using mobility assist devices is minor in comparison to many other barriers identified. Other instances where barriers are identified in the report and no remediation is recommended will be provided with an explanation on a case-by-case basis.

Barriers with a low severity rating are often assigned a Proposed Solution of "No remediation recommended – low severity barrier". The California Division of State Architect has approved this approach for projects throughout the state, since it is reasonable and allows for funds to be concentrated on barrier removals that have hindered or prevented use of an element by people with disabilities.

D. OFFICIAL RESPONSIBLE

The County of Humboldt is responsible to ensure access for people with disabilities to the programs, services or activities that they provide, whether they are provided in owned or leased facilities. The County is not necessarily the responsible party entrusted with removing barriers in leased facilities. The county will work with property owners, where feasible, to ensure compliance. Under the federal statute, discrimination includes a failure to design and construct facilities for first occupancy after January 26, 1993, that are readily accessible to and usable by individuals with disabilities⁹. California government code, civil code, health and safety code, vehicle code and labor code contain similar requirements.

The designated ADA Coordinator (ADA CO) is in charge of the barrier remediation plan pursuant to the Project Civic Access Consent Decree and ADA Transition Plan remediation during the time in which these reports have been compiled. The ADA CO and/or representative can be reached at (844) 365-0352 or ADA@co.humboldt.ca.us. It is likely that the person in this position will change over time through attrition, or retirement. At that time, another ADA CO will be assigned and assume these responsibilities to ensure continuity of services.

E. RECOMMENDED BARRIER REMOVAL PRIORITIES

The functions within the buildings were assigned a barrier removal priority that corresponds with the regulations discussed above. All construction and alterations to County buildings and facilities by the County or on its behalf [in leased facilities] will comply with the

⁹ Subpart D – New Construction and Alterations. § 36.401 New construction. (a) General. (a)



requirements of 28 C.F.R. § 35.151, including applicable architectural standards. All architectural changes by the County or on its behalf made on or after March 15, 2012, must comply with the 2010 ADA Standards. The term "2010 ADA Standards" refers to the 2010 ADA Standards for Accessible Design (28 C.F.R. § 35.104 (Title II) (defining the "2010 ADA Standards" as the requirements set forth in appendices B and D to 36 C.F.R. part 1191 and the requirements contained in 28 C.F.R. § 35.151.)). All citations are to the 2010 ADA Standards unless otherwise noted.

The parts of a County facility that do not comply with the 1991 ADA Standards (or the 2010 ADA Standards, as applicable), as listed in Attachments G, H, I, and J, of the consent decree, prevent people with disabilities from fully and equally enjoying the County's programs, services, or activities and constitute discrimination on the basis of disability within the meaning of 42 U.S.C. § 12132 and 28 C.F.R. §§ 35.149-35.15110.

Facilities that are privately owned will remain under this consent decree whether or not the County continues to lease the facility to house programs, services and activities. As long as public accommodations continue to be provided in the facility, the requirement to remove barriers to access will remain in effect.

In addition, barrier removal priorities should reflect the way in which people use the facilities. For instance, if barrier removal is not completed and a person cannot reach the facility because there is no pedestrian access route from the public transportation provided to serve the building, or no accessible parking is provided, an accessible toilet room inside the building is of little use to people with disabilities.

In order to prioritize barrier removal within facilities for implementation we have correlated the County programs, activities and services that take place within buildings that serve people with disabilities with the barriers to access that have been identified. Barriers to access identified in the exterior and interior spaces have been prioritized according to the following criteria:

- **Priority 1**: Pedestrian route including access to the building from points of arrival and from the building site, including walkways and breezeways and potential hazards (see stairways below). Building entrances and lobby spaces
- **Priority 2**: Primary building functions (classrooms, meeting rooms, auditoriums, corridors, play areas, etc.)
- **Priority 3**: Restrooms, drinking fountains and benches or tables in public places
- **Priority 4**: Interior and exterior stairways, signage and remaining barriers that affect people with disabilities as a low severity barrier

Finalized barrier priorities can be influenced by information on other factors provided by the County of Humboldt. These factors include:

_

¹⁰ US v. County of Humboldt, Civil Action No. 16-5139, Section II.M: New Construction, Alterations, and Physical Changes to Facilities.



- Number and type of programs, services and activities that take place in the facility
- Frequency of use by the general public
- Age of facility (pre-1992 existing or new construction post-1992)
- Type of use (public, staff or mixed use)
- Long-term Facility Planning Goals
 - Infrastructure improvement projects
 - Facility replacement as part of future CIP plans

F. COST ESTIMATES

This report contains budgetary cost estimates provided to facilitate the remediation of barriers. Cost estimates are provided for physical elements only while the cost of implementing a new policy or practice cannot be accurately assessed at this point in the process. The actual cost estimates are calculated using RS Means Construction Cost Estimating data and in some instances where a barrier location can have several different barriers to access, one or more of the barriers may have a cost estimate of \$0 dollars. This is an intentional reporting mechanism as it reflects the fact that the cost to remove that particular barrier is part of a cost of one or more barriers at that same location.

For instance, where a door equipped with a door closer is identified with a non-compliant opening force, sweep period and a lack of required maneuvering clearance on one or both sides of that door, the recommended barrier removal solution is often to install an automatic door opening device (ADOD), which at the time of this assessment is estimated to cost \$5,000. If each of those barriers to access had been reported with a cost estimate, the estimate could amount to 3 times that much, or \$15,000 if the correction to 2 of the 3 cost estimates was not performed. The end result is intended to produce a budgetary cost estimate that does not include amounts that could exponentially increase the overall cost of barrier removal implementation plans.

G. EXTERIOR SPACES

This assessment process included identification of barriers to access within the pedestrian access route (accessible route within the public rights-of-way or PROW) that serves this facility. Under state and federal regulations and statutes, the pedestrian access route from points of arrival at public transportation stops (where provided), continuing through sidewalks (where provided) and walkways leading to the facility entrance must be accessible to people with disabilities in order to ensure that they can reach the facility where programs, services and activities are provided. This information is not contained in this report, but has been compiled into a separate report provided to each jurisdictional authority that owns the PROW that connects bus stops and sidewalks to this facility.

Where these jurisdictions make use of federal funding for roadway work, etc. the entity is required under the federal Rehabilitation Act of 1973 to ensure that the pedestrian access route is usable by and accessible to people with disabilities. The 1990 ADA Standards



provided additional requirements intended to ensure that these paths of travel are made fully accessible "as expeditiously as possible, but, in any event, by January 26, 1995".¹¹

At present, barriers were identified that appeared to be pre-ADA in some cases and these entities should be making progress on this work through a Rehabilitation Act Transition Plan since 1974 or ADA Transition Plan since 1992. If such plans are not in place, this information will be provided available to these entities, to allow them to make use of it when updating their existing remediation plans to comply with state and federal statutes and regulations.

This report contains barriers to access that are located within the facility site. There may be some overlap between site arrival points and a pedestrian connection to the facility entrance. In cases where the existing sidewalk is an essential part of the accessible route to the facility entrance, alterations must be made to the sidewalk to ensure that people with disabilities can make use of County programs, services and activities.

Owners of leased properties are likely to have responsibility for some of the sidewalk that borders their property.

As a public facility that was constructed before the passage of the ADA, the facility is required to have at least one accessible entrance and an accessible route provided within the building site that connects the existing sidewalk to the exterior and interior amenities provided, including a connection to public streets and sidewalks; and public transportation stops to the accessible building or facility entrance¹², as required by the 1990 and 2010 ADA Standards and California Code of Regulations Title 24.

H. FACILITY ENTRANCES

The public entrance to this facility is located at the front of the building across from an offstreet parking strip. No accessible parking is provided in the parking strip on the shortest possible route to the facility entrance.

¹¹ The Americans with Disabilities Act, Title II Technical Assistance Manual Covering State and Local Government Programs and Services, Section II-8.3000. See https://www.ada.gov/taman2.html#II-8.3000

¹² 2010 ADA Standards for Accessible Design, Section **206.2.1 Site Arrival Points**



I. REPORT FORMAT - DEFINITIONS

The state of the s	8/30/2016 Rep	oort Date: 9/:	13/2016 Bar	rier #: 1	
Facility:	Jail (Adult Detention	1)			- Maria
Location:	Pedestrian Path to B	Building			STATE OF THE PERSON NAMED IN
Official Respo	nsible:			8 11	1000
Facility Funct	ion: Public			Dwg: 1 of 2	
Barrier Area:	Walkways		Remediation	Required	
Barrier Type:	Detectable Warning	s - Hazardous	Vehicular Way		
Barrier	Detectable warning	(truncated do	mes) or vertical co	irh not provided :	at hazardous vohicular ar
Description:		,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	ines, or vertical or	and not provided t	at Hazardous verileurar ar
Description:	nces: CBC 11B-705.1.		ines, or vertical of	arb not provided (at hazardous venicular ar
Description:	ces: CBC 11B-705.1.	2.5	(8.)		gs installed where requir
Description: Code Referent As Built	ces: CBC 11B-705.1. Pedestrian path alor	2.5 ng vehicular tra	affic lane has no c	letectable warmin	//
Description: Code Referent As Built Description:	Provide truncated d	2.5 ng vehicular tra omes as detec	affic lane has no c	letectable wording	gs installed where requir
Description: Code Referei As Built Description: Proposed Solution:	Pedestrian path alor Provide truncated d building entry 194 Quantit	2.5 ng vehicular tra omes as detec	affic lane has no o table warning alo st Estimate: \$67	letectable warming pathway from 1900.00	gs installed where requir Chestput Avenue to

This is the Graphic User Interface (GUI) for the SZS database entry form. The name of each facility is located at the top of the form and the reports produced by the database have a similar format with identical fields although they are, in some instances, slightly different in size. A description for the data contained within each field is provided below:

- 1) Field Date: The date of the facility inspection.
- 2) Report Date: The date the report was compiled, revised or completed.
- 3) Barrier #: Individual number assigned to each barrier identified. The alphanumeric character assigned correlates with a room or space identified on the reference drawings provided with each report. This number allows the barrier to be pinpointed to a location within the facility.
- **4) Image:** Digital photograph provided for each barrier as a visual representation of the issue and context.
- 5) Facility: Name of building, park or parking lot where the inspection was performed
- 6) Location: Area or space within the facility where a barrier is identified
- **7) Official Responsible:** Person responsible for overseeing the policies and practices implemented through this process



- 8) Facility Function (Public/Staff): Designates barriers as located in either staff or public areas. Most barriers identified are designated for public use. Different requirements exist for public and staff use areas.
- 9) Reference Drawing (Dwg): Floor, site plans or aerial maps of the designated facility where the assessment was performed. Each reference drawing provides correlation between the barrier number listed in the report (see item 3 above) and the actual physical location where the barrier was identified.
- **10) Barrier Area:** Provides a grouping of similar barriers identified in specific spaces (E.G.: Restrooms, Doors and Gates, Stairs, Ramps, Sidewalk, Walkways)
- **11) Remediation:** Indicates whether a barrier is in direct violation of the federal and state codes and statutes and must be remediated or whether the remediation is recommended as a best practice. One of two options exist: (Required) or (Recommended).
- **12) Barrier Type:** Identifies the type of physical element or area defined by California Building Code and the ADA Standards used to identify non-compliance. The categories of barriers contained in the database include:

Alarms
Assembly Areas
Blended Transitions
Bus Stops & Shelters
Classrooms
Clear Floor Space
Controls and Mechanisms
Corridors
Counters and Tables
Curb Ramps
Dining Facilities
Doors or Gates
Drinking Fountains
Elevators
Kitchens
Outdoor Areas Access Route
Parking
Passenger Loading Zones (Drop-Off)
Picnic Facilities
Play Areas
Public Phones
Ramps
Restrooms
Signage
Stairways
Street Furniture
Swimming Pools



Turning Space	
Walkways	

- **13) Requirement (Barrier Description):** Code language or performance standard that describes barrier identified.
- **14) Code References:** Applicable state and federal codes regulating the entities compliance. Each code reference is specific to each barrier and identifies the section of code which regulates compliance to that specific element (doors, parking stalls, sidewalks, etc.). Where a best practice is recommended, the term *Performance Standard* identifies the barrier to access documented in the barrier data record.
- **15) As Built Description (Desc):** Also known as the *findings*, information describes the barrier.
- **16) Proposed Solution:** Provides one suggested solution for the remediation of the barrier identified. Please note that other options may exist to bring items into compliance. Other solutions may exist and all solutions cannot be accounted for in this report. The suggested solution is generally the most common way of remediating this particular barrier.
- **17)** As Built Measure: Actual field measurement number for square footage (SF), linear footage (LF), or a single value (EACH or JOB) used to indicate physical dimension of barrier and calculate cost estimate.
- 18) Quantity: Unit of measure for the remediation of each barrier (SF, LF, EACH or JOB).
- **19) Cost Estimate:** Budgetary Cost Estimate to remove the barrier described.
- **20) Barrier Severity Rating (BSR):** A systematic, research based rating that describes how severely each barrier affects usability for the particular element.
- 21) X Coordinate: Geographic coordinate that provides the longitude (north-south) value
- 22) Y Coordinate: Geographic coordinate that provides the latitude (east-west) value
- 23) Z Coordinate: Geographic coordinate that provides the elevation value
- 24) Implementation Priority: N/A
- 25) Implementation Phase: N/A
- **26) Implementation Date:** Scheduled year or date as to when the remediation of the barrier will take place within the consent decree schedule. This field can be scheduled during phasing and changed to a specific date after the barrier is remediated and the record is closed.
- **27) Status (Open or Closed):** An implementation management tool that can flag barriers to indicate that they have been remediated or are remaining in the implementation phasing plan. Barrier data records have a "Closed" status when completed or have an "Open" status when they remain scheduled for remediation. This can be useful when remediation is



performed by both maintenance staff and design professionals within the construction process.

28) Notes: Open field where additional explanation of the findings can be noted when encountering unusual situations in the field, or to note programmatic access solutions. The notes field can contain the image file name shown in the barrier data record, or additional information as needed such as an explanation of findings, or information on associated barriers in the same or similar locations.

EXTERIOR SPACES

This narrative reflects the findings at the time of the original inspection. Overtime, barrier remediation has taken place and the original findings may no longer reflect present conditions.

The path of travel from the nearest bus stop was assessed as part of the scope of work. People with disabilities often travel using regional transit and must have an accessible route that allows them to reach the facility. Barriers to access were identified which may be the responsibility of another local jurisdiction to remediate. The jurisdiction should be contacted in order to ensure that these barriers are removed so that the County program, services and activities that take place in this location are accessible to people with disabilities.

The off-street parking strip has no accessible parking, although it is located across from the main building entrance. Seven (7) parking stalls are located in the parking strip and at least one accessible parking stall must be located on the on the shortest possible route to the building entrance.

The facility has a main entrance located along a walkway where the door landing was identified as lacking the required maneuvering clearance for people who use wheelchairs. The installation of an automatic door opening device could remediate this barrier to access.

INTERIOR SPACES

This narrative reflects the findings at the time of the original inspection. Overtime, barrier remediation has taken place and the original findings may no longer reflect present conditions.

The entrance door was identified with non-accessible door landing, operating force, signage, kickplate and threshold. Tactile signs and signs identifying the main entrance as accessible were not provided within the facility. The lobby was identified without a space for a person using a wheelchair to wait in the seating area and two accessible service counters were identified as protruding into the public circulation path for pedestrians. Although a water cooler was provided, no drinking fountain was identified in this facility, although California Building Code requires both a drinking fountain, and separate men and women's toilet rooms. One unisex toilet room was identified in the facility. While the room had adequate maneuvering clearance, the entry door signage and maneuvering clearance were not identified as accessible. The lavatory and rear grab bar also were not accessible. Alterations are required to provide access.




The facility is primarily comprised of offices where programs, services and activities are provided to the public. This assessment process has not included the determination of whether program accessibility can be applied in some of the offices. A determination must be made as to which programs, services and activities could be relocated, as few if any of the offices presently have adequate maneuvering clearance to allow a person using a wheelchair to enter, circulate and exit, without removing furniture or moving walls.

Entrance and exit doors associated with spaces where programs, services or activities take place in this facility were identified with non-compliant operating force or sweep periods. In instances where the door has a door closer and is not a fire rated door, or part of a fire rated assembly, the door closer may be removed to mitigate the barrier to access. If the door closer is to remain in place within a fire rated assembly, due to privacy concerns, etc., measures must be taken to ensure that the operating force and sweep period comply. If the existing door closer cannot be adjusted to comply for an extended period of time, the remaining options to ensure compliance are, first; to install new door closers that function at maximum 5 pounds of force and at least 5 seconds of sweep before reaching 12 degrees from the door frame (approx. 5 inches) consistently.

If the new door closer installed to comply is assessed and found not to function within these parameters, an automatic door opening device must be installed. An automatic door opening device has been identified by the California Building Standards Commission and the California Division of State Architect, as the only solution that meets both fire code requirements for fire doors, and accessibility requirements contained in the ADA and California Building Code, Section 11B, as well as California Government Code, Civil Code and Health and Safety Code.

Some doors in the facility were not equipped with door closer devices, but also lacked required maneuvering clearance at the exit side of the doors. In these instances, it may be possible to change the door swing to provide the required maneuvering clearance. Otherwise, an automatic door opening device could be installed to compensate for the lack of space. Some office doors were identified as too narrow for people using wheelchair to pass through. Where these doors are used by the public to access county programs, services and activities, they must be replaced with accessible doors.

The following barrier data records provide more detailed information on the barriers described above.

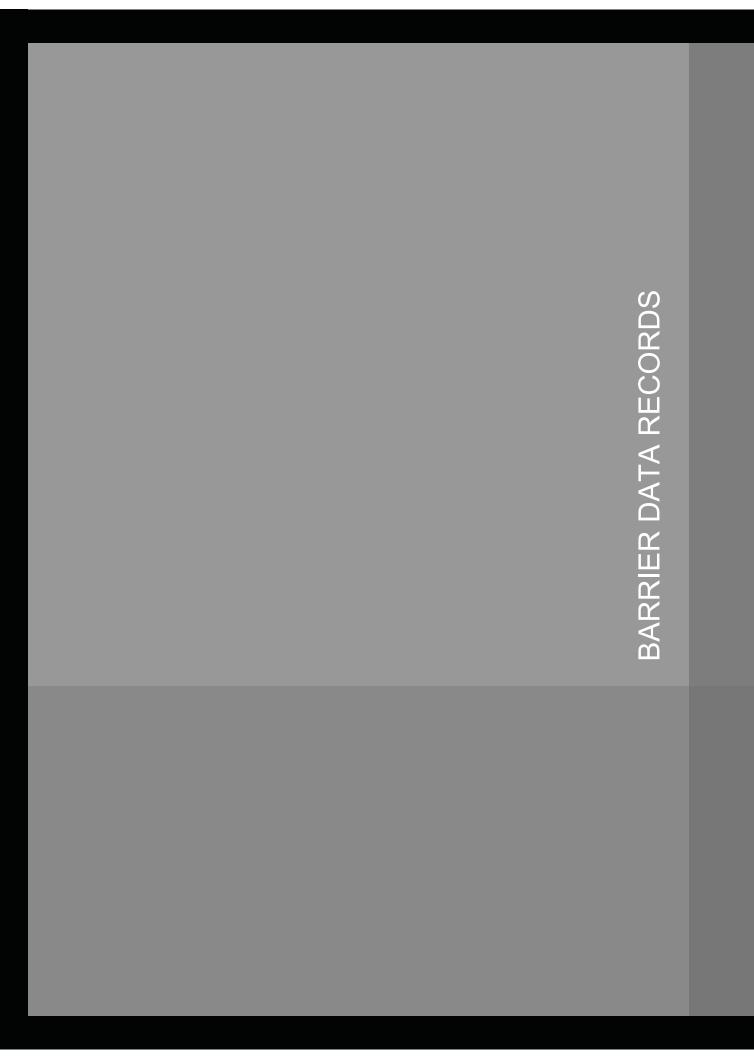



Field Date: 11/13/2017 Report Date: 8/3/2018 Barrier #: 1
Facility: Community Corrections Resource Center - 404 H St, Eureka
Location: Exterior - Walkway to Building
Official Responsible: Karen Clower, ADA Coordinator
Consent Decree: No Paragraph: M.51 Dwg: N/A
Barrier Area: Accessible Route - Exterior Remediation: Required
Barrier Type: Running Slope - Existing (8.3% or more)
Barrier Accessible route running slope exceeds 5.0% (8.3% or more) Description:
Code References: CBC 11B-403.3 and 2010 ADAS 403.3
As Built 10.8% running slope Description:
Proposed Solution: Provide handrails with wheelguide on both sides of ramp, and required landings. Where drop exceeds 30", provide guardrail.
As-Built Meas: 4 Quantity: LF Cost Estimate: \$1,460.00 BSR: 1 Necessary
X Coordinate: -124.164241 Y Coordinate: 40.802916 Z Coordinate: 22.9073029999999
Implementation: Priority 1 Phase Date Status Open
Notes: Property Owner Responsible- Property Owner states this barrier will be removed as part of Cal-Tran project to improve 4th Street accessibility.
Field Date: 11/13/2017 Report Date: 8/3/2018 Barrier #: 2
Facility: Community Corrections Resource Center - 404 H St, Eureka
Location: Exterior - Walkway to Building
Official Responsible: Karen Clower, ADA Coordinator
Consent Decree: No Paragraph: M.51 Dwg: N/A
Barrier Area: Accessible Route - Exterior Remediation: Required
Barrier Type: Cross Slope - Existing (2.1% to 3.0%)
Barrier Cross slope exceeds 2.0% (2.1% to 3.0%) Description:
Code References: CBC 11B-403.3 and 2010 ADAS 403.3
As Built Description: 2.1% - 2.3% cross slope
Proposed Demolish existing and construct new route Solution:
As-Built Meas: 10 Quantity: LF Cost Estimate: \$1,250.00 BSR: 4 Low Severity
X Coordinate: -124.164240 Y Coordinate: 40.802896 Z Coordinate: 22.9073029999999
Implementation: Priority 1 Phase Date Status Open
Notes: Property Owner Responsible- Property Owner states this barrier will be removed as part of Cal-Trans project to improve 4th Street accessibility.



Field Date:	11/13/2017 Report Date: 8/3/2018 Barrier #: 3A
Facility:	Community Corrections Resource Center - 404 H St, Eureka
Location:	Exterior - Parking Lot
Official Respo	nsible: Karen Clower, ADA Coordinator
Consent Decre	ee: No Paragraph: M.51 Dwg: N/A
Barrier Area:	Parking Remediation: Required
Barrier Type:	Tow-Away Sign
Barrier Description:	No tow-away sign provided at lot entry or accessible stalls
Code Referen	ces: CBC 11B-502.8
As Built Description:	No sign provided
Proposed Solution:	Provide compliant sign
As-Built Meas	: 1 Quantity: EACH Cost Estimate: \$250.00 BSR: 2 Recommended
X Coordinate:	-124.164189 Y Coordinate: 40.802857 Z Coordinate: 22.9073029999999
Implementati	on: Priority 1 Phase Date Status Open
Notes: Pro	operty Owner Responsible- Parking lot is not part of county lease with property owner.
Field Date:	11/13/2017 Report Date: 8/3/2018 Barrier #: 3B
Facility:	Community Corrections Resource Center - 404 H St, Eureka
Location:	Exterior - Parking Lot
Official Respo	nsible: Karen Clower, ADA Coordinator
Consent Decre	ee: No Paragraph: M.51 Dwg: N/A
Consent Decre Barrier Area:	
Barrier Area:	
Barrier Area:	Parking Remediation: Required
Barrier Area: Barrier Type: Barrier Description:	Parking Remediation: Required Accessible Stall Ratio - 1-25 total stalls
Barrier Area: Barrier Type: Barrier Description:	Parking Remediation: Required Accessible Stall Ratio - 1-25 total stalls Minimum of 1 accessible stall not provided in lot/structure
Barrier Area: Barrier Type: Barrier Description: Code Referen	Parking Remediation: Required Accessible Stall Ratio - 1-25 total stalls Minimum of 1 accessible stall not provided in lot/structure ces: CBC 11B-208.2 and 2010 ADAS 208.2
Barrier Area: Barrier Type: Barrier Description: Code Referent As Built Description: Proposed	Parking Accessible Stall Ratio - 1-25 total stalls Minimum of 1 accessible stall not provided in lot/structure ces: CBC 11B-208.2 and 2010 ADAS 208.2 7 total stalls with no accessible stall provided Provide at least 1 accessible stall including 1 van accessible stall
Barrier Area: Barrier Type: Barrier Description: Code Reference As Built Description: Proposed Solution: As-Built Meas	Parking Accessible Stall Ratio - 1-25 total stalls Minimum of 1 accessible stall not provided in lot/structure ces: CBC 11B-208.2 and 2010 ADAS 208.2 7 total stalls with no accessible stall provided Provide at least 1 accessible stall including 1 van accessible stall
Barrier Area: Barrier Type: Barrier Description: Code Reference As Built Description: Proposed Solution: As-Built Meas	Parking Remediation: Required Accessible Stall Ratio - 1-25 total stalls Minimum of 1 accessible stall not provided in lot/structure ces: CBC 11B-208.2 and 2010 ADAS 208.2 7 total stalls with no accessible stall provided Provide at least 1 accessible stall including 1 van accessible stall : 1 Quantity: EACH Cost Estimate: \$12,600.00 BSR: 1 Necessary -124.164189 Y Coordinate: 40.802857 Z Coordinate: 22.9073029999999



Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 Barrie	r#: 4A	
Facility:	Community Correction	ns Resource Center - 404 H St, Eu	ıreka	
Location:	Main Entrance			
Official Respo	nsible: Karen Clower	, ADA Coordinator		
Consent Decre	ee: No	Paragraph: M.51 D	wg: 1 of 1	
Barrier Area:	Signage	Remediation:	N/A	
Barrier Type:	Room ID Sign - No Tac	tile Information		
Barrier Description:	Room ID sign provided	d for sighted people lacks tactile i	info for the visually	impaired
Code Referen	ces: CBC 11B-216.2 ar	nd 2010 ADAS 216.2		
As Built Description:	Compliant tactile sign	provided		
Proposed Solution:	Barrier removed			
As-Built Meas	: 0 Quantity:	EACH Cost Estimate: \$0.00	BSR: 1	Necessary
X Coordinate:	N/A	Y Coordinate: N/A	Z Coordinate	e: N/A
Implementati	on: Priority 4	Phase Date	12/18/2019	Status Closed
Notes:				
Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 Barrie	r#: 4B	9
Facility:	Community Correction	ns Resource Center - 404 H St, Eu	ıreka	Marconit Centerons
Location:	Main Entrance		A	
Official Respo	nsible: Karen Clower	, ADA Coordinator		
Consent Decre	ee: No	Paragraph: M.51 D	wg: 1 of 1	- Marie
Barrier Area:				
barrier / irea.	Signage	Remediation:	I/A	
	Signage ISA - Accessible Entry	Remediation: N	N/A	
	-		I/A	
Barrier Type: Barrier Description:	ISA - Accessible Entry	or as accessible	I/A	
Barrier Type: Barrier Description:	ISA - Accessible Entry No sign identifying do	or as accessible nd 2010 ADAS 216.6	I/A	
Barrier Type: Barrier Description: Code Referen As Built	No sign identifying docces: CBC 11B-216.6 ar	or as accessible nd 2010 ADAS 216.6	J/A	
Barrier Type: Barrier Description: Code Referen As Built Description: Proposed	No sign identifying docces: CBC 11B-216.6 ar Accessible entrance has Barrier removed	or as accessible nd 2010 ADAS 216.6 as no ISA sign		Necessary
Barrier Type: Barrier Description: Code Referen As Built Description: Proposed Solution:	No sign identifying doces: CBC 11B-216.6 ar Accessible entrance has Barrier removed CQUARTIES CONTRACTOR CONT	or as accessible nd 2010 ADAS 216.6 as no ISA sign		
Barrier Type: Barrier Description: Code Referen As Built Description: Proposed Solution: As-Built Meas	No sign identifying doces: CBC 11B-216.6 ar Accessible entrance has Barrier removed CONTRACTOR Quantity:	or as accessible ad 2010 ADAS 216.6 as no ISA sign EACH Cost Estimate: \$0.00 Y Coordinate: N/A	BSR: 1	



Field Date:	11/13/2017 Repo	ort Date: 8/3/2018 Barrier #:	4C
Facility:	Community Correctio	ns Resource Center - 404 H St, Eurek	
Location:	Main Entrance		
Official Respo	nsible: Karen Clowe	r, ADA Coordinator	
Consent Decre	ee: No	Paragraph: M.51 Dwg:	1 of 1
Barrier Area:	Doors or Gates	Remediation: Requ	ired
Barrier Type:	Door Closer - Exterior	Adjustment	
Barrier Description:	Door opening force ex	cceeds 5 lbf	
Code Referen	ces: CBC 11B-404.2.9		
As Built Description:	10 lbf		
Proposed Solution:	Install automatic door	opening device to compensate for a	lack of maneuvering clearance
As-Built Meas	: 1 Quantity:	EACH Cost Estimate: \$5,000.00	BSR: 1 Necessary
X Coordinate:	N/A	Y Coordinate: N/A	Z Coordinate: N/A
Implementati	on: Priority 2	Phase Date	Status Open
Notes: Co	ounty Responsible.		
Field Date:	11/13/2017 Repo	ort Date: 8/3/2018 Barrier #:	4D
Field Date: Facility:		ort Date: 8/3/2018 Barrier #:	BOOT COS
		*	BOOT CON
Facility:	Community Correctio	*	BOOT CON
Facility: Location:	Community Correctio Main Entrance nsible: Karen Clower	ns Resource Center - 404 H St, Eurek	BOOT CON
Facility: Location: Official Respo Consent Decre	Community Correctio Main Entrance nsible: Karen Clower	ns Resource Center - 404 H St, Eurek	1 of 1
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Correctio Main Entrance nsible: Karen Clower ee: No	r, ADA Coordinator Paragraph: M.51 Remediation: Requ	1 of 1
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Correction Main Entrance Insible: Karen Clower Ree: No Doors or Gates Door Closer - Exterior	r, ADA Coordinator Paragraph: M.51 Remediation: Requ	1 of 1
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Correction Main Entrance Insible: Karen Clower Ree: No Doors or Gates Door Closer - Exterior Door closer lacks min.	ns Resource Center - 404 H St, Eureka r, ADA Coordinator Paragraph: M.51 Dwg: Remediation: Requ	1 of 1
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Correction Main Entrance Insible: Karen Clower Ree: No Doors or Gates Door Closer - Exterior Door closer lacks min.	r, ADA Coordinator Paragraph: M.51 Remediation: Requisitions Record Sweep	1 of 1
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built	Community Correction Main Entrance Insible: Karen Clower Insible: Insible Clower Insible: Insible: Insible Clower Insible: In	r, ADA Coordinator Paragraph: M.51 Remediation: Requisitions Record Sweep	1 of 1
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built Description: Proposed	Community Correction Main Entrance Insible: Karen Clower Insible: Karen Clower Install automatic door Community Correction Rate Clower Install automatic door A second sweep Community Correction Rate Clower Install automatic door A second sweep Community Correction Rate Clower Rate	ns Resource Center - 404 H St, Eurekanner, ADA Coordinator Paragraph: M.51 Dwg: Remediation: Requisite Sweep 5 second sweep period/back check 1 and 2010 ADAS 404.2.8.1	1 of 1
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built Description: Proposed Solution:	Community Correction Main Entrance Insible: Karen Clower Insible: Karen Clower Install automatic door Community Correction Install automatic door Install automatic door Install automatic door Install Quantity: Install Quantity: Install Quantity: Install Agency Correction Instal	ns Resource Center - 404 H St, Eurekanner, ADA Coordinator Paragraph: M.51 Dwg: Remediation: Requisite Sweep 5 second sweep period/back check 1 and 2010 ADAS 404.2.8.1	1 of 1 ired lack of maneuvering clearance
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built Description: Proposed Solution: As-Built Meas	Community Correction Main Entrance Insible: Karen Clower Insible: Karen Clower Insible: Karen Clower Install automatic door	Remediation: Requisite Sweep 5 second sweep period/back check 1 and 2010 ADAS 404.2.8.1 Fopening device to compensate for a EACH Cost Estimate: \$0.00	1 of 1 iired BSR: 2 Recommended



Field Date:	11/13/2017 Repo	ort Date: 8/3/2018 Ba	arrier #: 4E	
Facility:	Community Correction	ns Resource Center - 404 H S	it, Eureka	
Location:	Main Entrance			
Official Respo	nsible: Karen Clowe	r, ADA Coordinator		
Consent Decr	ee: No	Paragraph: M.51	Dwg: 1 of	1
Barrier Area:	Doors or Gates	Remediatio	n: Required	
Barrier Type:	Maneuvering Cl - Fro	nt App/Pull 60"		
Barrier Description:	Door/Gate at pull sid	e lacks min. 60" perpendicula	r to door	
Code Referen	ces: CBC Figure 11B-4	04.2.4.1 and 2010 ADAS 404	.2.4.1	
As Built Description:	59" maneuvering clea	rance at pull side of door exc	cluding 6" curl	0
Proposed Solution:	Install automatic doo	r opening device to compens	ate for a lack	of maneuvering clearance
As-Built Meas	: 0 Quantity	EACH Cost Estimate: \$(0.00	BSR: 1 Necessary
X Coordinate:	N/A	Y Coordinate: N/A	ZC	Coordinate: N/A
Implementati	on: Priority 2	Phase	Date	Status Open
Notes: Cour	nty Responsibility.			
Field Date:	12/18/2019 Rep	ort Date: 12/18/2019 Ba	arrier #: 4F	Thuo o
Facility:	Community Correction	ns Resource Center - 404 H S	it, Eureka	
Location:	Main Entrance			
Official Respo	nsible: Karen Clowe	r, ADA Coordinator		
Consent Decr	ee: No	Paragraph: M.51	Dwg: 1 of	1
Barrier Area:	Signage	Remediatio	n: N/A	
Barrier Type:	Tactile Exit Sign - Exit			
Barrier Description:	Ground floor doors th	at exit to exterior not provid	led with signs	stating "EXIT"
Code Referen	ces: CBC 11B-216.4.1	& 11B-703 and 2010 ADAS 2	16.4.1	
As Built Description:	New tactile sign prov	ded where required		
Proposed Solution:	Barrier removed			
	l			
As-Built Meas	: 0 Quantity	EACH Cost Estimate: \$0	0.00	BSR: 1 Necessary
As-Built Meas X Coordinate:	-	EACH Cost Estimate: \$0		BSR: 1 Necessary Coordinate: N/A
	N/A	Y Coordinate: N/A		Coordinate: N/A



Field Date:	11/13/2017 Report Date: 8/3/2018 Barrier #: 4G
Facility:	Community Corrections Resource Center - 404 H St, Eureka
Location:	Main Entrance
Official Respo	nsible: Karen Clower, ADA Coordinator
Consent Decr	ee: No Paragraph: M.51 Dwg: 1 of 1
Barrier Area:	Doors or Gates Remediation: N/A
Barrier Type:	Doormats
Barrier Description:	Doormat not anchored to floor (trip hazard)
Code Referen	ces: CBC 11B-302.2 and 2010 ADAS 302.2
As Built Description:	Existing door mat not recessed or secured
Proposed Solution:	Secure mat to floor. When mat provides equivalent facilitation on a non-slip resistant floor, the mat may stay in place when maintained.
As-Built Meas	2 Quantity: EACH Cost Estimate: \$0.00 BSR: 1 Necessary
X Coordinate:	N/A Y Coordinate: N/A Z Coordinate: N/A
Implementati	on: Priority 2 Phase Date 11/13/2017 Status Closed
Notes:	
Field Date:	12/18/2019 Report Date: 12/18/2019 Barrier #: 5A
Field Date: Facility:	12/18/2019 Report Date: 12/18/2019 Barrier #: 5A Community Corrections Resource Center - 404 H St, Eureka
Facility:	Community Corrections Resource Center - 404 H St, Eureka Main Lobby 1
Facility: Location:	Community Corrections Resource Center - 404 H St, Eureka Main Lobby 1 Insible: Karen Clower, ADA Coordinator
Facility: Location: Official Respo	Community Corrections Resource Center - 404 H St, Eureka Main Lobby 1 Insible: Karen Clower, ADA Coordinator
Facility: Location: Official Responsent Decre Barrier Area:	Community Corrections Resource Center - 404 H St, Eureka Main Lobby 1 Insible: Karen Clower, ADA Coordinator ee: No Paragraph: M.51 Dwg: 1 of 1
Facility: Location: Official Responsent Decre Barrier Area:	Community Corrections Resource Center - 404 H St, Eureka Main Lobby 1 Insible: Karen Clower, ADA Coordinator ee: No Paragraph: M.51 Dwg: 1 of 1 Controls and Mechanisms Remediation: N/A
Facility: Location: Official Responsion Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Corrections Resource Center - 404 H St, Eureka Main Lobby 1 Insible: Karen Clower, ADA Coordinator ee: No Paragraph: M.51 Dwg: 1 of 1 Controls and Mechanisms Remediation: N/A Operable Part - Clear Floor Space (Stored Items)
Facility: Location: Official Responsion Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Corrections Resource Center - 404 H St, Eureka Main Lobby 1 Insible: Karen Clower, ADA Coordinator ee: No Paragraph: M.51 Dwg: 1 of 1 Controls and Mechanisms Remediation: N/A Operable Part - Clear Floor Space (Stored Items) Clear floor space for person using wheelchair not provided at operable part
Facility: Location: Official Responsion Consent Decr Barrier Area: Barrier Type: Barrier Description: Code Referent As Built	Community Corrections Resource Center - 404 H St, Eureka Main Lobby 1 Insible: Karen Clower, ADA Coordinator ee: No Paragraph: M.51 Dwg: 1 of 1 Controls and Mechanisms Remediation: N/A Operable Part - Clear Floor Space (Stored Items) Clear floor space for person using wheelchair not provided at operable part ces: CBC 11B-305.3 and 2010 ADAS 305.3
Facility: Location: Official Responsion Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referent As Built Description: Proposed	Community Corrections Resource Center - 404 H St, Eureka Main Lobby 1 Insible: Karen Clower, ADA Coordinator ee: No Paragraph: M.51 Dwg: 1 of 1 Controls and Mechanisms Remediation: N/A Operable Part - Clear Floor Space (Stored Items) Clear floor space for person using wheelchair not provided at operable part ces: CBC 11B-305.3 and 2010 ADAS 305.3 Chairs moved. Access to flyers provided Barrier removed Es: O Quantity: JOB Cost Estimate: \$0.00 BSR: 1 Necessary
Facility: Location: Official Responsion Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referent As Built Description: Proposed Solution:	Community Corrections Resource Center - 404 H St, Eureka Main Lobby 1 Insible: Karen Clower, ADA Coordinator ee: No Paragraph: M.51 Dwg: 1 of 1 Controls and Mechanisms Remediation: N/A Operable Part - Clear Floor Space (Stored Items) Clear floor space for person using wheelchair not provided at operable part ces: CBC 11B-305.3 and 2010 ADAS 305.3 Chairs moved. Access to flyers provided Barrier removed Egyptimize Controls and Mechanisms Remediation: N/A Dwg: 1 of 1 Controls and Mechanisms Remediation: N/A Operable Part - Clear Floor Space (Stored Items) Clear floor space for person using wheelchair not provided at operable part ces: CBC 11B-305.3 and 2010 ADAS 305.3 Chairs moved. Access to flyers provided
Facility: Location: Official Responsion Consent Decripance Barrier Area: Barrier Type: Barrier Description: Code Referent As Built Description: Proposed Solution: As-Built Meas	Community Corrections Resource Center - 404 H St, Eureka Main Lobby 1 Insible: Karen Clower, ADA Coordinator ee: No Paragraph: M.51 Dwg: 1 of 1 Controls and Mechanisms Remediation: N/A Operable Part - Clear Floor Space (Stored Items) Clear floor space for person using wheelchair not provided at operable part ces: CBC 11B-305.3 and 2010 ADAS 305.3 Chairs moved. Access to flyers provided Barrier removed Signature: Space (Stored Items) Barrier removed Signature: Space (Stored Items) Clear floor space for person using wheelchair not provided at operable part Ces: CBC 11B-305.3 and 2010 ADAS 305.3 Chairs moved. Access to flyers provided



Field Date: 12/18/2019 Report Date: 12/18/2019 Barrier #: 5B	
Facility: Community Corrections Resource Center - 404 H St, Eureka	
Location: Main Lobby 1	
Official Responsible: Karen Clower, ADA Coordinator	
Consent Decree: No Paragraph: M.51 Dwg: 1 of 1	
Barrier Area: Controls and Mechanisms Remediation: N/A	
Barrier Type: Flyer Holder - High Reach Range	
Barrier Flyer holder point of control not at max. 48" high reach Description:	
Code References: CBC 11B-308.2.1 and 2010 ADAS 308.2.1	
As Built Flyers moved to 48" high Description:	
Proposed Barrier removed Solution:	
As-Built Meas: 0 Quantity: JOB Cost Estimate: \$0.00 BSR: 3 Hindrance	
X Coordinate: N/A Y Coordinate: N/A Z Coordinate: N/A	
Implementation: Priority 2 Phase Date 12/18/2019 Status Closed	
Notes:	
Field Date: 12/18/2019 Report Date: 12/18/2019 Barrier #: 5C	
Facility: Community Corrections Resource Center - 404 H St, Eureka	
Location: Main Lobby 1	
Official Responsible: Karen Clower, ADA Coordinator	
Consent Decree: No Paragraph: M.51 Dwg: 1 of 1	
Barrier Area: Controls and Mechanisms Remediation: N/A	
Barrier Type: Electrical Outlets - Clear Floor Space (Stored Items)	
Barrier Clear floor space for wheelchair not provided at electrical outlet Description:	
Code References: CBC 11B-305.3 and 2010 ADAS 305.3	
As Built Chair moved to provide clear floor space Description:	
Proposed Barrier removed Solution:	
	$\overline{}$
As-Built Meas: 0 Quantity: JOB Cost Estimate: \$0.00 BSR: 1 Necessary	
As-Built Meas: 0 Quantity: JOB Cost Estimate: \$0.00 BSR: 1 Necessary X Coordinate: N/A Z Coordinate: N/A	



Field Date:	12/18/2019 Report Date: 12/18/2019 Barrier #: 5D
Facility:	Community Corrections Resource Center - 404 H St, Eureka
Location:	Main Lobby 1
Official Respo	nsible: Karen Clower, ADA Coordinator
Consent Decre	ee: No Paragraph: M.51 Dwg: 1 of 1
Barrier Area:	Controls and Mechanisms Remediation: N/A
Barrier Type:	Operable Part - Clear Floor Space (Stored Items)
Barrier Description:	Clear floor space for person using wheelchair not provided at operable part
Code Referen	Ces: CBC 11B-305.3 and 2010 ADAS 305.3
As Built Description:	Hand sanitizer dispenser removed
Proposed Solution:	Barrier removed
As-Built Meas	Quantity: JOB Cost Estimate: \$0.00 BSR: 1 Necessary
X Coordinate:	N/A Y Coordinate: N/A Z Coordinate: N/A
Implementati	on: Priority 2 Phase Date 12/18/2019 Status Closed
Notes:	
Field Date:	12/18/2019 Report Date: 12/18/2019 Barrier #: 5E
Field Date: Facility:	12/18/2019 Report Date: 12/18/2019 Barrier #: 5E Community Corrections Resource Center - 404 H St, Eureka
Facility: Location:	Community Corrections Resource Center - 404 H St, Eureka
Facility: Location:	Community Corrections Resource Center - 404 H St, Eureka Main Lobby 1 nsible: Karen Clower, ADA Coordinator
Facility: Location: Official Respo Consent Decre	Community Corrections Resource Center - 404 H St, Eureka Main Lobby 1 nsible: Karen Clower, ADA Coordinator
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Corrections Resource Center - 404 H St, Eureka Main Lobby 1 nsible: Karen Clower, ADA Coordinator ee: No Paragraph: M.51 Dwg: 1 of 1
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Corrections Resource Center - 404 H St, Eureka Main Lobby 1 nsible: Karen Clower, ADA Coordinator ee: No Paragraph: M.51 Dwg: 1 of 1 Controls and Mechanisms Remediation: N/A
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Corrections Resource Center - 404 H St, Eureka Main Lobby 1 nsible: Karen Clower, ADA Coordinator ee: No Paragraph: M.51 Dwg: 1 of 1 Controls and Mechanisms Remediation: N/A Operable Part - Side Reach High (Safe Harbor)
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Corrections Resource Center - 404 H St, Eureka Main Lobby 1 Insible: Karen Clower, ADA Coordinator Insible: No Paragraph: M.51 Dwg: 1 of 1 Controls and Mechanisms Remediation: N/A Operable Part - Side Reach High (Safe Harbor) Operable part at max. 54" high
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built	Community Corrections Resource Center - 404 H St, Eureka Main Lobby 1 nsible: Karen Clower, ADA Coordinator ee: No Paragraph: M.51 Dwg: 1 of 1 Controls and Mechanisms Remediation: N/A Operable Part - Side Reach High (Safe Harbor) Operable part at max. 54" high Ces: ADA Title II, Subpart D, § 35.150 Existing facilities § 35.150(b)(2)(i)
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built Description: Proposed	Community Corrections Resource Center - 404 H St, Eureka Main Lobby 1 nsible: Karen Clower, ADA Coordinator ee: No Paragraph: M.51 Dwg: 1 of 1 Controls and Mechanisms Remediation: N/A Operable Part - Side Reach High (Safe Harbor) Operable part at max. 54" high ces: ADA Title II, Subpart D, § 35.150 Existing facilities § 35.150(b)(2)(i) Hand sanitizer dispenser removed Barrier removed
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built Description: Proposed Solution:	Community Corrections Resource Center - 404 H St, Eureka Main Lobby 1 Insible: Karen Clower, ADA Coordinator Insible: No Paragraph: M.51 Dwg: 1 of 1 Controls and Mechanisms Remediation: N/A Operable Part - Side Reach High (Safe Harbor) Operable part at max. 54" high Ces: ADA Title II, Subpart D, § 35.150 Existing facilities § 35.150(b)(2)(i) Hand sanitizer dispenser removed Barrier removed D Quantity: EACH Cost Estimate: \$0.00 BSR: 3 Hindrance
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built Description: Proposed Solution: As-Built Meas	Community Corrections Resource Center - 404 H St, Eureka Main Lobby 1 Insible: Karen Clower, ADA Coordinator Re: No Paragraph: M.51 Dwg: 1 of 1 Controls and Mechanisms Remediation: N/A Operable Part - Side Reach High (Safe Harbor) Operable part at max. 54" high Ces: ADA Title II, Subpart D, § 35.150 Existing facilities § 35.150(b)(2)(i) Hand sanitizer dispenser removed Barrier removed Barrier removed O Quantity: EACH Cost Estimate: \$0.00 BSR: 3 Hindrance N/A Z Coordinate: N/A Z Coordinate: N/A



Field Date:	12/18/2019 Repo	ort Date: 12/18/2019 Barrier #: 5F			
Facility:	Community Corrections Resource Center - 404 H St, Eureka				
Location:	Main Lobby 1				
Official Respo	nsible: Karen Clower	r, ADA Coordinator			
Consent Decr	ee: No	Paragraph: M.51 Dwg: 1 of 1			
Barrier Area:	Counters and Tables	Remediation: N/A			
Barrier Type:	Counter - Protruding (Object			
Barrier Description:	Counter or table in ro	ute of travel protrudes more than 4" above 27" high			
Code Referen	ces: CBC 11B-307 and	2010 ADAS 307			
As Built Description:	Detectable warning in	stalled with leading edge below 27" high on each side.			
Proposed Solution:	Barrier removed				
As-Built Meas	: 0 Quantity:	EACH Cost Estimate: \$0.00 BSR: 1 Necessary			
X Coordinate:	N/A	Y Coordinate: N/A Z Coordinate: N/A			
Implementati	on: Priority 2	Phase Date 12/18/2019 Status Closed			
Notes:					
Field Date:	12/18/2019 Repo	ort Date: 12/18/2019 Barrier #: 5G			
Facility:	Community Correctio	ns Resource Center - 404 H St, Eureka			
Location:	Main Lobby 1				
Official Respo	nsible: Karen Clower	r, ADA Coordinator			
Consent Decr	ee: No	Paragraph: M.51 Dwg: 1 of 1			
Barrier Area:	Counters and Tables	Remediation: N/A			
Barrier Type:	Counter - Protruding (Object			
Barrier Description:	Counter or table in ro	ute of travel protrudes more than 4" above 27" high			
Code Referen	ces: CBC 11B-307 and	2010 ADAS 307			
As Built Description:	Detectable warning in	stalled with leading edge below 27" high on each side			
Proposed Solution:	Barrier removed				
As-Built Meas	: 0 Quantity:	EACH Cost Estimate: \$0.00 BSR: 1 Necessary			
X Coordinate:	N/A	Y Coordinate: N/A Z Coordinate: N/A			
Implementati	on: Priority 2	Phase Date 12/18/2019 Status Closed			
Notes:					



Field Date:	11/13/2017 Repo	rt Date: 8/3/2018 Ba	rrier #: 5H	
Facility:	Community Corrections Resource Center - 404 H St, Eureka			
Location:	Main Lobby 1			
Official Respo	nsible: Karen Clower,	ADA Coordinator		
Consent Decre	ee: No	Paragraph: M.51	Dwg: 1 of 1	
Barrier Area:	Controls and Mechanis	sms Remediation	i: N/A	
Barrier Type:	Electrical Switches - Sid	de Reach High (Safe Harbor)		
Barrier Description:	Light switch control bo	x top edge at max. 54" high	measured to top of b	ох
Code Referen	ces: ADA Title II, Subpa	art D, § 35.150 Existing facilit	ies § 35.150(b)(2)(i)	
As Built Description:	50-1/4" high			
Proposed Solution:	No remediation requir harbor	ed. Control or mechanism co	omplied with prior co	de and is granted safe
As-Built Meas	: 1 Quantity:	EACH Cost Estimate: \$0	.00 BSR:	4 Low Severity
X Coordinate:	N/A	Y Coordinate: N/A	Z Coordina	te: N/A
Implementati	on: Priority 2	Phase	Date 11/13/2017	Status Closed
Notes:				
Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 Ba	rrier #: 51	
Field Date: Facility:		rt Date: 12/18/2019 Ba		
		,		
Facility: Location:	Community Correction	s Resource Center - 404 H St		
Facility: Location:	Community Correction Main Lobby 1 nsible: Karen Clower	s Resource Center - 404 H St		
Facility: Location: Official Respo Consent Decre	Community Correction Main Lobby 1 nsible: Karen Clower	s Resource Center - 404 H St ADA Coordinator	Dwg: 1 of 1	
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Correction Main Lobby 1 nsible: Karen Clower, ee: No Clear Floor Space	ADA Coordinator Paragraph: M.51	Dwg: 1 of 1	
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Correction Main Lobby 1 nsible: Karen Clower, ee: No Clear Floor Space Clear Floor Space - Wh	ADA Coordinator Paragraph: M.51 Remediation	Dwg: 1 of 1	be accessible
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Correction Main Lobby 1 nsible: Karen Clower, ee: No Clear Floor Space Clear Floor Space - Wh	ADA Coordinator Paragraph: M.51 Remediation eelchair Use (Stored Items) n. 30" by 48" not provided a	Dwg: 1 of 1	be accessible
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Correction Main Lobby 1 nsible: Karen Clower, ee: No Clear Floor Space Clear Floor Space - Wh	ADA Coordinator Paragraph: M.51 Remediation eelchair Use (Stored Items) n. 30" by 48" not provided at	Dwg: 1 of 1	be accessible
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built	Community Correction Main Lobby 1 nsible: Karen Clower, ee: No Clear Floor Space Clear Floor Space - Wh Clear floor space of mi ces: CBC 11B-305 and	ADA Coordinator Paragraph: M.51 Remediation eelchair Use (Stored Items) n. 30" by 48" not provided at	Dwg: 1 of 1	o be accessible
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built Description: Proposed	Community Correction Main Lobby 1 nsible: Karen Clower, ee: No Clear Floor Space Clear Floor Space - Wh Clear floor space of mi ces: CBC 11B-305 and Chairs moved to provid	ADA Coordinator Paragraph: M.51 Remediation eelchair Use (Stored Items) n. 30" by 48" not provided at	Dwg: 1 of 1 N/A t element required to	be accessible 1 Necessary
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built Description: Proposed Solution:	Community Correction Main Lobby 1 nsible: Karen Clower, ee: No Clear Floor Space Clear Floor Space - Wh Clear floor space of mi ces: CBC 11B-305 and Chairs moved to provid Barrier removed : 1 Quantity:	ADA Coordinator Paragraph: M.51 Remediation eelchair Use (Stored Items) n. 30" by 48" not provided at	Dwg: 1 of 1 N/A t element required to	1 Necessary
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built Description: Proposed Solution: As-Built Meas	Community Correction Main Lobby 1 nsible: Karen Clower, ee: No Clear Floor Space Clear Floor Space - Wh Clear floor space of mi ces: CBC 11B-305 and Chairs moved to provid Barrier removed : 1 Quantity: N/A	ADA Coordinator Paragraph: M.51 Remediation eelchair Use (Stored Items) n. 30" by 48" not provided at 2010 ADAS 305 de wheelchair access JOB Cost Estimate: \$0. Y Coordinate: N/A	Dwg: 1 of 1 I: N/A t element required to	1 Necessary



Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 Barrier #:	5.1		
Facility:	Community Corrections Resource Center - 404 H St, Eureka				
Location:	Main Lobby 1				
Official Respo	nsible: Karen Clower	, ADA Coordinator			
Consent Decre	ee: No	Paragraph: M.51 Dwg:	1 of 1		
Barrier Area:	Alarms	Remediation: N/A			
Barrier Type:	Strobe - Location belo	w 80"			
Barrier Description:	Strobe mounted below	v 80" AFF			
Code Referen	ces: NFPA 72 7.5.4.1				
As Built Description:	80" high. Strobe too cl	ose to eye level and could result in se	eizures		
Proposed Solution:	Barrier removed				
As-Built Meas	: 0 Quantity:	EACH Cost Estimate: \$0.00	BSR: 1 Necessary		
X Coordinate:	N/A	Y Coordinate: N/A	Z Coordinate: N/A		
Implementati	on: Priority 2	Phase Date 12	/18/2019 Status Closed		
Notes:					
Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 Barrier #:	6A		
Field Date: Facility:		rt Date: 12/18/2019 Barrier #:			
		,			
Facility: Location:	Community Correction	ns Resource Center - 404 H St, Eureka			
Facility: Location:	Community Correction Work Center nsible: Karen Clower	ns Resource Center - 404 H St, Eureka			
Facility: Location: Official Respo	Community Correction Work Center nsible: Karen Clower ee: No	ns Resource Center - 404 H St, Eureka , ADA Coordinator			
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Correction Work Center nsible: Karen Clower ee: No	, ADA Coordinator Paragraph: M.51 Remediation: N/A			
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Correction Work Center nsible: Karen Clower ee: No Signage Room ID Sign - No Tac	, ADA Coordinator Paragraph: M.51 Remediation: N/A	1 of 1		
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Correction Work Center nsible: Karen Clower ee: No Signage Room ID Sign - No Tac	ns Resource Center - 404 H St, Eureka , ADA Coordinator Paragraph: M.51 Remediation: N/A tile Information I for sighted people lacks tactile information	1 of 1		
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Correction Work Center nsible: Karen Clower ee: No Signage Room ID Sign - No Tack Room ID sign provided	ADA Coordinator Paragraph: M.51 Remediation: N/A tile Information If for sighted people lacks tactile information ad 2010 ADAS 216.2	1 of 1		
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference As Built	Community Correction Work Center nsible: Karen Clower ee: No Signage Room ID Sign - No Tac Room ID sign provided ces: CBC 11B-216.2 an	ADA Coordinator Paragraph: M.51 Remediation: N/A tile Information If for sighted people lacks tactile information ad 2010 ADAS 216.2	1 of 1		
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference As Built Description: Proposed	Community Correction Work Center nsible: Karen Clower ee: No Signage Room ID Sign - No Tac Room ID sign provided ces: CBC 11B-216.2 an Compliant tactile sign Barrier removed	ADA Coordinator Paragraph: M.51 Remediation: N/A tile Information for sighted people lacks tactile information ad 2010 ADAS 216.2 provided	1 of 1		
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referent As Built Description: Proposed Solution:	Community Correction Work Center nsible: Karen Clower ee: No Signage Room ID Sign - No Tac Room ID sign provided ces: CBC 11B-216.2 an Compliant tactile sign Barrier removed : O Quantity:	ADA Coordinator Paragraph: M.51 Remediation: N/A tile Information for sighted people lacks tactile information ad 2010 ADAS 216.2 provided	1 of 1 for the visually impaired		
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference As Built Description: Proposed Solution: As-Built Meas	Community Correction Work Center Insible: Karen Clower Insible: Insible	ADA Coordinator Paragraph: M.51 Remediation: N/A tile Information If for sighted people lacks tactile information Add 2010 ADAS 216.2 provided EACH Cost Estimate: \$0.00 Y Coordinate: N/A	1 of 1 for the visually impaired BSR: 1 Necessary		



Field Date:	12/18/2019 Report Date: 12/18/2019 Barrier #: 6B				
Facility:	Community Corrections Resource Center - 404 H St, Eureka				
Location:	Work Center				
Official Respo	nsible: Karen Clower, ADA Coordinator				
Consent Decre	ee: No Paragraph: M.51 Dwg: 1 of 1				
Barrier Area:	Doors or Gates Remediation: N/A				
Barrier Type:	Door Closer - Interior Adjustment				
Barrier Description:	Door opening force exceeds 5 lbf				
Code Referen	CBC 11B-404.2.9 and 2010 ADAS 404.2.9				
As Built Description:	Door closer removed where operating force was 7 lbf at non-fire rated door				
Proposed Solution:	Barrier removed				
As-Built Meas	Quantity: EACH Cost Estimate: \$0.00 BSR: 1 Necessary				
X Coordinate:	N/A Y Coordinate: N/A Z Coordinate: N/A				
Implementati	on: Priority 2 Phase Date 12/18/2019 Status Closed				
Notes:					
Field Date:	12/18/2019 Report Date: 12/18/2019 Barrier #: 6C				
Field Date: Facility:	12/18/2019 Report Date: 12/18/2019 Barrier #: 6C Community Corrections Resource Center - 404 H St, Eureka				
Facility: Location:	Community Corrections Resource Center - 404 H St, Eureka				
Facility: Location:	Community Corrections Resource Center - 404 H St, Eureka Work Center nsible: Karen Clower, ADA Coordinator				
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Corrections Resource Center - 404 H St, Eureka Work Center nsible: Karen Clower, ADA Coordinator ee: No Paragraph: M.51 Dwg: 1 of 1 Doors or Gates Remediation: N/A				
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Corrections Resource Center - 404 H St, Eureka Work Center nsible: Karen Clower, ADA Coordinator ee: No Paragraph: M.51 Dwg: 1 of 1				
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Corrections Resource Center - 404 H St, Eureka Work Center nsible: Karen Clower, ADA Coordinator ee: No Paragraph: M.51 Dwg: 1 of 1 Doors or Gates Remediation: N/A				
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Corrections Resource Center - 404 H St, Eureka Work Center Insible: Karen Clower, ADA Coordinator Insible: No Paragraph: M.51 Dwg: 1 of 1 Doors or Gates Remediation: N/A Door Closer - Interior Sweep				
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Corrections Resource Center - 404 H St, Eureka Work Center Insible: Karen Clower, ADA Coordinator Insible: No Paragraph: M.51 Dwg: 1 of 1 Doors or Gates Remediation: N/A Door Closer - Interior Sweep Door closer lacks min. 5 second sweep period/back check				
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built	Community Corrections Resource Center - 404 H St, Eureka Work Center Insible: Karen Clower, ADA Coordinator Insible: No Paragraph: M.51 Dwg: 1 of 1 Doors or Gates Remediation: N/A Door Closer - Interior Sweep Door closer lacks min. 5 second sweep period/back check Ces: CBC 11B-404.2.8.1 and ADA/ABA 404.2.8.1				
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built Description: Proposed	Community Corrections Resource Center - 404 H St, Eureka Work Center Insible: Karen Clower, ADA Coordinator Insible: Karen Clower, ADA Coordinator Insible: Remediation: M.51 Doors or Gates Remediation: N/A Door Closer - Interior Sweep Door closer lacks min. 5 second sweep period/back check Insible: Karen Clower, ADA Coordinator Insible: Karen Clower, ADA Coordi				
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built Description: Proposed Solution:	Community Corrections Resource Center - 404 H St, Eureka Work Center Insible: Karen Clower, ADA Coordinator Insible: Karen Clower, ADA Coordinator Insible: No Paragraph: M.51 Dwg: 1 of 1 Doors or Gates Remediation: N/A Door Closer - Interior Sweep Door closer lacks min. 5 second sweep period/back check Insible: No Paragraph: M.51 Dwg: 1 of 1 Doors or Gates Remediation: N/A Door Closer - Interior Sweep Door closer removed sweep period/back check Insible: Karen Clower, ADA Coordinator Remediation: N/A Door Closer - Interior Sweep Door closer lacks min. 5 second sweep period/back check Insible: Karen Clower, ADA Coordinator Remediation: N/A Door Closer - Interior Sweep Door closer lacks min. 5 second sweep period/back check Insible: Karen Clower, ADA Coordinator Remediation: N/A Door Closer - Interior Sweep Door closer lacks min. 5 second sweep period/back check Insible: Karen Clower, ADA Coordinator Remediation: N/A Door Closer - Interior Sweep Door closer lacks min. 5 second sweep period/back check Insible: Karen Clower, ADA Coordinator Remediation: N/A Door Closer lacks min. 5 second sweep period/back check Insible: Karen Clower, ADA Coordinator Remediation: N/A Door Closer lacks min. 5 second sweep period/back check Insible: Karen Clower, ADA Coordinator Remediation: N/A Door Closer lacks min. 5 second sweep period/back check Insible: Karen Clower, ADA Coordinator Remediation: N/A Door Closer lacks min. 5 second sweep period/back check Insible: Karen Clower, ADA Coordinator Remediation: N/A Door Closer lacks min. 5 second sweep period/back check Insible: Karen Clower, ADA Coordinator Remediation: N/A Door Closer lacks min. 5 second sweep period/back check Insible: Karen Clower, ADA Coordinator Remediation: N/A Door Closer lacks min. 5 second sweep period/back check Insible: Karen Clower, ADA Coordinator Remediation: N/A Door Closer lacks min. 5 second sweep period/back check Insible: Karen Clower, ADA Coordinator Remediation: N/A Door Closer lacks min. 5 secon				
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built Description: Proposed Solution: As-Built Meas	Community Corrections Resource Center - 404 H St, Eureka Work Center Insible: Karen Clower, ADA Coordinator Insible: Karen Clower, ADA Coordinator Insible: Remediation: M.51 Doors or Gates Remediation: N/A Door Closer - Interior Sweep Door closer lacks min. 5 second sweep period/back check Insible: Karen Clower, ADA Coordinate: N/A Doors or Gates Remediation: N/A Door closer removed Remediation: N/A Door closer removed where 3 second sweep was identified at non-fire rated door Barrier removed Insible: Karen Clower, ADA Coordinate: N/A Door Closer - Interior Sweep Door closer lacks min. 5 second sweep period/back check Door closer removed where 3 second sweep was identified at non-fire rated door Barrier removed Insible: Karen Clower, ADA Coordinate: \$0.00 BSR: 2 Recommended N/A Insible: Karen Clower, ADA Coordinate: N/A				



Field Date:	11/13/2017 Report Date: 8/3/2018 Barrier #: 6D				
Facility:	Community Corrections Resource Center - 404 H St, Eureka				
Location:	Work Center				
Official Respo	nsible: Karen Clower, ADA Coordinator				
Consent Decre	ee: No Paragraph: M.51 Dwg: 1 of 1				
Barrier Area:	Doors or Gates Remediation: Required				
Barrier Type:	Vision Lights - Existing				
Barrier Description:	Doors, gates, and side lights adjacent to opening not max. 43" above floor/ground				
Code Referen	CBC 11B-404.2.11 and 2010 ADAS 404.2.11				
As Built Description:	View panel 45-1/4" high				
Proposed Solution:	Replace door or vision panel in door				
As-Built Meas	Quantity: EACH Cost Estimate: \$2,250.00 BSR: 3 Hindrance				
X Coordinate:	N/A Y Coordinate: N/A Z Coordinate: N/A				
Implementati	on: Priority 2 Phase Date Status Open				
Notes: Pro	gram Access Applied- Public is escorted by staff at all times beyond this point.				
Field Date:	12/18/2019 Report Date: 12/18/2019 Barrier #: 6E				
Field Date: Facility:	12/18/2019 Report Date: 12/18/2019 Barrier #: 6E Community Corrections Resource Center - 404 H St, Eureka				
Facility: Location:	Community Corrections Resource Center - 404 H St, Eureka				
Facility: Location:	Community Corrections Resource Center - 404 H St, Eureka Work Center nsible: Karen Clower, ADA Coordinator				
Facility: Location: Official Respo Consent Decre	Community Corrections Resource Center - 404 H St, Eureka Work Center nsible: Karen Clower, ADA Coordinator				
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Corrections Resource Center - 404 H St, Eureka Work Center nsible: Karen Clower, ADA Coordinator ee: No Paragraph: M.51 Dwg: 1 of 1				
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Corrections Resource Center - 404 H St, Eureka Work Center nsible: Karen Clower, ADA Coordinator ee: No Paragraph: M.51 Dwg: 1 of 1 Doors or Gates Remediation: N/A				
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Corrections Resource Center - 404 H St, Eureka Work Center Insible: Karen Clower, ADA Coordinator Insible: No Paragraph: M.51 Dwg: 1 of 1 Doors or Gates Remediation: N/A Maneuvering CI - Stored Items				
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Corrections Resource Center - 404 H St, Eureka Work Center Insible: Karen Clower, ADA Coordinator Insible: No Paragraph: M.51 Dwg: 1 of 1 Doors or Gates Remediation: N/A Maneuvering CI - Stored Items Door/Gate lacks required maneuvering clearance				
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference As Built	Community Corrections Resource Center - 404 H St, Eureka Work Center Insible: Karen Clower, ADA Coordinator Insible: No Paragraph: M.51 Dwg: 1 of 1 Doors or Gates Maneuvering Cl - Stored Items Door/Gate lacks required maneuvering clearance Ces: CBC Figure 11B-404.2.4.1 and 2010 ADAS 404.2.4.1				
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference As Built Description: Proposed	Community Corrections Resource Center - 404 H St, Eureka Work Center Insible: Karen Clower, ADA Coordinator Insible: Karen Clower, ADA Coordinator Insible: No Paragraph: M.51 Dwg: 1 of 1 Doors or Gates Insible: Remediation: N/A Maneuvering CI - Stored Items Door/Gate lacks required maneuvering clearance Ces: CBC Figure 11B-404.2.4.1 and 2010 ADAS 404.2.4.1 Trash bin moved to area outside of door maneuvering clearance to provide access Barrier removed				
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referent As Built Description: Proposed Solution:	Community Corrections Resource Center - 404 H St, Eureka Work Center Insible: Karen Clower, ADA Coordinator Insible: Karen Clower, ADA Coordinator Insible: No Paragraph: M.51 Dwg: 1 of 1 Doors or Gates Remediation: N/A Maneuvering Cl - Stored Items Door/Gate lacks required maneuvering clearance Ces: CBC Figure 11B-404.2.4.1 and 2010 ADAS 404.2.4.1 Trash bin moved to area outside of door maneuvering clearance to provide access Barrier removed EACH Cost Estimate: \$0.00 BSR: 1 Necessary				
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference As Built Description: Proposed Solution: As-Built Meas	Community Corrections Resource Center - 404 H St, Eureka Work Center Insible: Karen Clower, ADA Coordinator Insible: Karen Clower, ADA Coordinator Insible: Remediation: M.51 Doors or Gates Remediation: N/A Maneuvering CI - Stored Items Door/Gate lacks required maneuvering clearance Ces: CBC Figure 11B-404.2.4.1 and 2010 ADAS 404.2.4.1 Trash bin moved to area outside of door maneuvering clearance to provide access Barrier removed I D Quantity: EACH Cost Estimate: \$0.00 BSR: 1 Necessary N/A V Coordinate: N/A Z Coordinate: N/A				



Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 Barrier #: 6F			
Facility:	Community Corrections Resource Center - 404 H St, Eureka				
Location:	Work Center				
Official Respo	nsible: Karen Clower	, ADA Coordinator			
Consent Decre	ee: No	Paragraph: M.51 Dwg: 1 of 1			
Barrier Area:	Signage	Remediation: N/A			
Barrier Type:	Tactile Exit Sign - Rout	e			
Barrier Description:	Exit door to exterior th	nru exit enclosure, interior room or passageway lacks "EXIT ROUTE" sign			
Code Referen	ces: CBC 11B-216.4.1	& 11B-703 and 2010 ADAS 216.4.1			
As Built Description:	New tactile sign provio	ded where required			
Proposed Solution:	Barrier removed				
As-Built Meas	: 0 Quantity:	EACH Cost Estimate: \$0.00 BSR: 2 Recommended			
X Coordinate:	N/A	Y Coordinate: N/A Z Coordinate: N/A			
Implementati	on: Priority 4	Phase Date 12/18/2019 Status Closed			
Notes:					
Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 Barrier #: 6G			
Field Date: Facility:		rt Date: 12/18/2019 Barrier #: 6G ns Resource Center - 404 H St, Eureka			
Facility:	Community Correction Work Center	ns Resource Center - 404 H St, Eureka			
Facility: Location:	Community Correction Work Center nsible: Karen Clower	ns Resource Center - 404 H St, Eureka			
Facility: Location: Official Respo	Community Correction Work Center nsible: Karen Clower ee: No	ns Resource Center - 404 H St, Eureka			
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Correction Work Center nsible: Karen Clower ee: No	ADA Coordinator Paragraph: M.51 Remediation: Required			
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Correction Work Center nsible: Karen Clower ee: No Signage	ADA Coordinator Paragraph: M.51 Remediation: Required Character Height			
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Correction Work Center nsible: Karen Clower ee: No Signage Evacuation Plan Sign - Visual character heigh	ADA Coordinator Paragraph: M.51 Remediation: Required Character Height			
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Correction Work Center nsible: Karen Clower ee: No Signage Evacuation Plan Sign - Visual character heigh	ADA Coordinator Paragraph: M.51 Remediation: Required Character Height t less than 5/8" high			
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference	Community Correction Work Center nsible: Karen Clower ee: No Signage Evacuation Plan Sign - Visual character heigh ces: 2010 ADAS 703.5	ns Resource Center - 404 H St, Eureka ADA Coordinator Paragraph: M.51 Remediation: Required Character Height t less than 5/8" high 5 (CBC 11B-703.5.5 less stringent)			
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referent As Built Description: Proposed	Community Correction Work Center nsible: Karen Clower ee: No Signage Evacuation Plan Sign - Visual character heigh ces: 2010 ADAS 703.5 1/4" character height Provide compliant eva	ADA Coordinator Paragraph: M.51 Remediation: Required Character Height t less than 5/8" high CUALTIEST STREET S			
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referent As Built Description: Proposed Solution:	Community Correction Work Center nsible: Karen Clower ee: No Signage Evacuation Plan Sign - Visual character heigh ces: 2010 ADAS 703.5 1/4" character height Provide compliant eva : 1 Quantity:	ADA Coordinator Paragraph: M.51 Remediation: Required Character Height t less than 5/8" high CUALTIEST STREET S			
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference As Built Description: Proposed Solution: As-Built Meas	Community Correction Work Center nsible: Karen Clower ee: No Signage Evacuation Plan Sign - Visual character heigh ces: 2010 ADAS 703.5. 1/4" character height Provide compliant eva : 1 Quantity: N/A	ADA Coordinator Paragraph: M.51 Remediation: Required Character Height t less than 5/8" high CUARTING STATE OF STATE			



Field Date:	12/18/2019 Repo	rt Date: 12/18/2019	Barrier #: 6H		
Facility:	Community Corrections Resource Center - 404 H St, Eureka				
Location:	Work Center				
Official Respo	nsible: Karen Clower	, ADA Coordinator			
Consent Decre	ee: No	Paragraph: M.51	Dwg: 1 of 1		
Barrier Area:	Controls and Mechani	sms Remediati	on: N/A		
Barrier Type:	Operable Part - Clear I	Floor Space (Stored Items)			
Barrier Description:	Clear floor space for p	erson using wheelchair no	t provided at operable	part	
Code Referen	ces: CBC 11B-305.3 ar	d 2010 ADAS 305.3			
As Built Description:	Stored items moved w	here clear floor space was	blocked at water dispo	enser	
Proposed Solution:	Barrier removed				
As-Built Meas	: 0 Quantity:	JOB Cost Estimate:	\$0.00 BSR:	1 Necessary	
X Coordinate:	N/A	Y Coordinate: N/A	Z Coordina	ate: N/A	
Implementati	on: Priority 3	Phase	Date 12/18/2019	Status Closed	
Notes:					
Field Date:	12/18/2019 Repo	rt Date: 12/18/2019	Barrier #: 61		
Facility:	Community Correction	ns Resource Center - 404 H	St, Eureka		
Location:	Work Center				
Official Respo	nsible: Karen Clower	, ADA Coordinator			
Consent Decre	ee: No	Paragraph: M.51	Dwg: 1 of 1		
Barrier Area:	Drinking Fountains	Remediati	on: Required		
Barrier Type:	Drinking Fountain - Ra	tio			
Barrier Description:	Where drinking founta	iins are provided on an ext	erior site, floor or in a	secured location, none	
Code Referen	ces: CBC 11B-211.1 ar	d 2010 ADAS 211.1			
As Built Description:	No accessible drinking	fountain provided			
Proposed Solution:	Provide min. one acce	ssible fountain in building			
As-Built Meas	: 1 Quantity:	JOB Cost Estimate:	\$1,440.00 BSR:	1 Necessary	
X Coordinate:	N/A	Y Coordinate: N/A	Z Coordina	ate: N/A	
Implementati		51	5.1.	Chahua	
	on: Priority 3	Phase	Date	Status Open	



Field Date:	12/18/2019 Repo	ort Date: 12/18/2019 Barrier #: 6J
Facility:	Community Correction	ns Resource Center - 404 H St, Eureka
Location:	Work Center	
Official Respo	nsible: Karen Clower	r, ADA Coordinator
Consent Decre	ee: No	Paragraph: M.51 Dwg: 1 of 1
Barrier Area:	Drinking Fountains	Remediation: Required
Barrier Type:	Drinking Fountains for	Standing Persons
Barrier Description:	Spout outlet of drinkin above floor or ground	ng fountains for standing persons not 38" minimum and 43" maximum
Code Referen	ces: CBC 11B-211.2 &	11B-602.7 and 2010 ADAS 211.2 & 602.7
As Built Description:	Low controls at water	cooler not accessible for people with bending and stooping injuries
Proposed Solution:	Provide hi-low drinking fountain	g fountain for standing persons, in addition to wheelchair accessible
As-Built Meas	: 1 Quantity:	EACH Cost Estimate: \$750.00 BSR: 2 Recommended
X Coordinate:	N/A	Y Coordinate: N/A Z Coordinate: N/A
Implementati	on: Priority 3	Phase Date Status Open
Notes: Cou	unty intends to apply Pi	rogram Access
Field Date:	12/18/2019 Repo	ort Date: 12/18/2019 Barrier #: 6K
Field Date: Facility:		ort Date: 12/18/2019 Barrier #: 6K ns Resource Center - 404 H St, Eureka
Facility: Location:	Community Correction	ns Resource Center - 404 H St, Eureka
Facility: Location:	Community Correction Work Center nsible: Karen Clower	ns Resource Center - 404 H St, Eureka
Facility: Location: Official Respo Consent Decre	Community Correction Work Center nsible: Karen Clower	r, ADA Coordinator Paragraph: M.51 Dwg: 1 of 1
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Correction Work Center nsible: Karen Clower ee: No Controls and Mechanis	r, ADA Coordinator Paragraph: M.51 Dwg: 1 of 1
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Correction Work Center nsible: Karen Clower ee: No Controls and Mechanis Operable Part - Side Re	r, ADA Coordinator Paragraph: M.51 Remediation: N/A
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Correction Work Center nsible: Karen Clower ee: No Controls and Mechanic Operable Part - Side Ro Operable part betwee	r, ADA Coordinator Paragraph: M.51 Sms Remediation: N/A each Obstructed (>10"-24")
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Correction Work Center nsible: Karen Clower ee: No Controls and Mechanic Operable Part - Side Ro Operable part betwee	ns Resource Center - 404 H St, Eureka 7, ADA Coordinator Paragraph: M.51 Sms Remediation: N/A each Obstructed (>10"-24") en 10" to 24" deep over an obstruction max. 34" high is located above 46" and 2010 ADAS 308.3.2
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference As Built	Community Correction Work Center nsible: Karen Clower ee: No Controls and Mechanic Operable Part - Side Ro Operable part betwee ces: CBC 11B-308.3.2 a Mail box 54-1/4" high	ns Resource Center - 404 H St, Eureka 7, ADA Coordinator Paragraph: M.51 Sms Remediation: N/A each Obstructed (>10"-24") en 10" to 24" deep over an obstruction max. 34" high is located above 46" and 2010 ADAS 308.3.2
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referent As Built Description: Proposed	Community Correction Work Center nsible: Karen Clower ee: No Controls and Mechanis Operable Part - Side Ro Operable part betwee ces: CBC 11B-308.3.2 a Mail box 54-1/4" high	ns Resource Center - 404 H St, Eureka 7, ADA Coordinator Paragraph: M.51 Sms Remediation: N/A each Obstructed (>10"-24") en 10" to 24" deep over an obstruction max. 34" high is located above 46" and 2010 ADAS 308.3.2 red. Mailbox is used by staff only.
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference As Built Description: Proposed Solution:	Community Correction Work Center nsible: Karen Clower ee: No Controls and Mechanis Operable Part - Side Ro Operable part betwee ces: CBC 11B-308.3.2 a Mail box 54-1/4" high No remediation requir : 1 Quantity:	ns Resource Center - 404 H St, Eureka 7, ADA Coordinator Paragraph: M.51 Sms Remediation: N/A each Obstructed (>10"-24") en 10" to 24" deep over an obstruction max. 34" high is located above 46" and 2010 ADAS 308.3.2 red. Mailbox is used by staff only.
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference As Built Description: Proposed Solution: As-Built Meas	Community Correction Work Center nsible: Karen Clower ee: No Controls and Mechanis Operable Part - Side Re Operable part betwee ces: CBC 11B-308.3.2 a Mail box 54-1/4" high No remediation requir : 1 Quantity: N/A	r, ADA Coordinator Paragraph: M.51 Sms Remediation: N/A each Obstructed (>10"-24") en 10" to 24" deep over an obstruction max. 34" high is located above 46" and 2010 ADAS 308.3.2 red. Mailbox is used by staff only. EACH Cost Estimate: \$0.00 BSR: 3 Hindrance



Field Date:	12/18/2019 Repo	rt Date: 12/18/2019	Barrier #: 6L			
Facility:	Community Correction	ns Resource Center - 404	H St, Eureka			
Location:	Work Center					
Official Respo	nsible: Karen Clower	, ADA Coordinator				
Consent Decr	ee: No	Paragraph: M.51	Dwg: 1 of	f 1		
Barrier Area:	Restrooms	Remedi	ation: N/A			
Barrier Type:	Weighing Scale - Clear	Floor Space				
Barrier Description:	Clear floor space of mi	n. 30" by 48" not provid	ed at public scale			
Code Referen	ces: CBC 11B-805.4.2					
As Built Description:	Non-accessible scale w	vas removed				
Proposed Solution:	Barrier removed					
As-Built Meas	: 0 Quantity:	EACH Cost Estimate:	\$0.00	BSR: 2 Recommended		
X Coordinate:	N/A	Y Coordinate: N/A	Z	Coordinate: N/A		
Implementati	on: Priority 2	Phase	Date 12/18	/2019 Status Closed		
Notes:						
Field Date:	11/13/2017 Repo	rt Date: 8/3/2018	Barrier #: 6M			
Facility:	Community Correction	ns Resource Center - 404	H St, Eureka			
Location:	Work Center					
Official Respo	nsible: Karen Clower	, ADA Coordinator		I STATE OF		
Consent Decr	ee: No	Paragraph: M.51	Dwg: 1 of	f1		
Barrier Area:	Alarms	Remedi	ation: Required			
Barrier Type:	Horn/Strobe - Staff Ard	еа				
Barrier Description:	No horn/strobe in staf	f areas				
Code Referen	ces: CBC 11B-702.1 an	d 2010 ADAS 702.1				
As Built Description:	Device not provided					
Proposed Solution:	Provide horn/strobe in	area where programs,	services and activ	vities take place		
As-Built Meas	Quantity:	EACH Cost Estimate:	\$5,500.00	BSR: 3 Hindrance		
X Coordinate:	N/A	Y Coordinate: N/A	Z	Coordinate: N/A		
Implementati	on: Priority 2	Phase	Date	Status Open		
dete	ermine if barrier remed	<u>-</u>	situation if no up	ect/professional or CASP to ogrades or replacement of 2.3 applies.		



Field Date:	12/18/2019 Repo	rt Date: 12/18/2019	Barrier #: 7A			
Facility:	Community Correction	ns Resource Center - 404	H St, Eureka			
Location:	Office 2					
Official Respo	nsible: Karen Clower	, ADA Coordinator				
Consent Decr	ee: No	Paragraph: M.51	Dwg: 1 of	1		
Barrier Area:	Signage	Remedia	tion: N/A			
Barrier Type:	Room ID Sign - No Tac	tile Information				
Barrier Description:	Room ID sign provided	I for sighted people lacks	tactile info for t	he visually impaired		
Code Referen	ces: CBC 11B-216.2 an	d 2010 ADAS 216.2				
As Built Description:	Compliant tactile sign	provided				
Proposed Solution:	Barrier removed					
As-Built Meas	: 0 Quantity:	EACH Cost Estimate:	\$0.00	BSR: 1 Necessary		
X Coordinate:	N/A	Y Coordinate: N/A	Z	Coordinate: N/A		
Implementati	on: Priority 4	Phase	Date 12/18/	/2019 Status Closed		
Notes:						
Field Date:	11/13/2017 Repo	rt Date: 8/3/2018	Barrier #: 7B			
Facility:	Community Correction	ns Resource Center - 404	H St, Eureka			
Location:	Office 2					
Official Respo	nsible: Karen Clower	, ADA Coordinator				
Consent Decre	ee: No	Paragraph: M.51	Dwg: 1 of	1		
Barrier Area:	Doors or Gates	Remedia	tion: Required			
Barrier Type:	Door Clear Width - 32	1				
Barrier Description:	Door, sliding/folding d	oor or gate clear width is	not min. 32"			
Code Referen	ces: CBC 11B-404.2.3	& 404.3.1 and 2010 ADAS	404.2.3 & 404.3	3.1		
As Built Description:	30" wide					
Proposed Solution:	Replace door or gate a	nd frame				
As-Built Meas	: 1 Quantity:	EACH Cost Estimate:	\$2,250.00	BSR: 1 Necessary		
X Coordinate:	N/A	Y Coordinate: N/A	Z	Coordinate: N/A		
Implementati	on: Priority 2	Phase	Date	Status Open		
Notes: Cou	inty intends to apply pr	ogram access.				



Field Date:	11/13/2017 Repo	rt Date: 8/3/2018 Barrier #:	7C			
Facility:	Community Correction	ns Resource Center - 404 H St, Eureka				
Location:	Office 2					
Official Respo	nsible: Karen Clower	, ADA Coordinator				
Consent Decre	ee: No	Paragraph: M.51 Dwg:	l of 1			
Barrier Area:	Doors or Gates	Remediation: Requir	ed			
Barrier Type:	Maneuvering Cl - Latcl	h App/Push 44"				
Barrier Description:	Door/Gate without lat	ch/closer at push side lacks min. 44" p	perpendicular to door			
Code Referen	ces: CBC Figure 11B-4	04.2.4.1 and 2010 ADAS 404.2.4.1				
As Built Description:	36" maneuvering clea	rance at push side of door				
Proposed Solution:	Install automatic door clearance	opening device to compensate for a la	ack of required maneuvering			
As-Built Meas	: 1 Quantity:	EACH Cost Estimate: \$5,000.00	BSR: 1 Necessary			
X Coordinate:	N/A	Y Coordinate: N/A	Z Coordinate: N/A			
Implementati	on: Priority 2	Phase Date	Status Open			
Notes: Cour	nty intends to apply Pro	gram Access. Public escorted by staff a	at all times in this area.			
Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 Barrier #:	7D			
Facility:	Community Correction	ns Resource Center - 404 H St, Eureka				
Location:	Office 2					
Official Respo	nsible: Karen Clower	, ADA Coordinator	5			
Consent Decre	ee: No	Paragraph: M.51 Dwg: 1	l of 1			
Barrier Area:	Clear Floor Space	Remediation: Requir	ed			
Barrier Type:	Clear Floor Space - Wh	neelchair Use (Stored Items)				
Barrier Description:	Clear floor space of m	in. 30" by 48" not provided at element	required to be accessible			
Code Referen	ces: CBC 11B-305 and	2010 ADAS 305				
As Built Description:	No wheelchair space p	provided in office where clients receive	e services			
Proposed Solution:	County indicated that accessible tables are p	clients with mobility impairments will provided	be served in conference room, after			
As-Built Meas	: 1 Quantity:	JOB Cost Estimate: \$0.00	BSR: 1 Necessary			
X Coordinate:						
A Coordinate.	N/A	Y Coordinate: N/A	Z Coordinate: N/A			
Implementati	, .	Y Coordinate: N/A Phase Date	Z Coordinate: N/A Status Open			



Field Date: 11/13/2017 Report Date: 8/3/2018 Barrier #: 7E
Facility: Community Corrections Resource Center - 404 H St, Eureka
Location: Office 2
Official Responsible: Karen Clower, ADA Coordinator
Consent Decree: No Paragraph: M.51 Dwg: 1 of 1
Barrier Area: Alarms Remediation: Required
Barrier Type: Horn/Strobe - Staff Area
Barrier Description: No horn/strobe in staff areas
Code References: CBC 11B-702.1 and 2010 ADAS 702.1
As Built Device not provided Description:
Proposed Solution: Provide horn/strobe in area where programs, services and activities take place
As-Built Meas: 1 Quantity: EACH Cost Estimate: \$5,500.00 BSR: 3 Hindrance
X Coordinate: N/A Y Coordinate: N/A Z Coordinate: N/A
Implementation: Priority 2 Phase Date Status Open
Notes: Property Owner Responsible. Strobe installed. Pending CASp inspection.
Field Date: 12/18/2019 Report Date: 12/18/2019 Barrier #: 8A
Facility: Community Corrections Resource Center - 404 H St, Eureka
Location: Office 3
Official Responsible: Karen Clower, ADA Coordinator
Consent Decree: No Paragraph: M.51 Dwg: 1 of 1
Barrier Area: Signage Remediation: N/A
Barrier Type: Room ID Sign - No Tactile Information
Barrier Description: Room ID sign provided for sighted people lacks tactile info for the visually impaired
Code References: CBC 11B-216.2 and 2010 ADAS 216.2
As Built Description: Compliant tactile sign provided
Proposed Barrier removed Solution:
As-Built Meas: 0 Quantity: EACH Cost Estimate: \$0.00 BSR: 1 Necessary
X Coordinate: N/A Y Coordinate: N/A Z Coordinate: N/A
Implementation: Priority 4 Phase Date 12/18/2019 Status Closed
Notes:



Field Date:	11/13/2017 Repo	rt Date: 8/3/2018	Barrier #: 8B			
Facility:	Community Correction	ns Resource Center - 404 I	H St, Eureka			
Location:	Office 3					
Official Respo	nsible: Karen Clower	, ADA Coordinator				
Consent Decr	ee: No	Paragraph: M.51	Dwg: 1 of 1			
Barrier Area:	Doors or Gates	Remedia	tion: Required			
Barrier Type:	Door Clear Width - 32'	ı				
Barrier Description:	Door, sliding/folding d	oor or gate clear width is	not min. 32"			
Code Referen	ces: CBC 11B-404.2.3	& 404.3.1 and 2010 ADAS	404.2.3 & 404.3.1			
As Built Description:	30" wide					
Proposed Solution:	Replace door or gate a	ind frame				
As-Built Meas	: 1 Quantity:	EACH Cost Estimate:	\$2,250.00 BSR: 1	1 Necessary		
X Coordinate:	N/A	Y Coordinate: N/A	Z Coordina	te: N/A		
Implementati	on: Priority 2	Phase	Date	Status Open		
Notes: Cou	unty intends to apply Pr	ogram Access.				
Field Date:	12/18/2019 Repo	rt Date: 12/18/2019	Barrier #: 8C	0		
Facility:	Community Correction	ns Resource Center - 404 I	H St, Eureka			
Location:	Office 3		ST.			
Official Respo	nsible: Karen Clower	, ADA Coordinator				
Consent Decr	ee: No	Paragraph: M.51	Dwg: 1 of 1			
Barrier Area:	Doors or Gates	Remediat	cion: Required	1446.1 00		
Barrier Type:	Maneuvering CI - Store	ed Items				
Barrier Description:	Door/Gate lacks requir	red maneuvering clearand	ce			
Code Referen	ces: CBC Figure 11B-40	04.2.4.1 and 2010 ADAS 4	04.2.4.1			
As Built Description:	Shelf blocks maneuver	ing clearance at pull side	of door			
Proposed Solution:	County indicated that accessible tables are p	clients with mobility impa rovided	irments will be served ir	conference room, after		
As-Built Meas	Quantity:	EACH Cost Estimate:	\$0.00 BSR:	1 Necessary		
X Coordinate:	N/A	Y Coordinate: N/A	Z Coordina	te: N/A		
Implementati	on: Priority 2	Phase	Date	Status Open		
Notes: Cour	nty intends to apply Pro	gram Access.				



Field Date:	12/18/2019 Report	t Date: 12/18/2019 Barrier #: 8D				
Facility:	Community Corrections	s Resource Center - 404 H St, Eureka				
Location:	Office 3					
Official Respo	nsible: Karen Clower,	ADA Coordinator				
Consent Decr	ee: No	Paragraph: M.51 Dwg: 1 of 1				
Barrier Area:	Clear Floor Space	Remediation: Required				
Barrier Type:	Clear Floor Space - Whe	eelchair Use (Stored Items)				
Barrier Description:	Clear floor space of min	n. 30" by 48" not provided at element required to be accessible				
Code Referen	ces: CBC 11B-305 and 2	2010 ADAS 305				
As Built Description:	No wheelchair space pr	rovided				
Proposed Solution:	County indicated that claccessible tables are pro	clients with mobility impairments will be served in conference room, after rovided				
As-Built Meas	Quantity:	JOB Cost Estimate: \$0.00 BSR: 1 Necessary				
X Coordinate:	N/A	Y Coordinate: N/A Z Coordinate: N/A				
Implementati	on: Priority 2	Phase Date Status Open				
Notes: Coun	ty intends to apply Progr	ram Access.				
Field Date:	11/13/2017 Report	t Date: 8/3/2018 Barrier #: 8E				
Facility:	Community Corrections	s Resource Center - 404 H St, Eureka				
Location:	Office 3					
Official Respo	nsible: Karen Clower,	ADA Coordinator				
Consent Decre	ee: No F	Paragraph: M.51 Dwg: 1 of 1				
Barrier Area:	Alarms	Remediation: Required				
Barrier Type:	Horn/Strobe - Staff Area	a				
Barrier						
Description:	No horn/strobe in staff	areas				
	No horn/strobe in staff ces: CBC 11B-702.1 and					
	L					
Code Referen As Built	ces: CBC 11B-702.1 and Device not provided					
Code Referen As Built Description: Proposed	ces: CBC 11B-702.1 and Device not provided Provide horn/strobe in	d 2010 ADAS 702.1				
Code Referen As Built Description: Proposed Solution:	Ces: CBC 11B-702.1 and Device not provided Provide horn/strobe in Quantity:	d 2010 ADAS 702.1 area where programs, services and activities take place				
Code Referen As Built Description: Proposed Solution: As-Built Meas	Ces: CBC 11B-702.1 and Device not provided Provide horn/strobe in Company Com	area where programs, services and activities take place EACH Cost Estimate: \$5,500.00 BSR: 3 Hindrance				



Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 Ba	rrier #: 9A	
Facility:	Community Correction	s Resource Center - 404 H St	t, Eureka	
Location:	Office 4			72
Official Respo	nsible: Karen Clower	, ADA Coordinator	1	
Consent Decr	ee: No	Paragraph: M.51	Dwg: 1 of 1	
Barrier Area:	Signage	Remediation	n: N/A	
Barrier Type:	Room ID Sign - No Tac	tile Information		
Barrier Description:	Room ID sign provided	for sighted people lacks tac	tile info for the visually i	mpaired
Code Referen	ces: CBC 11B-216.2 ar	d 2010 ADAS 216.2		
As Built Description:	Compliant tactile sign	provided		
Proposed Solution:	Barrier removed			
As-Built Meas	: 0 Quantity:	EACH Cost Estimate: \$0	.00 BSR: 1 N	ecessary
X Coordinate:	N/A	Y Coordinate: N/A	Z Coordinate:	N/A
Implementati	on: Priority 4	Phase	Date 12/18/2019	Status Closed
Notes:				
Field Date:	11/13/2017 Repo	rt Date: 8/3/2018 Ba	rrier #: 9B	Carle Alle
Facility:	Community Correction	s Resource Center - 404 H St	t, Eureka	\$ pane
Location:	Office 4			encon
Official Respo	nsible: Karen Clower	, ADA Coordinator		
Consent Decr	ee: No	Paragraph: M.51	Dwg: 1 of 1	
Barrier Area:	Doors or Gates	Remediation	n: Required	
Barrier Type:	Door Clear Width - 32	ı		
Barrier Description:	Door, sliding/folding d	oor or gate clear width is no	t min. 32"	
Code Referen	ces: CBC 11B-404.2.3	& 404.3.1 and 2010 ADAS 40	4.2.3 & 404.3.1	
As Built Description:	29-1/2" wide			
Proposed Solution:	Replace door or gate a	nd frame		
As-Built Meas	: 1 Quantity:	EACH Cost Estimate: \$2	,250.00 BSR: 1 N	ecessary
X Coordinate:	N/A	Y Coordinate: N/A	Z Coordinate:	N/A
Implementati	on: Priority 2	Phase	Date	Status Open
Notes: Cou				To poss



Field Date:	12/18/2019 Rep	ort Date: 12/18/2019	Barrier #:	9C	
Facility:	Community Correction	ns Resource Center - 404 H	St, Eurek	ia 📗	
Location:	Office 4				
Official Respo	nsible: Karen Clowe	r, ADA Coordinator			
Consent Decr	ee: No	Paragraph: M.51	Dwg:	1 of 1	
Barrier Area:	Doors or Gates	Remediation	on: Requ	uired	
Barrier Type:	Maneuvering Cl - Sto	ed Items			
Barrier Description:	Door/Gate lacks requ	ired maneuvering clearance	9		
Code Referen	ces: CBC Figure 11B-4	04.2.4.1 and 2010 ADAS 40	4.2.4.1		
As Built Description:	Cabinet blocks mane	uvering clearance at pull side	e of door		
Proposed Solution:	County indicated that accessible tables are	clients with mobility impai provided	rments w	ill be served in c	onference room, after
As-Built Meas	: 0 Quantity	EACH Cost Estimate:	\$0.00	BSR: 1 N	lecessary
X Coordinate:	N/A	Y Coordinate: N/A		Z Coordinate:	N/A
Implementati	on: Priority 2	Phase	Date		Status Open
Notes: Coun	ty intends to apply Pro	gram Access.			
Field Date:	11/13/2017 Rep	ort Date: 8/3/2018	Barrier #:	9D	
Facility:	Community Correction	ns Resource Center - 404 H	St, Eurek	ia 👢	
Location:	Office 4				
Official Respo	nsible: Karen Clowe	r, ADA Coordinator			
Consent Decre	ee: No	Paragraph: M.51	Dwg:	1 of 1	
Barrier Area:	Controls and Mechan	isms Remediation	on: N/A		
Barrier Type:	Clothing Hook or Rod	- Height			
Barrier Description:	Clothing hooks not m	ax. 48" high AFF			
Code Referen	ces: CBC 11B-308.2.1	and 2010 ADAS 308.2.1			
As Built Description:	77" high				
Proposed Solution:	Coat hook is used by	staff only. No remediation r	equired.		
As-Built Meas	: 0 Quantity	EACH Cost Estimate:	\$0.00	BSR: 2 R	tecommended
X Coordinate:	N/A	Y Coordinate: N/A		Z Coordinate:	N/A
Implementati	on: Priority 2	Phase	Date 1	.1/13/2017	Status Closed
Notes:					



	1/13/2017 Report Date: 8/3/2018 Barrier #: 9E					
Facility:	Community Corrections Resource Center - 404 H St, Eureka					
Location: O	Office 4					
Official Respons	sible: Karen Clower, ADA Coordinator					
Consent Decree	Paragraph: M.51 Dwg: 1 of 1					
Barrier Area: A	larms Remediation: Required					
Barrier Type: H	lorn/Strobe - Staff Area					
Barrier N Description:	Io horn/strobe in staff areas					
Code Reference	CBC 11B-702.1 and 2010 ADAS 702.1					
As Built Description:	Device not provided					
Proposed P Solution:	rovide horn/strobe in area where programs, services and activities take place					
As-Built Meas:	1 Quantity: EACH Cost Estimate: \$5,500.00 BSR: 3 Hindrance					
X Coordinate:	N/A Y Coordinate: N/A Z Coordinate: N/A					
Implementation	n: Priority 2 Phase Date Status Open					
Notes: Prope	erty Owner Responsible. Strobe installed. Pending CASp inspection.					
Field Date: 1	A CONTRACT OF THE CONTRACT OF					
rieid Date: 1	2/18/2019 Report Date: 12/18/2019 Barrier #: 10A					
. =	community Corrections Resource Center - 404 H St, Eureka					
Facility:	w (2)					
Facility:	Community Corrections Resource Center - 404 H St, Eureka Conference Room 1					
Facility: C	Community Corrections Resource Center - 404 H St, Eureka Conference Room 1 Sible: Karen Clower, ADA Coordinator					
Facility: C Location: C Official Respons	Community Corrections Resource Center - 404 H St, Eureka Conference Room 1 Sible: Karen Clower, ADA Coordinator E: No Paragraph: M.51 Dwg: 1 of 1					
Facility: C Location: C Official Respons Consent Decree Barrier Area: Si	Community Corrections Resource Center - 404 H St, Eureka Conference Room 1 Sible: Karen Clower, ADA Coordinator E: No Paragraph: M.51 Dwg: 1 of 1					
Facility: C Location: C Official Respons Consent Decree Barrier Area: Si Barrier Type: R	Community Corrections Resource Center - 404 H St, Eureka Conference Room 1 Sible: Karen Clower, ADA Coordinator E: No Paragraph: M.51 Dwg: 1 of 1 Eignage Remediation: N/A					
Facility: C Location: C Official Respons Consent Decree Barrier Area: Si Barrier Type: R Barrier Description:	Community Corrections Resource Center - 404 H St, Eureka Conference Room 1 Sible: Karen Clower, ADA Coordinator E: No Paragraph: M.51 Dwg: 1 of 1 Ignage Remediation: N/A Coom ID Sign - No Tactile Information					
Facility: C Location: C Official Respons Consent Decree Barrier Area: Si Barrier Type: R Barrier Description: C Code Reference	Community Corrections Resource Center - 404 H St, Eureka Conference Room 1 Sible: Karen Clower, ADA Coordinator E: No Paragraph: M.51 Dwg: 1 of 1 Ignage Remediation: N/A Coom ID Sign - No Tactile Information Coom ID sign provided for sighted people lacks tactile info for the visually impaired					
Facility: C Location: C Official Respons Consent Decree Barrier Area: Si Barrier Type: R Barrier Type: R Code Reference As Built Description: C	Community Corrections Resource Center - 404 H St, Eureka Conference Room 1 Sible: Karen Clower, ADA Coordinator E: No Paragraph: M.51 Dwg: 1 of 1 Ignage Remediation: N/A Coom ID Sign - No Tactile Information Coom ID sign provided for sighted people lacks tactile info for the visually impaired Es: CBC 11B-216.2 and 2010 ADAS 216.2					
Facility: C Location: C Official Respons Consent Decree Barrier Area: Si Barrier Type: R Barrier Type: R Code Reference As Built C Description: Proposed B	Community Corrections Resource Center - 404 H St, Eureka Conference Room 1 Sible: Karen Clower, ADA Coordinator Ele: No Paragraph: M.51 Dwg: 1 of 1 Elignage Remediation: N/A Coom ID Sign - No Tactile Information Coom ID sign provided for sighted people lacks tactile info for the visually impaired Eles: CBC 11B-216.2 and 2010 ADAS 216.2 Compliant tactile sign provided where visual sign exists at door within circulation path Carrier removed					
Facility: C Location: C Official Respons Consent Decree Barrier Area: Si Barrier Type: R Barrier Type: R Code Reference As Built Description: Proposed Solution:	Community Corrections Resource Center - 404 H St, Eureka Conference Room 1 Sible: Karen Clower, ADA Coordinator Elipsiage Remediation: N/A Coom ID Sign - No Tactile Information Coom ID sign provided for sighted people lacks tactile info for the visually impaired Elipsiage Center - 404 H St, Eureka Conference Room 1 Coom ID Sign Clower, ADA Coordinator Coom ID Sign - No Tactile Information Coom ID Sign - No Tactile Information Coom ID sign provided for sighted people lacks tactile info for the visually impaired Center - 404 H St, Eureka Conference Room 1 Coordinator Center - 404 H St, Eureka Conference Room 1 Coordinator Center - 404 H St, Eureka Conference Room 1 Coordinator Center - 404 H St, Eureka Conference Room 1 Center - 404 H St, Eureka Conference Room 1 Center - 404 H St, Eureka Conference Room 1 Center - 404 H St, Eureka Conference Room 1 Center - 404 H St, Eureka Conference Room 1 Center - 404 H St, Eureka Center - 404 H St, Eurek					
Facility: C Location: C Official Respons Consent Decree Barrier Area: Si Barrier Type: R Barrier Type: R Description: Code Reference As Built Description: Proposed Solution: As-Built Meas:	Community Corrections Resource Center - 404 H St, Eureka Conference Room 1 Sible: Karen Clower, ADA Coordinator E: No Paragraph: M.51 Dwg: 1 of 1 Ignage Remediation: N/A Coom ID Sign - No Tactile Information Coom ID sign provided for sighted people lacks tactile info for the visually impaired Es: CBC 11B-216.2 and 2010 ADAS 216.2 Compliant tactile sign provided where visual sign exists at door within circulation path Compliant tactile sign provided where visual sign exists at door within circulation path Compliant tactile sign provided where visual sign exists at door within circulation path Compliant tactile sign provided where visual sign exists at door within circulation path Compliant tactile sign provided where visual sign exists at door within circulation path Compliant tactile sign provided where visual sign exists at door within circulation path Compliant tactile sign provided where visual sign exists at door within circulation path Compliant tactile sign provided where visual sign exists at door within circulation path Compliant tactile sign provided where visual sign exists at door within circulation path Compliant tactile sign provided where visual sign exists at door within circulation path Compliant tactile sign provided where visual sign exists at door within circulation path Compliant tactile sign provided where visual sign exists at door within circulation path Compliant tactile sign provided where visual sign exists at door within circulation path Compliant tactile sign provided where visual sign exists at door within circulation path Compliant tactile sign provided where visual sign exists at door within circulation path Compliant tactile sign provided where visual sign exists at door within circulation path Compliant tactile sign provided where visual sign exists at door within circulation path Compliant tactile sign provided where visual sign exists at door within circulation path Compliant tactile sign provided where visual sign exists at door within circulation path Compliant tactile sign					



Field Date:	12/18/2019 Repo	ort Date: 12/18/2019 Barrier #: 10B			
Facility:	Community Correction	ns Resource Center - 404 H St, Eureka			
Location:	Conference Room 1				
Official Respo	nsible: Karen Clower	, ADA Coordinator			
Consent Decre	ee: No	Paragraph: M.51 Dwg: 1 of 1			
Barrier Area:	Signage	Remediation: N/A			
Barrier Type:	Tactile Exit Sign - Rout	e			
Barrier Description:	Exit door to exterior th	hru exit enclosure, interior room or passageway lacks "EXIT ROUTE" sign			
Code Referen	ces: CBC 11B-216.4.1	& 11B-703 and 2010 ADAS 216.4.1			
As Built Description:	New tactile sign provio	ded where required			
Proposed Solution:	Barrier removed				
As-Built Meas	: 0 Quantity:	EACH Cost Estimate: \$0.00 BSR: 2 Recommended			
X Coordinate:	N/A	Y Coordinate: N/A Z Coordinate: N/A			
Implementati	on: Priority 4	Phase Date 12/18/2019 Status Closed			
Notes:					
Field Date:	12/18/2019 Repo	ort Date: 12/18/2019 Barrier #: 10C			
		The second secon			
Facility:		ns Resource Center - 404 H St, Eureka			
Facility:	Community Correction Conference Room 1	ns Resource Center - 404 H St, Eureka			
Facility: Location:	Community Correction Conference Room 1 nsible: Karen Clower	ns Resource Center - 404 H St, Eureka			
Facility: Location: Official Respo	Community Correction Conference Room 1 nsible: Karen Clower ee: No	ns Resource Center - 404 H St, Eureka			
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Correction Conference Room 1 nsible: Karen Clower ee: No	r, ADA Coordinator Paragraph: M.51 Remediation: Required			
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Correction Conference Room 1 nsible: Karen Clower ee: No Signage	r, ADA Coordinator Paragraph: M.51 Remediation: Required Character Height			
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Correction Conference Room 1 nsible: Karen Clower ee: No Signage Evacuation Plan Sign - Visual character height	r, ADA Coordinator Paragraph: M.51 Remediation: Required Character Height			
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Correction Conference Room 1 nsible: Karen Clower ee: No Signage Evacuation Plan Sign - Visual character height	ns Resource Center - 404 H St, Eureka 7, ADA Coordinator Paragraph: M.51 Remediation: Required Character Height It less than 5/8" high			
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference As Built	Community Correction Conference Room 1 nsible: Karen Clower ee: No Signage Evacuation Plan Sign - Visual character heigh ces: 2010 ADAS 703.5	ns Resource Center - 404 H St, Eureka 7, ADA Coordinator Paragraph: M.51 Remediation: Required Character Height 1t less than 5/8" high .5 (CBC 11B-703.5.5 less stringent)			
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referent As Built Description: Proposed	Community Correction Conference Room 1 nsible: Karen Clower ee: No Signage Evacuation Plan Sign - Visual character height ces: 2010 ADAS 703.5 1/4" character height	ns Resource Center - 404 H St, Eureka 7, ADA Coordinator Paragraph: M.51 Remediation: Required Character Height 1t less than 5/8" high 1.5 (CBC 11B-703.5.5 less stringent)			
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referent As Built Description: Proposed Solution:	Community Correction Conference Room 1 nsible: Karen Clower ee: No Signage Evacuation Plan Sign - Visual character height ces: 2010 ADAS 703.5. 1/4" character height Provide compliant eva	ns Resource Center - 404 H St, Eureka 7, ADA Coordinator Paragraph: M.51 Remediation: Required Character Height 1t less than 5/8" high 1.5 (CBC 11B-703.5.5 less stringent)			
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referent As Built Description: Proposed Solution: As-Built Meas	Community Correction Conference Room 1 nsible: Karen Clower ee: No Signage Evacuation Plan Sign - Visual character heigh ces: 2010 ADAS 703.5. 1/4" character height Provide compliant eva : 1 Quantity: N/A	ns Resource Center - 404 H St, Eureka 7, ADA Coordinator Paragraph: M.51 Remediation: Required Character Height 1t less than 5/8" high 5.5 (CBC 11B-703.5.5 less stringent) Cauation sign EACH Cost Estimate: \$250.00 BSR: 2 Recommended			



Field Date:	12/18/2019 Repo	ort Date: 12/18/2019	Barrier #:	10D	earl 2	
Facility:	Community Corrections Resource Center - 404 H St, Eureka					
Location:	Conference Room 1					
Official Respo	nsible: Karen Clower	, ADA Coordinator		1		
Consent Decr	ee: No	Paragraph: M.51	Dwg:	1 of 1		
Barrier Area:	Alarms	Remediation	on: N/A			
Barrier Type:	Fire Extinguisher - Rea	ich Range				
Barrier Description:	Fire extinguisher high	reach exceeds 48"				
Code Referen	ces: CBC 11B-309.3 &	11B-308 and 2010 ADAS 30	09.3 & 30)8		
As Built Description:	Device moved to loca	tion where leading edge is r	max. 27"	high		
Proposed Solution:	Barrier removed					
As-Built Meas	: 0 Quantity:	JOB Cost Estimate:	0.00	BSR: 11	Necessary	
X Coordinate:	N/A	Y Coordinate: N/A		Z Coordinate	: N/A	
Implementati	on: Priority 3	Phase	Date 1	.2/18/2019	Status Closed	
Notes:						
Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 E	Barrier #:	10E	OF STATE OF	
Facility:	Community Correctio	ns Resource Center - 404 H	St, Eurek	ka 💮	THE STATE OF THE S	
Location:	Conference Room 1					
Official Respo	nsible: Karen Clowei	, ADA Coordinator				
Consent Decre	ee: No	Paragraph: M.51	Dwg:	1 of 1		
Barrier Area:	Alarms	Remediation	on: N/A			
Barrier Type:	Fire Extinguisher - Pro	truding Object				
Barrier Description:	Fire extinguisher in cir	culation path protrudes mo	ore than 4	4" between 27" :	and 80" high	
Code Referen	ces: CBC 11B-307.2 ar	nd 2010 ADAS 307.2				
As Built Description:	Fire extinguisher prot	rudes 4-1/4" at 27" high				
Proposed Solution:	Barrier removed					
As-Built Meas	: 0 Quantity:	EACH Cost Estimate:	50.00	BSR: 11	Necessary	
X Coordinate:	N/A	Y Coordinate: N/A		Z Coordinate	: N/A	
Implementati	on: Priority 3	Phase	Date 1	.2/18/2019	Status Closed	
Notes:						



Field Date: 11/13/2017 Report Date: 8/3/2018 Barrier #: 10F
Facility: Community Corrections Resource Center - 404 H St, Eureka
Location: Conference Room 1
Official Responsible: Karen Clower, ADA Coordinator
Consent Decree: No Paragraph: M.51 Dwg: 1 of 1
Barrier Area: Controls and Mechanisms Remediation: Required
Barrier Type: Electrical Outlets - Side Reach Low Unobstructed
Barrier Description: Electrical outlet control box not min. 15" high measured to the bottom of the outlet box
Code References: CBC 11B-308.1.2, 11B-308.3.1 and 2010 ADAS 308.3
As Built 12-3/4" high Description:
Proposed Relocate outlet to area with min. 15" low reach or max. 48" high reach Solution:
As-Built Meas: 1 Quantity: EACH Cost Estimate: \$750.00 BSR: 3 Hindrance
X Coordinate: N/A Y Coordinate: N/A Z Coordinate: N/A
Implementation: Priority 3 Phase Date Status Open
Notes: Property Owner Responsible.
Field Date: 12/18/2019 Report Date: 12/18/2019 Barrier #: 10G
Facility: Community Corrections Resource Center - 404 H St, Eureka
Location: Conference Room 1
Official Responsible: Karen Clower, ADA Coordinator
Consent Decree: No Paragraph: M.51 Dwg: 1 of 1
Barrier Area: Counters and Tables Remediation: Required
Barrier Type: Table - Knee Clearance
Barrier Description: Knee clearance of at least 27" high, 30" wide and 19" deep not provided
Code References: CBC 11B-306.3 and 2010 ADAS 306.3
Code References: CBC 11B-306.3 and 2010 ADAS 306.3 As Built Description: 26-1/2" high and 13" deep knee clearance. 5 tables total with no accessible tables
As Built 26-1/2" high and 13" deep knee clearance. 5 tables total with no accessible tables
As Built Description: 26-1/2" high and 13" deep knee clearance. 5 tables total with no accessible tables Proposed Provide min. 1 accessible table and 5% overall. Avoid pedestal base tables.
As Built Description: Proposed Solution: 26-1/2" high and 13" deep knee clearance. 5 tables total with no accessible tables Provide min. 1 accessible table and 5% overall. Avoid pedestal base tables.
As Built Description: Proposed Solution: Provide min. 1 accessible table and 5% overall. Avoid pedestal base tables. As-Built Meas: Quantity: EACH Cost Estimate: \$0.00 BSR: 3 Hindrance



Field Date:	12/18/2019	Repor	t Date:	12/18/2019	Barrier	#: 10H	N.		
Facility:	Community Co	rrection	s Resoui	rce Center - 404	H St, Eur	eka			-
Location:	Conference Ro	om 1						F	Z A
Official Respo	nsible: Karen	Clower,	ADA Co	ordinator			4	A	
Consent Decr	ee: No		Paragra	ph: M.51	Dw	/g: 1 of	1	4	
Barrier Area:	Accessible Rou	te - Inte	rior	Remedia	ation: N/	Ά			
Barrier Type:	Clear Width - 3	6" Wide	(Stored	Items)					
Barrier Description:	Accessible rout	e clear	width is	not min. 36" wid	de				
Code Referen	ces: CBC 11B-4	03.5.1 a	nd 2010) ADAS 403.5.1					
As Built Description:	Furniture rearr	anged t	o provid	e min. 36" wide	passage s	space th	rough roo	om.	
Proposed Solution:	Barrier remove	ed							
As-Built Meas	: 1 Qu	iantity:	JOB	Cost Estimate:	\$0.00		BSR: 2	Recomm	ended
X Coordinate:	N/A		Y Coord	inate: N/A		Z C	oordinate	e: N/A	
Implementati	on: Priority 3	3	Phase		Date	12/18/	2019	Status	Closed
Notes:									
Field Date:	12/18/2019	Repor	t Date:	12/18/2019	Barrier	#: 101	M		- The second second
Facility:	Community Co	rrection	s Resoui	rce Center - 404	H St, Eur	eka	76		
Location:	Conference Ro	om 1					6		
Official Respo	nsible: Karen	Clower,	ADA Co	ordinator					
Consent Decre	ee: No		Paragra	ph: M.51	Dw	/g: 1 of	1		
Barrier Area:	Classrooms			Remedia	ation: N/	Ά			
Barrier Type:	Whiteboard/Ch	nalkboai	rd - Cleai	r Floor Space					
Barrier Description:	Clear floor space	ce of mi	n. 30" bչ	y 48" not provid	ed				
Code Referen	ces: CBC 11B-3	05.3 an	d 2010 A	ADAS 305.3					
As Built Description:	Whiteboard me	oved to	provide	wheelchair acce	ess				
Proposed Solution:	Barrier remove	ed							
As-Built Meas	: 1 Qu	iantity:	JOB	Cost Estimate:	\$0.00		BSR: 1	Necessar	y
V C						7.0	o ordinat	3: NI/A	
X Coordinate:	N/A		Y Coord	inate: N/A		20	oordinate	e. IN/A	
Implementati			Y Coord Phase	, .	Date	12/18/		Status	Closed



Field Date:	12/18/2019 Repo	rt Date: 12/18/2019	Barrier #:	10J	
Facility:	Community Correction	ns Resource Center - 404 H	St, Eurek	a	
Location:	Conference Room 1				
Official Respo	nsible: Karen Clower	, ADA Coordinator			A LIVE
Consent Decr	ee: No	Paragraph: M.51	Dwg:	1 of 1	
Barrier Area:	Controls and Mechani	sms Remediation	on: Requ	uired	
Barrier Type:	Operable Part - Side R	each High Unobstructed			
Barrier Description:	Operable part not at n	nin. 15" or max. 48" high			
Code Referen	ces: CBC 11B-308.3.1	and 2010 ADAS 308.3.1			
As Built Description:	Coffee machine contro	ols 57" high			
Proposed Solution:	Assistance to be provi	ded by applying program a	ccess		
As-Built Meas	: 0 Quantity:	EACH Cost Estimate:	0.00	BSR: 3 H	Hindrance
X Coordinate:	N/A	Y Coordinate: N/A		Z Coordinate	: N/A
Implementati	on: Priority 3	Phase	Date		Status Open
Notes: Coun	ty intends to apply Prop	gram Access.			
Field Date:	12/18/2019 Repo	rt Date: 12/18/2019	Barrier #:	10K	
Facility:	Community Correction	ns Resource Center - 404 H	St, Eurek	a	8
Location:	Conference Room 1			ng v	
Official Respo	nsible: Karen Clower	, ADA Coordinator			
Consent Decre	ee: No	Paragraph: M.51	Dwg:	1 of 1	
Barrier Area:	Controls and Mechani	sms Remediation	on: N/A		
Barrier Type:	Operable Part - Side R	each Obstructed (>10"-24")		
Barrier Description:	Operable part betwee	n 10" to 24" deep over an o	obstructio	on max. 34" high	is located above 46"
Code Referen	ces: CBC 11B-308.3.2	and 2010 ADAS 308.3.2			
As Built Description:	Phone 50" high and 19)-1/2" deep			
Proposed Solution:	No remediation requir	ed. Phone is used by staff o	only.		
As-Built Meas	: 0 Quantity:	EACH Cost Estimate:	50.00	BSR: 3 H	Hindrance
X Coordinate:	N/A	Y Coordinate: N/A		Z Coordinate	: N/A
Implementati	on: Priority 3	Phase	Date 1	2/18/2019	Status Closed
Notes:					



Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 Barrier #:	11A
Facility:	Community Correction	ns Resource Center - 404 H St, Eureka	
Location:	Conference Room 2		
Official Respo	nsible: Karen Clower,	, ADA Coordinator	
Consent Decr	ee: No	Paragraph: M.51 Dwg: 1	1 of 1
Barrier Area:	Signage	Remediation: N/A	
Barrier Type:	Room ID Sign - No Tact	tile Information	
Barrier Description:	Room ID sign provided	I for sighted people lacks tactile info fo	or the visually impaired
Code Referen	ces: CBC 11B-216.2 an	id 2010 ADAS 216.2	
As Built Description:	Compliant tactile sign	provided	
Proposed Solution:	Barrier removed		
As-Built Meas	: 0 Quantity:	EACH Cost Estimate: \$0.00	BSR: 1 Necessary
X Coordinate:	N/A	Y Coordinate: N/A	Z Coordinate: N/A
Implementati	on: Priority 4	Phase Date 12/	/18/2019 Status Closed
Notes:			
Field Date:	11/13/2017 Repor	rt Date: 8/3/2018 Barrier #:	11B
Field Date: Facility:		rt Date: 8/3/2018 Barrier #: s Resource Center - 404 H St, Eureka	11B
			11B
Facility:	Community Correction Conference Room 2		118
Facility: Location:	Community Correction Conference Room 2 nsible: Karen Clower	ns Resource Center - 404 H St, Eureka	
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Correction Conference Room 2 nsible: Karen Clower, ee: No Doors or Gates	, ADA Coordinator Paragraph: M.51 Dwg: 1	1 of 1
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Correction Conference Room 2 nsible: Karen Clower, ee: No	, ADA Coordinator Paragraph: M.51 Dwg: 1	1 of 1
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Correction Conference Room 2 nsible: Karen Clower, ee: No Doors or Gates	Adjustment	1 of 1
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Correction Conference Room 2 nsible: Karen Clower, ee: No Doors or Gates Door Closer - Interior A	Adjustment ns Resource Center - 404 H St, Eureka ns Resource Center - 404 H St, Eureka ns Resource Center - 404 H St, Eureka Dwg: 1 Requirement Ceeds 5 lbf	1 of 1
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Correction Conference Room 2 nsible: Karen Clower, ee: No Doors or Gates Door Closer - Interior A	Adjustment ceeds 5 lbf and 2010 ADAS 404.2.9	1 of 1
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built	Community Correction Conference Room 2 nsible: Karen Clower, ee: No Doors or Gates Door Closer - Interior A Door opening force ex ces: CBC 11B-404.2.9 a	ADA Coordinator Paragraph: M.51 Dwg: 1 Remediation: Required Adjustment ceeds 5 lbf and 2010 ADAS 404.2.9 door opening device to compensate for lace	1 of 1 ed
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built Description: Proposed	Community Correction Conference Room 2 nsible: Karen Clower, ee: No Doors or Gates Door Closer - Interior A Door opening force ex ces: CBC 11B-404.2.9 a 8 lbf at non-fire rated of clearance at both sides	ADA Coordinator Paragraph: M.51 Dwg: 1 Remediation: Required Adjustment ceeds 5 lbf and 2010 ADAS 404.2.9 door opening device to compensate for lace	1 of 1 ed
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built Description: Proposed Solution:	Community Correction Conference Room 2 nsible: Karen Clower, ee: No Doors or Gates Door Closer - Interior A Door opening force ex ces: CBC 11B-404.2.9 a 8 lbf at non-fire rated of clearance at both sides : 1 Quantity:	ADA Coordinator Paragraph: M.51 Dwg: 1 Remediation: Required Adjustment ceeds 5 lbf and 2010 ADAS 404.2.9 door opening device to compensate for lacks of door	of 1 ed ek of required maneuvering
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built Description: Proposed Solution: As-Built Meas	Community Correction Conference Room 2 nsible: Karen Clower, ee: No Doors or Gates Door Closer - Interior A Door opening force ex ces: CBC 11B-404.2.9 a 8 lbf at non-fire rated of clearance at both sides Install automatic door clearance at both sides Install Quantity:	Adjustment ceeds 5 lbf and 2010 ADAS 404.2.9 door opening device to compensate for laces of door EACH Cost Estimate: \$5,000.00	ck of required maneuvering BSR: 1 Necessary



Field Date: 11/13/2017 Report Date: 8/3/2018 Barrier #: 11C
Facility: Community Corrections Resource Center - 404 H St, Eureka
Location: Conference Room 2
Official Responsible: Karen Clower, ADA Coordinator
Consent Decree: No Paragraph: M.51 Dwg: 1 of 1
Barrier Area: Doors or Gates Remediation: Required
Barrier Type: Door Closer - Interior Sweep
Barrier Door closer lacks min. 5 second sweep period/back check Description:
Code References: CBC 11B-404.2.8.1 and ADA/ABA 404.2.8.1
As Built 3 second sweep at non-fire rated door Description:
Proposed Install automatic door opening device to compensate for lack of required maneuvering clearance at both sides of door
As-Built Meas: 0 Quantity: EACH Cost Estimate: \$0.00 BSR: 2 Recommended
X Coordinate: N/A Y Coordinate: N/A Z Coordinate: N/A
Implementation: Priority 3 Phase Date Status Open
Notes: County intends to apply Program Access. Public is escorted by staff at all times in this area.
Field Date: 11/13/2017 Report Date: 8/3/2018 Barrier #: 11D
Facility: Community Corrections Resource Center - 404 H St, Eureka
Location: Conference Room 2
Official Responsible: Karen Clower, ADA Coordinator
Consent Decree: No Paragraph: M.51 Dwg: 1 of 1
Barrier Area: Doors or Gates Remediation: Required
Barrier Type: Maneuvering Cl - Front App/Push 12"
Barrier Door/Gate with latch/closer at push side lacks min. 12" beyond latch side of door Description:
Code References: CBC Figure 11B-404.2.4.1 and 2010 ADAS 404.2.4.1
As Built Description: 7" maneuvering clearance at push side of door
Proposed Install automatic door opening device to compensate for lack of required maneuvering clearance at both sides of door
As-Built Meas: 1 Quantity: EACH Cost Estimate: \$5,000.00 BSR: 1 Necessary
X Coordinate: N/A Y Coordinate: N/A Z Coordinate: N/A
Implementation: Priority 3 Phase Date Status Open
Notes: County intends to apply Program Access. Public is escorted by staff at all times in this area.



Field Date:	12/18/2019 Report	Date: 12/18/2019 Barrier #: 11E			
Facility:	Community Corrections	Resource Center - 404 H St, Eureka			
Location:	Conference Room 2				
Official Respo	nsible: Karen Clower, A	DA Coordinator			
Consent Decr	ee: No P	aragraph: M.51 Dwg: 1 of 1			
Barrier Area:	Doors or Gates	Remediation: N/A			
Barrier Type:	Maneuvering Cl - Stored	Items			
Barrier Description:	Door/Gate lacks require	d maneuvering clearance			
Code Referen	ces: CBC Figure 11B-404	.2.4.1 and 2010 ADAS 404.2.4.1			
As Built Description:	Trash bin moved that wa	as blocking maneuvering clearance at pull side of door			
Proposed Solution:	Barrier removed				
As-Built Meas	: 0 Quantity:	ACH Cost Estimate: \$0.00 BSR: 1 Necessary			
X Coordinate:	N/A Y	Coordinate: N/A Z Coordinate: N/A			
Implementati	on: Priority 3	Phase Date 12/18/2019 Status Closed			
Notes:					
Field Date:	12/18/2019 Report	Date: 12/18/2019 Barrier #: 11F			
Field Date: Facility:		Date: 12/18/2019 Barrier #: 11F Resource Center - 404 H St, Eureka			
Facility:	Community Corrections Conference Room 2	Resource Center - 404 H St, Eureka			
Facility: Location:	Community Corrections Conference Room 2 Insible: Karen Clower, A	Resource Center - 404 H St, Eureka			
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Corrections Conference Room 2 consible: Karen Clower, A ee: No P Signage	Resource Center - 404 H St, Eureka DA Coordinator			
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Corrections Conference Room 2 Insible: Karen Clower, A	Resource Center - 404 H St, Eureka DA Coordinator aragraph: M.51 Dwg: 1 of 1			
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Corrections Conference Room 2 Insible: Karen Clower, A ee: No P Signage Tactile Exit Sign - Route	Resource Center - 404 H St, Eureka DA Coordinator aragraph: M.51 Dwg: 1 of 1			
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Corrections Conference Room 2 Insible: Karen Clower, A ee: No P Signage Tactile Exit Sign - Route Exit door to exterior thru	Resource Center - 404 H St, Eureka DA Coordinator aragraph: M.51 Remediation: N/A			
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Corrections Conference Room 2 Insible: Karen Clower, A ee: No P Signage Tactile Exit Sign - Route Exit door to exterior thru	Resource Center - 404 H St, Eureka DA Coordinator aragraph: M.51 Remediation: N/A Dwg: 1 of 1 Remediation: N/A 1 exit enclosure, interior room or passageway lacks "EXIT ROUTE" sign			
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built	Community Corrections Conference Room 2 Insible: Karen Clower, A ee: No P Signage Tactile Exit Sign - Route Exit door to exterior thruces: CBC 11B-216.4.1 &	Resource Center - 404 H St, Eureka DA Coordinator aragraph: M.51 Remediation: N/A Dwg: 1 of 1 Remediation: N/A 1 exit enclosure, interior room or passageway lacks "EXIT ROUTE" sign			
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built Description: Proposed	Community Corrections Conference Room 2 Insible: Karen Clower, A Insibl	Resource Center - 404 H St, Eureka ADA Coordinator aragraph: M.51 Dwg: 1 of 1 Remediation: N/A a exit enclosure, interior room or passageway lacks "EXIT ROUTE" sign 11B-703 and 2010 ADAS 216.4.1 d where required			
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built Description: Proposed Solution:	Community Corrections Conference Room 2 Insible: Karen Clower, A Insibl	Resource Center - 404 H St, Eureka ADA Coordinator aragraph: M.51 Dwg: 1 of 1 Remediation: N/A a exit enclosure, interior room or passageway lacks "EXIT ROUTE" sign 11B-703 and 2010 ADAS 216.4.1 d where required			
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built Description: Proposed Solution: As-Built Meas	Community Corrections Conference Room 2 Insible: Karen Clower, A Insibl	Resource Center - 404 H St, Eureka ADA Coordinator aragraph: M.51 Dwg: 1 of 1 Remediation: N/A Description: N/A Description: Remediation: Remediation: N/A Description: Remediation: Remedi			



Field Date:	12/18/2019 Report Date: 12/18/2019 Barrier #: 11G					
Facility:	Community Corrections Resource Center - 404 H St, Eureka					
Location:						
Official Respo	nsible: Karen Clower, ADA Coordinator					
Consent Decre	ee: No Paragraph: M.51 Dwg: 1 of 1					
Barrier Area:	Counters and Tables Remediation: Required					
Barrier Type:	Table - Knee Clearance					
Barrier Description:	Knee clearance of at least 27" high, 30" wide and 19" deep not provided					
Code Referen	ces: CBC 11B-306.3 and 2010 ADAS 306.3					
As Built Description:	26-1/2" and 13" deep knee clearance. 5 total tables provided with no accessible table					
Proposed Solution:	Provide min. 1 accessible table and 5% overall. Avoid pedestal base tables.					
As-Built Meas	O Quantity: EACH Cost Estimate: \$0.00 BSR: 3 Hindrance					
X Coordinate:	N/A Y Coordinate: N/A Z Coordinate: N/A					
Implementation	on: Priority 3 Phase Date Status Open					
Notes: Co	unty Responsibility.					
Field Date:	12/18/2019 Report Date: 12/18/2019 Barrier #: 11H					
Field Date: Facility:	12/18/2019 Report Date: 12/18/2019 Barrier #: 11H Community Corrections Resource Center - 404 H St, Eureka					
Facility:						
Facility: Location:	Community Corrections Resource Center - 404 H St, Eureka Conference Room 2 Insible: Karen Clower, ADA Coordinator					
Facility: Location:	Community Corrections Resource Center - 404 H St, Eureka Conference Room 2 Insible: Karen Clower, ADA Coordinator					
Facility: Location: Official Responsent Decre Barrier Area:	Community Corrections Resource Center - 404 H St, Eureka Conference Room 2 Insible: Karen Clower, ADA Coordinator Insible: No Paragraph: M.51 Dwg: 1 of 1 Accessible Route - Interior Remediation: N/A					
Facility: Location: Official Responsent Decre Barrier Area:	Community Corrections Resource Center - 404 H St, Eureka Conference Room 2 nsible: Karen Clower, ADA Coordinator ee: No Paragraph: M.51 Dwg: 1 of 1					
Facility: Location: Official Responsent Decre Barrier Area:	Community Corrections Resource Center - 404 H St, Eureka Conference Room 2 Insible: Karen Clower, ADA Coordinator Insible: No Paragraph: M.51 Dwg: 1 of 1 Accessible Route - Interior Remediation: N/A					
Facility: Location: Official Respondence Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Corrections Resource Center - 404 H St, Eureka Conference Room 2 Insible: Karen Clower, ADA Coordinator Insible: No Paragraph: M.51 Dwg: 1 of 1 Accessible Route - Interior Remediation: N/A Clear Width - 36" Wide (Stored Items)					
Facility: Location: Official Respondence Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Corrections Resource Center - 404 H St, Eureka Conference Room 2 Insible: Karen Clower, ADA Coordinator Insible: No Paragraph: M.51 Dwg: 1 of 1 Accessible Route - Interior Remediation: N/A Clear Width - 36" Wide (Stored Items) Accessible route clear width is not min. 36" wide					
Facility: Location: Official Respondence Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference As Built	Community Corrections Resource Center - 404 H St, Eureka Conference Room 2 Insible: Karen Clower, ADA Coordinator Insible: No Paragraph: M.51 Dwg: 1 of 1 Accessible Route - Interior Remediation: N/A Clear Width - 36" Wide (Stored Items) Accessible route clear width is not min. 36" wide Insible: CBC 11B-403.5.1 and 2010 ADAS 403.5.1					
Facility: Location: Official Respondence Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference As Built Description: Proposed	Community Corrections Resource Center - 404 H St, Eureka Conference Room 2 nsible: Karen Clower, ADA Coordinator nsible: No Paragraph: M.51 Dwg: 1 of 1 Accessible Route - Interior Remediation: N/A Clear Width - 36" Wide (Stored Items) Accessible route clear width is not min. 36" wide nses: CBC 11B-403.5.1 and 2010 ADAS 403.5.1 Furniture rearranged to provide min. 36" wide passage space through room. Barrier removed					
Facility: Location: Official Respondence Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference As Built Description: Proposed Solution:	Community Corrections Resource Center - 404 H St, Eureka Conference Room 2 Insible: Karen Clower, ADA Coordinator Insible: Karen Clower, ADA Coordinator Insible: Route - Interior Remediation: N/A Accessible Route - Interior Remediation: N/A Clear Width - 36" Wide (Stored Items) Accessible route clear width is not min. 36" wide Insible: Karen Clower, ADA Coordinator Remediation: N/A Clear Width - 36" Wide (Stored Items) Accessible route clear width is not min. 36" wide Insible: Karen Clower, ADA Coordinator Remediation: N/A Insible: Route - Interior Remediation: N/A Insible:					
Facility: Location: Official Respondence of Consent Decree Barrier Area: Barrier Type: Barrier Description: Code Reference As Built Description: Proposed Solution: As-Built Meas	Community Corrections Resource Center - 404 H St, Eureka Conference Room 2 Insible: Karen Clower, ADA Coordinator Insible:					



Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 Ba	arrier #: 111	
Facility:	Community Correction	ns Resource Center - 404 H S	t, Eureka	
Location:	Conference Room 2			
Official Respo	nsible: Karen Clower	, ADA Coordinator		3
Consent Decre	ee: No	Paragraph: M.51	Dwg: 1 of 1	
Barrier Area:	Classrooms	Remediation	n: N/A	
Barrier Type:	Whiteboard/Chalkboa	rd - Clear Floor Space		
Barrier Description:	Clear floor space of mi	n. 30" by 48" not provided		
Code Referen	ces: CBC 11B-305.3 an	d 2010 ADAS 305.3		
As Built Description:	One whiteboard move	d to provide wheelchair acco	ess and additional w	hiteboards removed
Proposed Solution:	Barrier removed			
As-Built Meas	: 1 Quantity:	JOB Cost Estimate: \$0	0.00 BSR:	1 Necessary
X Coordinate:	N/A	Y Coordinate: N/A	Z Coordin	ate: N/A
Implementati	on: Priority 3	Phase	Date 12/18/2019	Status Closed
Notes:				
Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 Ba	arrier #: 11J	
Field Date: Facility:		rt Date: 12/18/2019 Ba		
Facility: Location:	Community Correction	ns Resource Center - 404 H S		
Facility: Location:	Community Correction Conference Room 2 nsible: Karen Clower	ns Resource Center - 404 H S		For the state of t
Facility: Location: Official Respo Consent Decre	Community Correction Conference Room 2 nsible: Karen Clower	ns Resource Center - 404 H S , ADA Coordinator	t, Eureka Dwg: 1 of 1	
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Correction Conference Room 2 nsible: Karen Clower ee: No	, ADA Coordinator Paragraph: M.51 Remediation	t, Eureka Dwg: 1 of 1	Fig. 12.
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Correction Conference Room 2 nsible: Karen Clower ee: No Counters and Tables Podium - Knee Clearar	, ADA Coordinator Paragraph: M.51 Remediation	Dwg: 1 of 1	provided
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Correction Conference Room 2 nsible: Karen Clower ee: No Counters and Tables Podium - Knee Clearar	, ADA Coordinator Paragraph: M.51 Remediation nce e of at least 27" high, 30" wi	Dwg: 1 of 1	provided
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Correction Conference Room 2 nsible: Karen Clower ee: No Counters and Tables Podium - Knee Clearan Podium knee clearanc	ADA Coordinator Paragraph: M.51 Remediation nce e of at least 27" high, 30" wi	Dwg: 1 of 1	provided
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference As Built	Community Correction Conference Room 2 nsible: Karen Clower ee: No Counters and Tables Podium - Knee Clearar Podium knee clearanc ces: CBC 11B-902.2 an	ADA Coordinator Paragraph: M.51 Remediation nce e of at least 27" high, 30" will d 2010 ADAS 902.2 existing podium	Dwg: 1 of 1	provided
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference As Built Description: Proposed	Community Correction Conference Room 2 nsible: Karen Clower ee: No Counters and Tables Podium - Knee Clearar Podium knee clearanc ces: CBC 11B-902.2 an No knee clearance at e	ADA Coordinator Paragraph: M.51 Remediation nce e of at least 27" high, 30" wind 2010 ADAS 902.2 existing podium ng field investigation	Dwg: 1 of 1 n: N/A de and 8" deep not p	provided 1 Necessary
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referent As Built Description: Proposed Solution:	Community Correction Conference Room 2 nsible: Karen Clower ee: No Counters and Tables Podium - Knee Clearar Podium knee clearanc ces: CBC 11B-902.2 an No knee clearance at 6	ADA Coordinator Paragraph: M.51 Remediation nce e of at least 27" high, 30" wi d 2010 ADAS 902.2 existing podium ng field investigation	Dwg: 1 of 1 n: N/A de and 8" deep not p	1 Necessary
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference As Built Description: Proposed Solution: As-Built Meas	Community Correction Conference Room 2 nsible: Karen Clower ee: No Counters and Tables Podium - Knee Clearar Podium knee clearanc ces: CBC 11B-902.2 an No knee clearance at e	ADA Coordinator Paragraph: M.51 Remediation nce e of at least 27" high, 30" will d 2010 ADAS 902.2 existing podium ng field investigation EACH Cost Estimate: \$0 Y Coordinate: N/A	Dwg: 1 of 1 n: N/A de and 8" deep not p	1 Necessary



Field Date: 11/13/2017 Report Date: 8/3/2018 Barrier #: 11K
Facility: Community Corrections Resource Center - 404 H St, Eureka
Location: Conference Room 2
Official Responsible: Karen Clower, ADA Coordinator
Consent Decree: No Paragraph: M.51 Dwg: 1 of 1
Barrier Area: Alarms Remediation: Required
Barrier Type: Horn/Strobe - Meeting Room
Barrier Description: No horn/strobes in meeting room
Code References: CBC 11B-702.1 and 2010 ADAS 702.1
As Built Device not provided Description:
Proposed Solution: Provide strobe in common use area
As-Built Meas: 1 Quantity: EACH Cost Estimate: \$5,500.00 BSR: 1 Necessary
X Coordinate: N/A Y Coordinate: N/A Z Coordinate: N/A
Implementation: Priority 3 Phase Date Status Open
Notes: Property Owner Responsible.
Field Date: 12/18/2019 Report Date: 12/18/2019 Barrier #: 12A
Facility: Community Corrections Resource Center - 404 H St, Eureka
Location: Conference Room 3
Official Responsible: Karen Clower, ADA Coordinator
Consent Decree: No Paragraph: M.51 Dwg: 1 of 1
Barrier Area: Signage Remediation: Required
Barrier Type: Evacuation Plan Sign - Character Height
Barrier Visual character height less than 5/8" high Description:
Code References: 2010 ADAS 703.5.5 (CBC 11B-703.5.5 less stringent)
As Built Description: 1/4" character height
Proposed Solution: Provide compliant evacuation sign
As-Built Meas: 1 Quantity: EACH Cost Estimate: \$250.00 BSR: 2 Recommended
X Coordinate: N/A Y Coordinate: N/A Z Coordinate: N/A
Implementation: Priority 4 Phase Date Status Open
Notes: County Responsible.



Field Date:	12/18/2019 Report Date: 12/18/2019 Barrier #: 12B
Facility:	Community Corrections Resource Center - 404 H St, Eureka
Location:	Conference Room 3
Official Respo	nsible: Karen Clower, ADA Coordinator
Consent Decre	ee: No Paragraph: M.51 Dwg: 1 of 1
Barrier Area:	Controls and Mechanisms Remediation: N/A
Barrier Type:	Electrical Switches - Clear Floor Space (Stored Items)
Barrier Description:	Clear floor space for wheelchair not provided at light switch control box
Code Referen	Ces: CBC 11B-305.3 and 2010 ADAS 305.3
As Built Description:	Trash bin moved that was blocking electrical switch clear floor space
Proposed Solution:	Barrier removed
As-Built Meas	Quantity: JOB Cost Estimate: \$0.00 BSR: 1 Necessary
X Coordinate:	N/A Y Coordinate: N/A Z Coordinate: N/A
Implementati	on: Priority 3 Phase Date 12/18/2019 Status Closed
Notes:	
Field Date:	12/18/2019 Report Date: 12/18/2019 Barrier #: 12C
Field Date: Facility:	12/18/2019 Report Date: 12/18/2019 Barrier #: 12C Community Corrections Resource Center - 404 H St, Eureka
Facility: Location:	Community Corrections Resource Center - 404 H St, Eureka
Facility: Location:	Community Corrections Resource Center - 404 H St, Eureka Conference Room 3 nsible: Karen Clower, ADA Coordinator
Facility: Location: Official Respo Consent Decre	Community Corrections Resource Center - 404 H St, Eureka Conference Room 3 nsible: Karen Clower, ADA Coordinator
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Corrections Resource Center - 404 H St, Eureka Conference Room 3 Insible: Karen Clower, ADA Coordinator Ree: No Paragraph: M.51 Dwg: 1 of 1
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Corrections Resource Center - 404 H St, Eureka Conference Room 3 nsible: Karen Clower, ADA Coordinator ee: No Paragraph: M.51 Dwg: 1 of 1 Accessible Route - Interior Remediation: N/A
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Corrections Resource Center - 404 H St, Eureka Conference Room 3 Insible: Karen Clower, ADA Coordinator Insible: No Paragraph: M.51 Dwg: 1 of 1 Accessible Route - Interior Remediation: N/A Clear Width - 36" Wide (Stored Items)
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Corrections Resource Center - 404 H St, Eureka Conference Room 3 Insible: Karen Clower, ADA Coordinator Insible: No Paragraph: M.51 Dwg: 1 of 1 Accessible Route - Interior Remediation: N/A Clear Width - 36" Wide (Stored Items) Accessible route clear width is not min. 36" wide
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built	Community Corrections Resource Center - 404 H St, Eureka Conference Room 3 Insible: Karen Clower, ADA Coordinator Insible: No Paragraph: M.51 Dwg: 1 of 1 Accessible Route - Interior Remediation: N/A Clear Width - 36" Wide (Stored Items) Accessible route clear width is not min. 36" wide Ces: CBC 11B-403.5.1 and 2010 ADAS 403.5.1
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built Description: Proposed	Community Corrections Resource Center - 404 H St, Eureka Conference Room 3 Insible: Karen Clower, ADA Coordinator Insible: Karen Clower, ADA Coordinator Insible: Route - Interior Insible: Remediation: N/A Clear Width - 36" Wide (Stored Items) Accessible route clear width is not min. 36" wide Coes: CBC 11B-403.5.1 and 2010 ADAS 403.5.1 Furniture rearranged to provide min. 36" wide passage space through room Barrier removed
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built Description: Proposed Solution:	Community Corrections Resource Center - 404 H St, Eureka Conference Room 3 Insible: Karen Clower, ADA Coordinator Insible: Karen Clower, ADA Coordinator Insible: No Paragraph: M.51 Dwg: 1 of 1 Insible: Paragraph: Paragraph: M.51 Dwg: 1 of 1 Insible: No Paragraph: No
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built Description: Proposed Solution: As-Built Meas	Community Corrections Resource Center - 404 H St, Eureka Conference Room 3 Insible: Karen Clower, ADA Coordinator Insible: Karen Clower, ADA Coordinator Insible: Remediation: M.51 Insible: Remediation: M.51 Insible: No Paragraph: M.51 Insible: Paragraph: M.51 Insible: Remediation: M.51 Ins



Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 B	arrier #: 12D			
Facility:	Community Correction	ns Resource Center - 404 H	St, Eureka			
Location:	Conference Room 3					
Official Respo	nsible: Karen Clower	, ADA Coordinator				
Consent Decr	ee: No	Paragraph: M.51	Dwg: 1 of 1			
Barrier Area:	Classrooms	Remediatio	n: N/A			
Barrier Type:	Whiteboard/Chalkboa	rd - Clear Floor Space				
Barrier Description:	Clear floor space of m	in. 30" by 48" not provided				
Code Referen	ces: CBC 11B-305.3 ar	nd 2010 ADAS 305.3				
As Built Description:	Tables rearranged to p	provide wheelchair access a	t min. 1 whitebo	pard/chalkboard		
Proposed Solution:	Barrier removed					
As-Built Meas	: 1 Quantity:	JOB Cost Estimate: \$	0.00	BSR: 1 Necessary		
X Coordinate:	N/A	Y Coordinate: N/A	Z Co	ordinate: N/A		
Implementati	on: Priority 3	Phase	Date 12/18/2	O19 Status Closed		
Notes:						
Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 B	arrier #: 13A			
Facility:	Community Correction	ns Resource Center - 404 H	St, Eureka			
Location:	Open Staff Work Spac	e				
Official Respo	nsible: Karen Clower	, ADA Coordinator				
Consent Decr	ee: No	Paragraph: M.51	Dwg: 1 of 1			
Barrier Area:	Signage	Remediatio	n: N/A			
Barrier Type:	Room ID Sign - No Tac	tile Information				
Barrier Description:	Room ID sign provided	d for sighted people lacks ta	ctile info for the	visually impaired		
Code Referen	ces: CBC 11B-216.2 ar	nd 2010 ADAS 216.2				
As Built Description:	Compliant tactile sign	provided				
Proposed Solution:	Barrier removed					
As-Built Meas	: 0 Quantity:	EACH Cost Estimate: \$	0.00	BSR: 1 Necessary		
X Coordinate:	N/A	Y Coordinate: N/A	Z Co	ordinate: N/A		
Implementati	on: Priority 4	Phase	Date 12/18/2	O19 Status Closed		
Notes:						



Field Date:	12/18/2019 Repo	ort Date: 12/18/2019	Barrier #:	13B		
Facility:	Community Correction	ns Resource Center - 404 H	St, Eureka			
Location:	Open Staff Work Space					
Official Respo	nsible: Karen Clowe	r, ADA Coordinator			A STATE OF THE STA	
Consent Decr	ee: No	Paragraph: M.51	Dwg:	1 of 1		
Barrier Area:	Doors or Gates	Remediati	on: N/A			
Barrier Type:	Door Closer - Interior	Adjustment				
Barrier Description:	Door opening force e	cceeds 5 lbf				
Code Referen	ces: CBC 11B-404.2.9	and 2010 ADAS 404.2.9				
As Built Description:	Door closer removed	at door measured with 7 lb	f at non-fire	e rated door		
Proposed Solution:	Barrier removed					
As-Built Meas	: 0 Quantity	EACH Cost Estimate:	\$0.00	BSR: 1 N	lecessary	
X Coordinate:	N/A	Y Coordinate: N/A		Z Coordinate	: N/A	
Implementati	on: Priority 2	Phase	Date 12/	/18/2019	Status Closed	
Notes:						
Field Date:	12/18/2019 Repo	ort Date: 12/18/2019	Barrier #:	13C		
Facility:	Community Correction	ns Resource Center - 404 H	St, Eureka			
Location:	Open Staff Work Space	e		112		
Official Respo	nsible: Karen Clowe	r, ADA Coordinator			And the second s	
Consent Decre	ee: No	Paragraph: M.51	Dwg:	1 of 1		
Barrier Area:	Doors or Gates	Remediati	on: N/A			
Barrier Type:	Door Closer - Interior	Sweep				
Barrier Description:	Door closer lacks min	. 5 second sweep period/ba	ack check			
Code Referen	ces: CBC 11B-404.2.8	1 and ADA/ABA 404.2.8.1				
As Built Description:	Door closer removed	where 3 second sweep was	s measured	at non-fire rat	ed door	
Proposed Solution:	Barrier removed					
As-Built Meas	: 0 Quantity	EACH Cost Estimate:	\$0.00	BSR: 2 F	Recommended	
X Coordinate:	N/A	Y Coordinate: N/A		Z Coordinate	N/A	
Implementati						
implementati	on: Priority 2	Phase	Date 12/	/18/2019	Status Closed	



Field Date:	11/13/2017 Report Date: 8/3/2018 Barrier #: 13D					
Facility:	Community Corrections Resource Center - 404 H St, Eureka					
Location:	Open Staff Work Space					
Official Respo	nsible: Karen Clower, ADA Coordinator					
Consent Decre	ee: No Paragraph: M.51 Dwg: 1 of 1					
Barrier Area:	Doors or Gates Remediation: Required					
Barrier Type:	Vision Lights - Existing					
Barrier Description:	Doors, gates, and side lights adjacent to opening not max. 43" above floor/ground					
Code Referen	CBC 11B-404.2.11 and 2010 ADAS 404.2.11					
As Built Description:	View panel 51-1/2" high					
Proposed Solution:	Replace door or vision panel in door					
As-Built Meas	1 Quantity: EACH Cost Estimate: \$2,250.00 BSR: 3 Hindrance					
X Coordinate:	N/A Y Coordinate: N/A Z Coordinate: N/A					
Implementati	on: Priority 2 Phase Date Status Open					
Notes: Cou	nty intends to apply Program Access. Public is escorted by staff at all times in this area.					
Field Date:	12/18/2019 Report Date: 12/18/2019 Barrier #: 13E					
Facility:	Community Corrections Resource Center - 404 H St, Eureka					
Location:	Open Staff Work Space					
Official Respo	nsible: Karen Clower, ADA Coordinator					
Consent Decre	ee: No Paragraph: M.51 Dwg: 1 of 1					
Barrier Area:	Signage Remediation: N/A					
Barrier Type:	Tactile Exit Sign - Route					
Barrier Description:	Exit door to exterior thru exit enclosure, interior room or passageway lacks "EXIT ROUTE" sign					
Code Referen	CBC 11B-216.4.1 & 11B-703 and 2010 ADAS 216.4.1					
As Built Description:	New tactile sign provided where required					
Proposed Solution:	Barrier removed					
As-Built Meas	O Quantity: EACH Cost Estimate: \$0.00 BSR: 2 Recommended					
X Coordinate:	N/A Y Coordinate: N/A Z Coordinate: N/A					
Implementati	on: Priority 4 Phase Date 12/18/2019 Status Closed					
Notes:						



Field Date:	12/18/2019 Repo	ort Date: 12/18/2019 Barrier #: 13F			
Facility:	Community Corrections Resource Center - 404 H St, Eureka				
Location:	Open Staff Work Space				
Official Respo	nsible: Karen Clower	r, ADA Coordinator			
Consent Decre	ee: No	Paragraph: M.51 Dwg: 1 of 1			
Barrier Area:	Signage	Remediation: N/A			
Barrier Type:	Room ID Sign - No Tac	ctile Information			
Barrier Description:	Room ID sign provided	d for sighted people lacks tactile info for the visually impaired			
Code Referen	ces: CBC 11B-216.2 an	nd 2010 ADAS 216.2			
As Built Description:	Compliant tactile sign	provided where visual sign exists at room 13			
Proposed Solution:	Barrier removed				
As-Built Meas	: 0 Quantity:	EACH Cost Estimate: \$0.00 BSR: 1 Necessary			
X Coordinate:	N/A	Y Coordinate: N/A Z Coordinate: N/A			
Implementati	on: Priority 4	Phase Date 12/18/2019 Status Closed			
Notes:					
Field Date:	11/13/2017 Repo	ort Date: 8/3/2018 Barrier #: 13G			
Field Date: Facility:		ort Date: 8/3/2018 Barrier #: 13G ns Resource Center - 404 H St, Eureka			
		ns Resource Center - 404 H St, Eureka			
Facility:	Community Correction Open Staff Work Space	ns Resource Center - 404 H St, Eureka			
Facility: Location:	Community Correction Open Staff Work Space nsible: Karen Clower	ns Resource Center - 404 H St, Eureka			
Facility: Location: Official Respo	Community Correction Open Staff Work Space nsible: Karen Clower ee: No	ns Resource Center - 404 H St, Eureka se r, ADA Coordinator			
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Correction Open Staff Work Space nsible: Karen Clower ee: No	ns Resource Center - 404 H St, Eureka re r, ADA Coordinator Paragraph: M.51 Remediation: Required			
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Correction Open Staff Work Space nsible: Karen Clower ee: No Alarms	ns Resource Center - 404 H St, Eureka re r, ADA Coordinator Paragraph: M.51 Remediation: Required rea			
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Correction Open Staff Work Space nsible: Karen Clower ee: No Alarms Horn/Strobe - Staff Are	ns Resource Center - 404 H St, Eureka te r, ADA Coordinator Paragraph: M.51 Remediation: Required ff areas			
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Correction Open Staff Work Space nsible: Karen Clower ee: No Alarms Horn/Strobe - Staff Are No horn/strobe in staf	ns Resource Center - 404 H St, Eureka te r, ADA Coordinator Paragraph: M.51 Remediation: Required ff areas			
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference	Community Correction Open Staff Work Space nsible: Karen Clower ee: No Alarms Horn/Strobe - Staff Are No horn/strobe in staf ces: CBC 11B-702.1 and Device not provided	ns Resource Center - 404 H St, Eureka te r, ADA Coordinator Paragraph: M.51 Remediation: Required ff areas			
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referent As Built Description: Proposed	Community Correction Open Staff Work Space nsible: Karen Clower ee: No Alarms Horn/Strobe - Staff Are No horn/strobe in staff ces: CBC 11B-702.1 and Device not provided Provide horn/strobe in	ns Resource Center - 404 H St, Eureka te r, ADA Coordinator Paragraph: M.51 Dwg: 1 of 1 Remediation: Required rea ff areas and 2010 ADAS 702.1			
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referent As Built Description: Proposed Solution:	Community Correction Open Staff Work Space nsible: Karen Clower ee: No Alarms Horn/Strobe - Staff Are No horn/strobe in staff ces: CBC 11B-702.1 and Device not provided Provide horn/strobe in	ns Resource Center - 404 H St, Eureka se r, ADA Coordinator Paragraph: M.51 Remediation: Required rea ff areas nd 2010 ADAS 702.1 n area where programs, services and activities take place			
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference As Built Description: Proposed Solution: As-Built Meas	Community Correction Open Staff Work Space nsible: Karen Clower ee: No Alarms Horn/Strobe - Staff Are No horn/strobe in staff ces: CBC 11B-702.1 an Device not provided Provide horn/strobe in 1 Quantity: N/A	ns Resource Center - 404 H St, Eureka se r, ADA Coordinator Paragraph: M.51 Dwg: 1 of 1 Remediation: Required rea ff areas nd 2010 ADAS 702.1 paragraph: Remediation: Required paragraph: Requir			



Field Date: 12/18/2019 Report Date: 12/18/2019 Barrier #: 13H
Facility: Community Corrections Resource Center - 404 H St, Eureka
Location: Open Staff Work Space
Official Responsible: Karen Clower, ADA Coordinator
Consent Decree: No Paragraph: M.51 Dwg: 1 of 1
Barrier Area: Signage Remediation: Required
Barrier Type: Evacuation Plan Sign - Character Height
Barrier Visual character height less than 5/8" high Description:
Code References: 2010 ADAS 703.5.5 (CBC 11B-703.5.5 less stringent)
As Built 1/4" character height Description:
Proposed Solution:
As-Built Meas: 1 Quantity: EACH Cost Estimate: \$250.00 BSR: 2 Recommended
X Coordinate: N/A Y Coordinate: N/A Z Coordinate: N/A
Implementation: Priority 4 Phase Date Status Open
Notes: County Responsible.
Field Date: 12/18/2019 Report Date: 12/18/2019 Barrier #: 13I
Facility: Community Corrections Resource Center - 404 H St, Eureka
Location: Open Staff Work Space
Official Responsible: Karen Clower, ADA Coordinator
Consent Decree: No Paragraph: M.51 Dwg: 1 of 1
Barrier Area: Counters and Tables Remediation: N/A
Barrier Type: Counter - Protruding Object
Barrier Counter or table in route of travel protrudes more than 4" above 27" high Description:
Code References: CBC 11B-307 and 2010 ADAS 307
As Built Detectable warning installed with leading edge below 27" high on each side Description:
Proposed Barrier removed Solution:
As-Built Meas: 0 Quantity: EACH Cost Estimate: \$0.00 BSR: 1 Necessary
X Coordinate: N/A Y Coordinate: N/A Z Coordinate: N/A
Implementation: Priority 2 Phase Date 12/18/2019 Status Closed
Notes:



Field Date:	12/18/2019 Repor	rt Date: 12/18/2019 Barr	ier #: 13J		
Facility:	Community Corrections Resource Center - 404 H St, Eureka				
Location:	Open Staff Work Space				
Official Respo	nsible: Karen Clower,	ADA Coordinator			
Consent Decr	ee: No	Paragraph: M.51	Dwg: 1 of 1		
Barrier Area:	Clear Floor Space	Remediation:	Required		
Barrier Type:	Clear Floor Space - Wh	eelchair Use (Stored Items)			
Barrier Description:	Clear floor space of mi	n. 30" by 48" not provided at ϵ	element required to be accessible		
Code Referen	ces: CBC 11B-305 and	2010 ADAS 305			
As Built Description:	No wheelchair space p	rovided within cubicle			
Proposed Solution:	County indicated that accessible tables are p		nts will be served in conference room, after		
As-Built Meas	: 1 Quantity:	JOB Cost Estimate: \$0.0	0 BSR: 1 Necessary		
X Coordinate:	N/A	Y Coordinate: N/A	Z Coordinate: N/A		
Implementati	on: Priority 2	Phase Da	Status Open		
Notes: Coun	ty intends to apply Prog	ram Access.			
Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 Barr	ier #: 13K		
Facility:	Community Correction	s Resource Center - 404 H St, I	Eureka		
Location:	Open Staff Work Space	2			
Official Respo	nsible: Karen Clower,	ADA Coordinator			
Consent Decr	ee: No	Paragraph: M.51	Dwg: 1 of 1		
Barrier Area:	Accessible Route - Inte	rior Remediation:	Required		
Barrier Type:	Clear Width - 36" Wide	2			
Barrier Description:	Accessible route clear	width is not min. 36" wide			
Code Referen	ces: CBC 11B-403.5.1 a	and 2010 ADAS 403.5.1			
As Built Description:	Furniture or stored ite	ms block circulation route and	prevent passage through space		
Proposed Solution:	County indicated that accessible tables are p		nts will be served in conference room, after		
As-Built Meas	: 1 Quantity:	JOB Cost Estimate: \$0.0	0 BSR: 2 Recommended		
X Coordinate:	N/A	Y Coordinate: N/A	Z Coordinate: N/A		
Implementati	on: Priority 2	Phase Da	status Open		
Notes: Coun					



Field Date:	12/18/2019 Report Date: 12/18/2019 Barrier #: 13L				
Facility:	Community Corrections Resource Center - 404 H St, Eureka				
Location:	Open Staff Work Space				
Official Respo	nsible: Karen Clower, ADA Coordinator				
Consent Decr	ee: No Paragraph: M.51 Dwg: 1 of 1				
Barrier Area:	Clear Floor Space Remediation: Required				
Barrier Type:	Clear Floor Space - Wheelchair Use (Stored Items)				
Barrier Description:	Clear floor space of min. 30" by 48" not provided at element required to be accessible				
Code Referen	ces: CBC 11B-305 and 2010 ADAS 305				
As Built Description:	No wheelchair maneuvering space provided within cubicle				
Proposed Solution:	County indicated that clients with mobility impairments will be served in conference room, after accessible tables are provided				
As-Built Meas	2 Quantity: JOB Cost Estimate: \$0.00 BSR: 1 Necessary				
X Coordinate:	N/A Y Coordinate: N/A Z Coordinate: N/A				
Implementati	on: Priority 2 Phase Date Status Open				
Notes: Coun	ty intends to apply Program Access.				
Field Date:	12/18/2019 Report Date: 12/18/2019 Barrier #: 13M				
Facility:	Community Corrections Resource Center - 404 H St, Eureka				
Location:	Open Staff Work Space				
Official Respo	nsible: Karen Clower, ADA Coordinator				
Consent Decre	ee: No Paragraph: M.51 Dwg: 1 of 1				
	ee: No Paragraph: M.51 Dwg: 1 of 1				
Barrier Area:	Accessible Route - Interior Remediation: Required				
	Accessible Route - Interior Remediation: Required				
Barrier Type: Barrier Description:	Accessible Route - Interior Remediation: Required Clear Width - 36" Wide				
Barrier Type: Barrier Description:	Accessible Route - Interior Remediation: Required Clear Width - 36" Wide Accessible route clear width is not min. 36" wide				
Barrier Type: Barrier Description: Code Referen As Built	Accessible Route - Interior Remediation: Required Clear Width - 36" Wide Accessible route clear width is not min. 36" wide ces: CBC 11B-403.5.1 and 2010 ADAS 403.5.1				
Barrier Type: Barrier Description: Code Referen As Built Description: Proposed	Accessible Route - Interior Remediation: Required Clear Width - 36" Wide Accessible route clear width is not min. 36" wide ces: CBC 11B-403.5.1 and 2010 ADAS 403.5.1 Furniture or stored items block circulation route and prevent passage through space County indicated that clients with mobility impairments will be served in conference room, after accessible tables are provided				
Barrier Type: Barrier Description: Code Referen As Built Description: Proposed Solution:	Accessible Route - Interior Remediation: Required Clear Width - 36" Wide Accessible route clear width is not min. 36" wide ces: CBC 11B-403.5.1 and 2010 ADAS 403.5.1 Furniture or stored items block circulation route and prevent passage through space County indicated that clients with mobility impairments will be served in conference room, after accessible tables are provided County indicated that clients with mobility impairments will be served in conference room, after accessible tables are provided County indicated that clients with mobility impairments will be served in conference room, after accessible tables are provided County indicated that clients with mobility impairments will be served in conference room, after accessible tables are provided				
Barrier Type: Barrier Description: Code Referen As Built Description: Proposed Solution: As-Built Meas	Accessible Route - Interior Remediation: Required Clear Width - 36" Wide Accessible route clear width is not min. 36" wide ces: CBC 11B-403.5.1 and 2010 ADAS 403.5.1 Furniture or stored items block circulation route and prevent passage through space County indicated that clients with mobility impairments will be served in conference room, after accessible tables are provided County indicated that clients with mobility impairments will be served in conference room, after accessible tables are provided County indicated that clients with mobility impairments will be served in conference room, after accessible tables are provided N/A Y Coordinate: N/A Z Coordinate: N/A				



Field Date: 12/18/2019 Report Date: 12/18/2019 Barrier #: 13N				
Facility: Community Corrections Resource Center - 404 H St, Eureka				
Location: Open Staff Work Space				
Official Responsible: Karen Clower, ADA Coordinator				
Consent Decree: No Paragraph: M.51 Dwg: 1 of 1				
Barrier Area: Controls and Mechanisms Remediation: N/A				
Barrier Type: Clothing Hook or Rod - Height				
Barrier Description: Clothing hooks not max. 48" high AFF				
Code References: CBC 11B-308.2.1 and 2010 ADAS 308.2.1				
As Built Description: 62-1/2" high				
Proposed Coat hook is used by staff only. No remediation required. Solution:				
As-Built Meas: 1 Quantity: EACH Cost Estimate: \$0.00 BSR: 2 Recommended				
X Coordinate: N/A Y Coordinate: N/A Z Coordinate: N/A				
Implementation: Priority 2 Phase Date 12/18/2019 Status Closed				
Notes:				
Field Date: 12/18/2019 Report Date: 12/18/2019 Barrier #: 130				
Facility: Community Corrections Resource Center - 404 H St, Eureka				
Location: Open Staff Work Space				
Official Responsible: Karen Clower, ADA Coordinator				
Consent Decree: No Paragraph: M.51 Dwg: 1 of 1				
Barrier Area: Clear Floor Space Remediation: Required				
Barrier Type: Clear Floor Space - Wheelchair Use (Stored Items)				
Barrier Description: Clear floor space of min. 30" by 48" not provided at element required to be accessible				
Code References: CBC 11B-305 and 2010 ADAS 305				
As Built Description: No wheelchair maneuvering space provided within cubicle				
Proposed Solution: County indicated that clients with mobility impairments will be served in conference room, after accessible tables are provided				
As-Built Meas: 1 Quantity: JOB Cost Estimate: \$0.00 BSR: 1 Necessary				
X Coordinate: N/A Y Coordinate: N/A Z Coordinate: N/A				
Implementation: Priority 2 Phase Date Status Open				
Notes: County intends to apply Program Access.				



Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 Barrier #: 14A			
Facility:	Community Correction	ns Resource Center - 404 H St, Eureka			
Location:	Office 12				
Official Respo	nsible: Karen Clower	, ADA Coordinator			
Consent Decre	ee: No	Paragraph: M.51 Dwg: 1 of 1			
Barrier Area:	Signage	Remediation: N/A			
Barrier Type:	Room ID Sign - No Sigr	1	•		
Barrier Description:	No room ID sign provid	ded at permanent room or space			
Code Referen	ces: CBC 11B-216.2 an	d 2010 ADAS 216.2			
As Built Description:	Compliant tactile sign	provided			
Proposed Solution:	Barrier removed				
As-Built Meas	: 0 Quantity:	EACH Cost Estimate: \$0.00 BSR	: 1 Necessary		
X Coordinate:	N/A	Y Coordinate: N/A Z Coordi	nate: N/A		
Implementati	on: Priority 4	Phase Date 12/18/2019	Status Closed		
Notes:					
Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 Barrier #: 14B			
Facility:	Community Correction	ns Resource Center - 404 H St, Eureka			
Location:	Office 12				
Location.					
Official Respo	nsible: Karen Clower	, ADA Coordinator			
		Paragraph: M.51 Dwg: 1 of 1			
Official Respo Consent Decre					
Official Respo Consent Decre Barrier Area:	ee: No	Paragraph: M.51 Dwg: 1 of 1 Remediation: Required			
Official Respo Consent Decre Barrier Area:	Doors or Gates Maneuvering CI - Store	Paragraph: M.51 Dwg: 1 of 1 Remediation: Required			
Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Doors or Gates Maneuvering CI - Store Door/Gate lacks requi	Paragraph: M.51 Dwg: 1 of 1 Remediation: Required ed Items			
Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Doors or Gates Maneuvering CI - Store Door/Gate lacks require CES: CBC Figure 11B-46	Paragraph: M.51 Dwg: 1 of 1 Remediation: Required ed Items red maneuvering clearance			
Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code References	Doors or Gates Maneuvering CI - Store Door/Gate lacks requires: CBC Figure 11B-40 Desk and chair blocks	Paragraph: M.51 Dwg: 1 of 1 Remediation: Required ed Items red maneuvering clearance 04.2.4.1 and 2010 ADAS 404.2.4.1 maneuvering clearance at pull side of door clients with mobility impairments will be served	d in conference room, after		
Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referent As Built Description: Proposed	Doors or Gates Maneuvering CI - Store Door/Gate lacks require Ces: CBC Figure 11B-40 Desk and chair blocks County indicated that accessible tables are p	Paragraph: M.51 Dwg: 1 of 1 Remediation: Required ed Items red maneuvering clearance 04.2.4.1 and 2010 ADAS 404.2.4.1 maneuvering clearance at pull side of door clients with mobility impairments will be served rovided	d in conference room, after 1 Necessary		
Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referent As Built Description: Proposed Solution:	Doors or Gates Maneuvering CI - Store Door/Gate lacks requires: CBC Figure 11B-40 Desk and chair blocks County indicated that accessible tables are possible tables.	Paragraph: M.51 Dwg: 1 of 1 Remediation: Required ed Items red maneuvering clearance 04.2.4.1 and 2010 ADAS 404.2.4.1 maneuvering clearance at pull side of door clients with mobility impairments will be served rovided EACH Cost Estimate: \$0.00 BSR			
Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referent As Built Description: Proposed Solution: As-Built Meas	Doors or Gates Maneuvering CI - Store Door/Gate lacks require Ces: CBC Figure 11B-40 Desk and chair blocks County indicated that accessible tables are p Double County: N/A	Paragraph: M.51 Dwg: 1 of 1 Remediation: Required ed Items red maneuvering clearance 04.2.4.1 and 2010 ADAS 404.2.4.1 maneuvering clearance at pull side of door clients with mobility impairments will be served rovided EACH Cost Estimate: \$0.00 BSR	: 1 Necessary		



Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 Barrier #: 14C			
Facility:	Community Corrections Resource Center - 404 H St, Eureka				
Location:	Office 12				
Official Respo	nsible: Karen Clower	, ADA Coordinator			
Consent Decr	ee: No	Paragraph: M.51 Dwg: 1 of 1			
Barrier Area:	Controls and Mechani	sms Remediation: Required			
Barrier Type:	Electrical Switches - Cl	ear Floor Space (Stored Items)			
Barrier Description:	Clear floor space for w	heelchair not provided at light switch contr	ol box		
Code Referen	ces: CBC 11B-305.3 ar	nd 2010 ADAS 305.3			
As Built Description:	Chair blocks electrical	switch clear floor space			
Proposed Solution:	County indicated that accessible tables are p	clients with mobility impairments will be selections of the selections of the selections with mobility impairments will be selections.	rved in conference room, after		
As-Built Meas	: 1 Quantity:	JOB Cost Estimate: \$0.00	BSR: 1 Necessary		
X Coordinate:	N/A	Y Coordinate: N/A Z Coo	ordinate: N/A		
Implementati	on: Priority 2	Phase Date	Status Open		
Notes: Coun	ty intends to apply Pro	gram Access. Light switches are to be operat	ed by staff only.		
Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 Barrier #: 14D			
Facility:	Community Correction	ns Resource Center - 404 H St, Eureka			
Location:	Office 12				
Official Respo	nsible: Karen Clower	, ADA Coordinator			
Consent Decr	ee: No	Paragraph: M.51 Dwg: 1 of 1			
Barrier Area:	Clear Floor Space	Remediation: Required			
Barrier Type:	Clear Floor Space - Wh	neelchair Use (Stored Items)			
Barrier Description:	Clear floor space of m	in. 30" by 48" not provided at element requ	ired to be accessible		
Code Referen	ces: CBC 11B-305 and	2010 ADAS 305			
As Built Description:					
•	No wheelchair space p	provided			
Proposed Solution:		clients with mobility impairments will be se	rved in conference room, after		
•	County indicated that accessible tables are p	clients with mobility impairments will be se provided	rved in conference room, after BSR: 1 Necessary		
Solution:	County indicated that accessible tables are positives:	clients with mobility impairments will be selected by the sele			
Solution: As-Built Meas	County indicated that accessible tables are possible tables are possible. 1 Quantity:	clients with mobility impairments will be selected by the sele	BSR: 1 Necessary		



Field Date:	11/13/2017 Repo	rt Date: 8/3/2018 B	Barrier #:	14E	
Facility:	Community Correctio	ns Resource Center - 404 H	St, Eureka	-	1
Location:	Office 12				
Official Respo	nsible: Karen Clowei	, ADA Coordinator			
Consent Decre	ee: No	Paragraph: M.51	Dwg:	1 of 1	alci V
Barrier Area:	Alarms	Remediatio	n: Requi	red	
Barrier Type:	Horn/Strobe - Staff Ar	ea			
Barrier Description:	No horn/strobe in sta	ff areas			
Code Referen	ces: CBC 11B-702.1 ar	nd 2010 ADAS 702.1			
As Built Description:	Device not provided				
Proposed Solution:	Provide horn/strobe i	n area where programs, ser	vices and a	activities take pl	ace
As-Built Meas	: 1 Quantity:	EACH Cost Estimate: \$	5,500.00	BSR: 3 H	indrance
X Coordinate:	N/A	Y Coordinate: N/A		Z Coordinate:	N/A
Implementati	on: Priority 2	Phase	Date		Status Open
INULES.	uired in this situation if no upg	y want to retain a licensed architect/ ades or replacement of existing fire a	•		
Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 B	Barrier #:	15A	1
Facility:	Community Correctio	ns Resource Center - 404 H	St, Eureka		98
Location:	Office 11				
Official Respo	nsible: Karen Clowei	, ADA Coordinator			
Consent Decre	ee: No	Paragraph: M.51	Dwg:	1 of 1	
Barrier Area:	Signage	Remediation	n: N/A		
Barrier Type:	Room ID Sign - No Sig	1			
Barrier Description:	No room ID sign provi	ded at permanent room or	space		
Code Referen	ces: CBC 11B-216.2 ar	nd 2010 ADAS 216.2			
As Built Description:	Compliant tactile sign	provided			
Proposed Solution:	Barrier removed				
As-Built Meas	: 0 Quantity:	EACH Cost Estimate: \$	0.00	BSR: 1 N	ecessary
X Coordinate:	N/A	Y Coordinate: N/A		Z Coordinate:	N/A
Implementation	on: Priority 4	Phase	Date 12	/18/2019	Status Closed
Notes:					



Field Date:	11/13/2017 Report Date: 8/3/2018 Barrier #: 15B				
Facility:	Community Corrections Resource Center - 404 H St, Eureka				
Location:	Office 11				
Official Respo	nsible: Karen Clower, ADA Coordinator				
Consent Decre	ee: No Paragraph: M.51 Dwg: 1 of 1				
Barrier Area:	Doors or Gates Remediation: Required				
Barrier Type:	Door/Gate Hardware - Operation				
Barrier Description:	Hardware not operable with a closed fist				
Code Referen	ces: CBC 11B-404.2.7 and 2010 ADAS 404.2.7				
As Built Description:	Door knob not accessible				
Proposed Solution:	Provide compliant hardware				
As-Built Meas	: 1 Quantity: EACH Cost Estimate: \$300.00 BSR: 1 Necessary				
X Coordinate:	N/A Y Coordinate: N/A Z Coordinate: N/A				
Implementati	on: Priority 2 Phase Date Status Open				
Notes: Co	unty intends to apply Program Access. Public is escorted by staff at all times in this area.				
Field Date:	11/13/2017 Report Date: 8/3/2018 Barrier #: 15C				
Facility:	Community Corrections Resource Center - 404 H St, Eureka				
Location:	Office 11				
Official Respo	nsible: Karen Clower, ADA Coordinator				
Consent Decre	ee: No Paragraph: M.51 Dwg: 1 of 1				
Barrier Area:	Doors or Gates Remediation: Required				
Barrier Type:	Doors of Gates Remediation. Required				
	Door Clear Width - 32"				
Barrier Description:					
Barrier Description:	Door Clear Width - 32"				
Barrier Description:	Door Clear Width - 32" Door, sliding/folding door or gate clear width is not min. 32"				
Barrier Description: Code Referen As Built	Door Clear Width - 32" Door, sliding/folding door or gate clear width is not min. 32" ces: CBC 11B-404.2.3 & 404.3.1 and 2010 ADAS 404.2.3 & 404.3.1				
Barrier Description: Code Referent As Built Description: Proposed	Door Clear Width - 32" Door, sliding/folding door or gate clear width is not min. 32" ces: CBC 11B-404.2.3 & 404.3.1 and 2010 ADAS 404.2.3 & 404.3.1 29-1/2" wide Replace door or gate and frame				
Barrier Description: Code Reference As Built Description: Proposed Solution:	Door Clear Width - 32" Door, sliding/folding door or gate clear width is not min. 32" ces: CBC 11B-404.2.3 & 404.3.1 and 2010 ADAS 404.2.3 & 404.3.1 29-1/2" wide Replace door or gate and frame : 1 Quantity: EACH Cost Estimate: \$2,250.00 BSR: 1 Necessary				
Barrier Description: Code Reference As Built Description: Proposed Solution: As-Built Meas	Door Clear Width - 32" Door, sliding/folding door or gate clear width is not min. 32" ces: CBC 11B-404.2.3 & 404.3.1 and 2010 ADAS 404.2.3 & 404.3.1 29-1/2" wide Replace door or gate and frame : 1 Quantity: EACH Cost Estimate: \$2,250.00 BSR: 1 Necessary N/A Y Coordinate: N/A Z Coordinate: N/A				



Field Date:	12/18/2019 Rep	ort Date: 12/18/2019	Barrier #	t: 15D	
Facility:	Community Correction	ons Resource Center - 404 H	l St, Eure	ka	99
Location:	Office 11				
Official Respo	nsible: Karen Clowe	r, ADA Coordinator			
Consent Decr	ee: No	Paragraph: M.51	Dwg	g: 1 of 1	
Barrier Area:	Doors or Gates	Remediati	ion: Rec	quired	
Barrier Type:	Maneuvering CI - Sto	red Items			
Barrier Description:	Door/Gate lacks requ	ired maneuvering clearance	e		
Code Referen	ces: CBC Figure 11B-	404.2.4.1 and 2010 ADAS 40	04.2.4.1		
As Built Description:	Chair and desk block	s maneuvering clearance at	pull side	of door	
Proposed Solution:	County indicated tha accessible tables are	t clients with mobility impa provided	irments v	will be served in o	conference room, after
As-Built Meas	: 0 Quantity	: EACH Cost Estimate:	\$0.00	BSR: 1	Necessary
X Coordinate:	N/A	Y Coordinate: N/A		Z Coordinate	e: N/A
Implementati	on: Priority 2	Phase	Date		Status Open
Notes: Coun	ty intends to apply Pr	ogram Access. Public is esco	rted by s	staff at all times i	n this area.
Field Date:	11/13/2017 Rep	ort Date: 8/3/2018	Barrier #	t: 15E	
Facility:	Community Correction	ons Resource Center - 404 H	l St, Eure	ka	
Location:	Office 11				
Official Respo	nsible: Karen Clowe	r, ADA Coordinator			
Consent Decre	ee: No	Paragraph: M.51	Dw	g: 1 of 1	
Barrier Area:	Controls and Mechai	isms Remediati	ion: N/A	4	
Barrier Type:	Clothing Hook or Roo	l - Height			
Barrier Description:	Clothing hooks not n	ax. 48" high AFF			
Code Referen	ces: CBC 11B-308.2.2	and 2010 ADAS 308.2.1			
As Built Description:	78" high				
Proposed Solution:	Coat hook is used by	staff only. No remediation	required		
As-Built Meas	: 0 Quantity	: EACH Cost Estimate:	\$0.00	BSR: 2	Recommended
X Coordinate:	N/A	Y Coordinate: N/A		Z Coordinate	2: N/A
Implementati	on: Priority 2	Phase	Date	11/13/2017	Status Closed
Notes:					



Field Date:	12/18/2019 Repo	rt Date: 12/18/2019	Barrier #: 15F		
Facility:	Community Correction	ns Resource Center - 404 I	H St, Eureka		
Location:	Office 11				
Official Respo	nsible: Karen Clower	, ADA Coordinator			
Consent Decr	ee: No	Paragraph: M.51	Dwg: 1 of 1		
Barrier Area:	Controls and Mechani	sms Remediat	tion: Required		
Barrier Type:	Electrical Switches - Cl	ear Floor Space (Stored It	ems)		
Barrier Description:	Clear floor space for w	heelchair not provided at	light switch control box		
Code Referen	ces: CBC 11B-305.3 ar	d 2010 ADAS 305.3			
As Built Description:	Chair blocks electrical	switch clear floor space			
Proposed Solution:	County indicated that accessible tables are p		irments will be served in c	onference room, after	
As-Built Meas	: 1 Quantity:	JOB Cost Estimate:	\$0.00 BSR: 11	Necessary	
X Coordinate:	N/A	Y Coordinate: N/A	Z Coordinate	: N/A	
Implementati	on: Priority 2	Phase	Date	Status Open	
Notes: Coun	ty intends to apply Prop	gram Access. Public is esco	orted by staff at all times ir	this area.	
Field Date:	12/18/2019 Repo	rt Date: 12/18/2019	Barrier #: 15G	F 55	
Facility:	Community Correction	ns Resource Center - 404 I	H St, Eureka		
Location:	Office 11				
Official Respo	nsible: Karen Clower	, ADA Coordinator			
Consent Decr	ee: No	Paragraph: M.51	Dwg: 1 of 1		
Barrier Area:	Clear Floor Space	Remediat	cion: Required		
Barrier Type:	Clear Floor Space - Wh	neelchair Use (Stored Item	ns)		
Barrier Description:	Clear floor space of m	in. 30" by 48" not provide	d at element required to b	e accessible	
Code Referen	ces: CBC 11B-305 and	2010 ADAS 305			
As Built Description:	No wheelchair space p	provided			
Proposed Solution:	County indicated that accessible tables are p		irments will be served in c	onference room, after	
As-Built Meas	: 1 Quantity:	JOB Cost Estimate:	\$0.00 BSR: 11	Necessary	
X Coordinate:	N/A	Y Coordinate: N/A	Z Coordinate	: N/A	
Implementati					
piementati	on: Priority 2	Phase	Date	Status Open	



Field Date:	11/13/2017 Repo	ort Date: 8/3/2018 Barrier #: 15H			
Facility:	Community Corrections Resource Center - 404 H St, Eureka				
Location:	Office 11				
Official Respo	nsible: Karen Clower	r, ADA Coordinator			
Consent Decre	ee: No	Paragraph: M.51 Dwg: 1 of 1			
Barrier Area:	Alarms	Remediation: Required			
Barrier Type:	Horn/Strobe - Staff Ar	rea			
Barrier Description:	No horn/strobe in staf	ff areas			
Code Referen	ces: CBC 11B-702.1 ar	nd 2010 ADAS 702.1			
As Built Description:	Device not provided				
Proposed Solution:	Provide horn/strobe in	n area where programs, services and activities take place			
As-Built Meas	: 1 Quantity:	EACH Cost Estimate: \$5,500.00 BSR: 3 Hindrance			
X Coordinate:	N/A	Y Coordinate: N/A Z Coordinate: N/A			
Implementati	on: Priority 2	Phase Date Status Open			
INOLCS.	ired in this situation if no upgra	want to retain a licensed architect/professional or CASP to determine if barrier remediation is ades or replacement of existing fire alarm system have occurred and the exception in 907.5.2.3			
Field Date:	12/18/2019 Repo	ort Date: 12/18/2019 Barrier #: 16A			
	1 12/10/1015				
Facility:	Community Correction	ns Resource Center - 404 H St, Eureka			
Facility: Location:	Community Correction Office 14	ns Resource Center - 404 H St, Eureka			
•	Office 14	r, ADA Coordinator			
Location:	Office 14 nsible: Karen Clower	114			
Location: Official Respo	Office 14 nsible: Karen Clower ee: No	r, ADA Coordinator			
Location: Official Respo Consent Decre Barrier Area:	Office 14 nsible: Karen Clower ee: No	r, ADA Coordinator Paragraph: M.51 Remediation: N/A			
Location: Official Respo Consent Decre Barrier Area:	Office 14 nsible: Karen Clower ee: No Signage Room ID Sign - No Sign	r, ADA Coordinator Paragraph: M.51 Remediation: N/A			
Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Office 14 nsible: Karen Clower ee: No Signage Room ID Sign - No Sign	r, ADA Coordinator Paragraph: M.51 Remediation: N/A ded at permanent room or space			
Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Office 14 nsible: Karen Clower ee: No Signage Room ID Sign - No Sign	r, ADA Coordinator Paragraph: M.51 Remediation: N/A n ded at permanent room or space and 2010 ADAS 216.2			
Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference As Built	Office 14 nsible: Karen Clower ee: No Signage Room ID Sign - No Sign No room ID sign providues: CBC 11B-216.2 ar Compliant tactile sign Barrier removed	r, ADA Coordinator Paragraph: M.51 Remediation: N/A ded at permanent room or space and 2010 ADAS 216.2 provided			
Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referent As Built Description: Proposed	Office 14 nsible: Karen Clower ee: No Signage Room ID Sign - No Sign No room ID sign providues: CBC 11B-216.2 ar Compliant tactile sign Barrier removed	r, ADA Coordinator Paragraph: M.51 Remediation: N/A ded at permanent room or space and 2010 ADAS 216.2 provided			
Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference As Built Description: Proposed Solution:	Office 14 nsible: Karen Clower ee: No Signage Room ID Sign - No Sign No room ID sign providues: CBC 11B-216.2 ar Compliant tactile sign Barrier removed : 0 Quantity:	ADA Coordinator Paragraph: M.51 Remediation: N/A ded at permanent room or space and 2010 ADAS 216.2 provided EACH Cost Estimate: \$0.00 BSR: 1 Necessary Y Coordinate: N/A Z Coordinate: N/A			
Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference As Built Description: Proposed Solution: As-Built Meas	Office 14 nsible: Karen Clower ee: No Signage Room ID Sign - No Sign No room ID sign provio ces: CBC 11B-216.2 an Compliant tactile sign Barrier removed : O Quantity: N/A	Paragraph: M.51 Dwg: 1 of 1 Remediation: N/A ded at permanent room or space and 2010 ADAS 216.2 provided EACH Cost Estimate: \$0.00 BSR: 1 Necessary			



Field Date:	11/13/2017 Report Date: 8/3/2018 Barrier #: 16B				
Facility:	Community Corrections Resource Center - 404 H St, Eureka				
Location:	Office 14				
Official Respon	nsible: Karen Clower, ADA Coordinator				
Consent Decre	ee: No Paragraph: M.51 Dwg: 1 of 1				
Barrier Area:	Doors or Gates Remediation: Required				
Barrier Type:	Door/Gate Hardware - Operation				
Barrier Description:	Hardware not operable with a closed fist				
Code Reference	Ces: CBC 11B-404.2.7 and 2010 ADAS 404.2.7				
As Built Description:	Door knob not accessible				
Proposed Solution:	Provide compliant hardware				
As-Built Meas	Quantity: EACH Cost Estimate: \$300.00 BSR: 1 Necessary				
X Coordinate:	N/A Y Coordinate: N/A Z Coordinate: N/A				
Implementation	on: Priority 2 Phase Date Status Open				
Notes: Cour	nty intends to apply Program Access. Public is escorted by staff at all times in this area.				
ļ.					
Field Date:	11/13/2017 Report Date: 8/3/2018 Barrier #: 16C				
Field Date: Facility:	11/13/2017 Report Date: 8/3/2018 Barrier #: 16C Community Corrections Resource Center - 404 H St, Eureka				
Facility:					
Facility:	Community Corrections Resource Center - 404 H St, Eureka Office 14				
Facility: Location:	Community Corrections Resource Center - 404 H St, Eureka Office 14 nsible: Karen Clower, ADA Coordinator				
Facility: Location: Official Respondence Consent Decree	Community Corrections Resource Center - 404 H St, Eureka Office 14 nsible: Karen Clower, ADA Coordinator				
Facility: Location: Official Responsent Decre Barrier Area:	Community Corrections Resource Center - 404 H St, Eureka Office 14 Insible: Karen Clower, ADA Coordinator Insible: No Paragraph: M.51 Dwg: 1 of 1				
Facility: Location: Official Responsent Decre Barrier Area:	Community Corrections Resource Center - 404 H St, Eureka Office 14 nsible: Karen Clower, ADA Coordinator ee: No Paragraph: M.51 Dwg: 1 of 1 Doors or Gates Remediation: Required				
Facility: Location: Official Respondence Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Corrections Resource Center - 404 H St, Eureka Office 14 Insible: Karen Clower, ADA Coordinator Insible: No Paragraph: M.51 Dwg: 1 of 1 Doors or Gates Remediation: Required Door Clear Width - 32"				
Facility: Location: Official Respondence Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Corrections Resource Center - 404 H St, Eureka Office 14 Insible: Karen Clower, ADA Coordinator Insible: No Paragraph: M.51 Dwg: 1 of 1 Doors or Gates Remediation: Required Door Clear Width - 32" Door, sliding/folding door or gate clear width is not min. 32"				
Facility: Location: Official Respondence Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference As Built	Community Corrections Resource Center - 404 H St, Eureka Office 14 Insible: Karen Clower, ADA Coordinator Insible: No Paragraph: M.51 Dwg: 1 of 1 Doors or Gates Door Clear Width - 32" Door, sliding/folding door or gate clear width is not min. 32" Ces: CBC 11B-404.2.3 & 404.3.1 and 2010 ADAS 404.2.3 & 404.3.1				
Facility: Location: Official Respondence Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference As Built Description: Proposed	Community Corrections Resource Center - 404 H St, Eureka Office 14 Insible: Karen Clower, ADA Coordinator Insible: Karen Clower, ADA Coordinator Insible: No Paragraph: M.51 Dwg: 1 of 1 Doors or Gates Door Clear Width - 32" Door, sliding/folding door or gate clear width is not min. 32" Insible: Karen Clower, ADA Coordinator Required Doors or Gates CBC 11B-404.2.3 & 404.3.1 and 2010 ADAS 404.2.3 & 404.3.1 Replace door or gate and frame				
Facility: Location: Official Respondence Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference As Built Description: Proposed Solution:	Community Corrections Resource Center - 404 H St, Eureka Office 14 Insible: Karen Clower, ADA Coordinator Insible: No Paragraph: M.51 Dwg: 1 of 1 Insible: Paragraph: Paragraph				
Facility: Location: Official Respondence Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference As Built Description: Proposed Solution: As-Built Meas	Community Corrections Resource Center - 404 H St, Eureka Office 14 Insible: Karen Clower, ADA Coordinator Insible: Karen Clower, ADA Coordinator Insible: Remediation: Required Doors or Gates Insible: Remediation: Required Door Clear Width - 32" Door, sliding/folding door or gate clear width is not min. 32" Insible: Karen Clower, ADA Coordinate: Start St				



Field Date: 12/18/2019 Report Date: 12/18/2019 Barrier #: 16D
Facility: Community Corrections Resource Center - 404 H St, Eureka
Location: Office 14
Official Responsible: Karen Clower, ADA Coordinator
Consent Decree: No Paragraph: M.51 Dwg: 1 of 1
Barrier Area: Doors or Gates Remediation: Required
Barrier Type: Maneuvering Cl - Stored Items
Barrier Description: Door/Gate lacks required maneuvering clearance
Code References: CBC Figure 11B-404.2.4.1 and 2010 ADAS 404.2.4.1
As Built Desk blocks maneuvering clearance at pull side of door Description:
Proposed Solution: County indicated that clients with mobility impairments will be served in conference room, after accessible tables are provided
As-Built Meas: 0 Quantity: EACH Cost Estimate: \$0.00 BSR: 1 Necessary
X Coordinate: N/A Y Coordinate: N/A Z Coordinate: N/A
Implementation: Priority 2 Phase Date Status Open
Notes: County intends to apply Program Access. Public is escorted by staff at all times in this area.
Field Date: 12/18/2019 Report Date: 12/18/2019 Barrier #: 16E
Facility: Community Corrections Resource Center - 404 H St, Eureka
Location: Office 14
Official Responsible: Karen Clower, ADA Coordinator
Consent Decree: No Paragraph: M.51 Dwg: 1 of 1
Barrier Area: Controls and Mechanisms Remediation: N/A
Barrier Type: Clothing Hook or Rod - Height
Barrier Clothing hooks not max. 48" high AFF Description:
Code References: CBC 11B-308.2.1 and 2010 ADAS 308.2.1
As Built Description: 68" high
Proposed Coat hook is used by staff only. No remediation required. Solution:
As-Built Meas: 0 Quantity: EACH Cost Estimate: \$0.00 BSR: 2 Recommended
X Coordinate: N/A Y Coordinate: N/A Z Coordinate: N/A
Implementation: Priority 2 Phase Date 12/18/2019 Status Closed
Notes:



Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 B	arrier #: 16F	2
Facility:	Community Correction	ns Resource Center - 404 H S	St, Eureka	
Location:	Office 14			
Official Respo	nsible: Karen Clower	, ADA Coordinator		
Consent Decre	ee: No	Paragraph: M.51	Dwg: 1 of 1	
Barrier Area:	Controls and Mechanis	sms Remediatio	n: Required	_
Barrier Type:	Electrical Switches - Cl	ear Floor Space (Stored Iten	ns)	
Barrier Description:	Clear floor space for w	heelchair not provided at lig	ght switch control box	
Code Referen	ces: CBC 11B-305.3 an	d 2010 ADAS 305.3		
As Built Description:	Desk blocks electrical	switch clear floor space		
Proposed Solution:	County indicated that accessible tables are p	clients with mobility impair rovided	ments will be served in c	onference room, after
As-Built Meas	: 1 Quantity:	JOB Cost Estimate: \$0	0.00 BSR: 11	Necessary
X Coordinate:	N/A	Y Coordinate: N/A	Z Coordinate	: N/A
Implementati	on: Priority 2	Phase	Date	Status Open
Notes: Coun	ty intends to apply Prog	gram Access. Public is escort	ted by staff at all times ir	this area.
Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 B	arrier #: 16G	The state of the s
Facility:	Community Correction	ns Resource Center - 404 H S	St, Eureka	
Location:	Office 14			
Official Respo	nsible: Karen Clower	, ADA Coordinator		
Consent Decre	ee: No	Paragraph: M.51	Dwg: 1 of 1	
Barrier Area:	Clear Floor Space	Remediatio	n: Required	
Barrier Type:	Class Flags Coass Mile	eelchair Use (Stored Items)		
Dannian	Clear Floor Space - wr	ieeichan Ose (Stored items)		
Barrier Description:		n. 30" by 48" not provided a		e accessible
Description:		n. 30" by 48" not provided a		e accessible
Description:	Clear floor space of mi	n. 30" by 48" not provided a		e accessible
Description: Code Referen As Built	Clear floor space of mices: CBC 11B-305 and	n. 30" by 48" not provided a 2010 ADAS 305 rovided clients with mobility impair	at element required to b	
Description: Code Referen As Built Description: Proposed	Clear floor space of microscopic CBC 11B-305 and No wheelchair space processible tables are processible tables are processible tables.	n. 30" by 48" not provided a 2010 ADAS 305 rovided clients with mobility impairs	at element required to b	
Description: Code Referen As Built Description: Proposed Solution:	Clear floor space of mices: CBC 11B-305 and No wheelchair space processible tables are processible tables are processible tables.	n. 30" by 48" not provided a 2010 ADAS 305 rovided clients with mobility impairs	at element required to b	onference room, after
Description: Code Referen As Built Description: Proposed Solution: As-Built Meas	Clear floor space of microscopic CBC 11B-305 and No wheelchair space processible tables are	n. 30" by 48" not provided a 2010 ADAS 305 provided clients with mobility impairs rovided [JOB Cost Estimate: \$6	ments will be served in c	onference room, after



Field Date:	11/13/2017 Report Date: 8/3/2018 Barrier #: 16H				
Facility:	Community Corrections Resource Center - 404 H St, Eureka				
Location:	Office 14				
Official Respo	nsible: Karen Clower, ADA Coordinator				
Consent Decre	ee: No Paragraph: M.51 Dwg: 1 of 1				
Barrier Area:	Alarms Remediation: Required				
Barrier Type:	Horn/Strobe - Staff Area				
Barrier Description:	No horn/strobe in staff areas				
Code Referen	ces: CBC 11B-702.1 and 2010 ADAS 702.1				
As Built Description:	Device not provided				
Proposed Solution:	Provide horn/strobe in area where programs, services and activities take place				
As-Built Meas	Quantity: EACH Cost Estimate: \$5,500.00 BSR: 3 Hindrance				
X Coordinate:	N/A Y Coordinate: N/A Z Coordinate: N/A				
Implementati	on: Priority 2 Phase Date Status Open				
	erty Owner Barrier. Owner may want to retain a licensed architect/professional or CASP to determine if barrier remediation is required in this tion if no upgrades or replacement of existing fire alarm system have occurred and the exception in 907.5.2.3 applies.				
Field Date:	12/18/2019 Report Date: 12/18/2019 Barrier #: 17A				
Facility:	Community Corrections Resource Center - 404 H St, Eureka				
Location:	Open Staff Work Space 9				
Official Respo	nsible: Karen Clower, ADA Coordinator				
Consent Decre	ee: No Paragraph: M.51 Dwg: 1 of 1				
Barrier Area:	Signage Remediation: N/A				
Barrier Type:	Room ID Sign - No Sign				
Barrier Description:	No room ID sign provided at permanent room or space				
Code Referen	ces: CBC 11B-216.2 and 2010 ADAS 216.2				
As Built Description:	Compliant tactile sign provided				
Proposed Solution:	Barrier removed				
As-Built Meas	: O Quantity: EACH Cost Estimate: \$0.00 BSR: 1 Necessary				
X Coordinate:	N/A Y Coordinate: N/A Z Coordinate: N/A				
Implementati	on: Priority 4 Phase Date 12/18/2019 Status Closed				
Notes:					



Field Date:	11/13/2017 Report Date: 8/3/2018 Barrier #: 17B		
Facility:	Community Corrections Resource Center - 404 H St, Eureka		
Location:	Open Staff Work Space 9		
Official Respo	nsible: Karen Clower, ADA Coordinator		
Consent Decre	ee: No Paragraph: M.51 Dwg: 1 of 1		
Barrier Area:	Doors or Gates Remediation: Required		
Barrier Type:	Door/Gate Hardware - Operation		
Barrier Description:	Hardware not operable with a closed fist		
Code Referen	CBC 11B-404.2.7 and 2010 ADAS 404.2.7		
As Built Description:	No door hardware provided at door		
Proposed Solution:	Provide compliant hardware		
As-Built Meas	Quantity: EACH Cost Estimate: \$300.00 BSR: 1 Necessary		
X Coordinate:	N/A Y Coordinate: N/A Z Coordinate: N/A		
Implementation	on: Priority 2 Phase Date Status Open		
Notes: Cou	nty intends to apply Program Access.Public is escorted by staff at all times in this area.		
Field Date:	11/13/2017 Report Date: 8/3/2018 Barrier #: 17C		
Facility:	Community Corrections Resource Center - 404 H St, Eureka		
Location:	Open Staff Work Space 9		
Official Respo	nsible: Karen Clower, ADA Coordinator		
Consent Decre	ee: No Paragraph: M.51 Dwg: 1 of 1		
Barrier Area:	Doors or Gates Remediation: Required		
	Doors or Gates Remediation: Required		
Barrier Type: Barrier Description:	Doors or Gates Remediation: Required Vision Lights - Existing		
Barrier Type: Barrier Description:	Doors or Gates Remediation: Required Vision Lights - Existing Doors, gates, and side lights adjacent to opening not max. 43" above floor/ground		
Barrier Type: Barrier Description: Code Reference As Built	Doors or Gates Remediation: Required Vision Lights - Existing Doors, gates, and side lights adjacent to opening not max. 43" above floor/ground Ces: CBC 11B-404.2.11 and 2010 ADAS 404.2.11		
Barrier Type: Barrier Description: Code Reference As Built Description: Proposed	Doors or Gates Vision Lights - Existing Doors, gates, and side lights adjacent to opening not max. 43" above floor/ground Ces: CBC 11B-404.2.11 and 2010 ADAS 404.2.11 View panel 43-1/2" high Replace door or vision panel in door		
Barrier Type: Barrier Description: Code Reference As Built Description: Proposed Solution:	Doors or Gates Vision Lights - Existing		
Barrier Type: Barrier Description: Code Reference As Built Description: Proposed Solution: As-Built Meas	Doors or Gates Vision Lights - Existing Doors, gates, and side lights adjacent to opening not max. 43" above floor/ground ces: CBC 11B-404.2.11 and 2010 ADAS 404.2.11 View panel 43-1/2" high Replace door or vision panel in door 1 Quantity: EACH Cost Estimate: \$2,250.00 BSR: 3 Hindrance N/A Y Coordinate: N/A Z Coordinate: N/A		



Field Date:	11/13/2017 Report Date: 8/3/2018 Barrier #: 17D			
Facility:	Community Corrections Resource Center - 404 H St, Eureka			
Location:	Open Staff Work Space 9			
Official Respo	nsible: Karen Clower, ADA Coordinator			
Consent Decre	ee: No Paragraph: M.51 Dwg: 1 of 1			
Barrier Area:	Doors or Gates Remediation: Required			
Barrier Type:	Maneuvering CI - Int Front App/Pull 18"			
Barrier Description:	Door/Gate at pull side lacks min. 18" beyond latch side of door			
Code Referen	ces: CBC Figure 11B-404.2.4.1 and 2010 ADAS 404.2.4.1			
As Built Description:	4-3/4" maneuvering clearance at pull side of door			
Proposed Solution:	Install automatic door opening device to compensate for lack of required maneuvering clearance			
As-Built Meas	: 1 Quantity: EACH Cost Estimate: \$5,000.00 BSR: 1 Necessary			
X Coordinate:	N/A Y Coordinate: N/A Z Coordinate: N/A			
Implementati	on: Priority 2 Phase Date Status Open			
Notes: Cou	nty intends to apply Program Access. Public is escorted by staff at all times in this area.			
Field Date:	12/18/2019 Report Date: 12/18/2019 Barrier #: 17E			
Facility:	Community Corrections Resource Center - 404 H St, Eureka			
Location:	Open Staff Work Space 9			
Official Respo	nsible: Karen Clower, ADA Coordinator			
Consent Decre				
CONSCIN DCCI	ee: No Paragraph: M.51 Dwg: 1 of 1			
Barrier Area:				
Barrier Area:				
Barrier Area:	Signage Remediation: N/A			
Barrier Area: Barrier Type: Barrier Description:	Signage Remediation: N/A Room ID Sign - No Sign			
Barrier Area: Barrier Type: Barrier Description:	Signage Remediation: N/A Room ID Sign - No Sign No room ID sign provided at permanent room or space			
Barrier Area: Barrier Type: Barrier Description: Code Reference As Built	Signage Remediation: N/A Room ID Sign - No Sign No room ID sign provided at permanent room or space ces: CBC 11B-216.2 and 2010 ADAS 216.2			
Barrier Area: Barrier Type: Barrier Description: Code Referen As Built Description: Proposed	Signage Remediation: N/A Room ID Sign - No Sign No room ID sign provided at permanent room or space ces: CBC 11B-216.2 and 2010 ADAS 216.2 Compliant tactile sign provided where visual sign exists at rooms 10, 15 and heater closet Barriers removed			
Barrier Area: Barrier Type: Barrier Description: Code Referent As Built Description: Proposed Solution:	Signage Remediation: N/A Room ID Sign - No Sign No room ID sign provided at permanent room or space Ces: CBC 11B-216.2 and 2010 ADAS 216.2 Compliant tactile sign provided where visual sign exists at rooms 10, 15 and heater closet Barriers removed Description: N/A No room ID Sign - No Sign No room ID sign provided at permanent room or space CBC 11B-216.2 and 2010 ADAS 216.2 Compliant tactile sign provided where visual sign exists at rooms 10, 15 and heater closet Barriers removed Description: N/A Barriers removed Description: N/A No room ID Sign - No Sign No room ID sign provided at permanent room or space CBC 11B-216.2 and 2010 ADAS 216.2 Compliant tactile sign provided where visual sign exists at rooms 10, 15 and heater closet Barriers removed Description: N/A Barriers removed Description: N/A Barriers removed Description: N/A Barriers removed			
Barrier Area: Barrier Type: Barrier Description: Code Reference As Built Description: Proposed Solution: As-Built Meas	Signage Remediation: N/A Room ID Sign - No Sign No room ID sign provided at permanent room or space ces: CBC 11B-216.2 and 2010 ADAS 216.2 Compliant tactile sign provided where visual sign exists at rooms 10, 15 and heater closet Barriers removed : O Quantity: EACH Cost Estimate: \$0.00 BSR: 1 Necessary N/A Y Coordinate: N/A Z Coordinate: N/A			



Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 B	Barrier #:	17F	
Facility:	Community Correction	ns Resource Center - 404 H	St, Eureka	a	
Location:	Open Staff Work Spac	e 9		0	
Official Respo	nsible: Karen Clower	, ADA Coordinator			
Consent Decr	ee: No	Paragraph: M.51	Dwg:	1 of 1	
Barrier Area:	Signage	Remediatio	n: Requ	ired	
Barrier Type:	Evacuation Plan Sign -	Character Height			
Barrier Description:	Visual character heigh	t less than 5/8" high			
Code Referen	ces: 2010 ADAS 703.5	.5 (CBC 11B-703.5.5 less str	ingent)		
As Built Description:	1/4" character height				
Proposed Solution:	Provide compliant eva	cuation sign			
As-Built Meas	: 1 Quantity:	EACH Cost Estimate: \$	250.00	BSR: 2 R	Recommended
X Coordinate:	N/A	Y Coordinate: N/A		Z Coordinate:	N/A
Implementati	on: Priority 4	Phase	Date		Status Open
Notes:	County Responsible.				
Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 B	arrier #:	17G	A E 15
Facility:	Community Correction	ns Resource Center - 404 H	St, Eureka	a	- 1
Location:	Open Staff Work Spac	e 9			
Official Respo	nsible: Karen Clower	, ADA Coordinator			
Consent Decre	ee: No	Paragraph: M.51	Dwg:	1 of 1	
Barrier Area:	Controls and Mechani	sms Remediatio	n: N/A		
Barrier Type:	Electrical Switches - Cl	ear Floor Space (Stored Iter	ns)		
Barrier Description:	Clear floor space for w	heelchair not provided at li	ght switc	h control box	
Code Referen	ces: CBC 11B-305.3 ar	nd 2010 ADAS 305.3			
As Built Description:	Chair removed from e	lectrical switch clear floor s	pace		
Proposed Solution:	Barrier removed				
As-Built Meas	: 1 Quantity:	JOB Cost Estimate: \$	0.00	BSR: 1 N	lecessary
X Coordinate:	N/A	Y Coordinate: N/A		Z Coordinate:	N/A
Implementati	on: Priority 2	Phase	Date 1	2/18/2019	Status Closed
Notes:					



Field Date:	12/18/2019 Repo	rt Date: 12/18/2019	Barrier #: 17H	
Facility:	Community Correction	s Resource Center - 404	H St, Eureka	
Location:	Open Staff Work Space	9	-	
Official Respo	nsible: Karen Clower	, ADA Coordinator		
Consent Decr	ee: No	Paragraph: M.51	Dwg: 1 of 1	A .//
Barrier Area:	Accessible Route - Inte	rior Remedia	tion: Required	
Barrier Type:	Clear Width - 36" Wide	(Stored Items)		
Barrier Description:	Accessible route clear	width is not min. 36" wid	e	
Code Referen	ces: CBC 11B-403.5.1 a	and 2010 ADAS 403.5.1		
As Built Description:	Furniture or stored ite	ms block circulation rout	e and prevent passage thro	ough space
Proposed Solution:	County indicated that accessible tables are p		airments will be served in o	conference room, after
As-Built Meas	: 1 Quantity:	JOB Cost Estimate:	\$0.00 BSR: 2	Recommended
X Coordinate:	N/A	Y Coordinate: N/A	Z Coordinate	e: N/A
Implementati	on: Priority 2	Phase	Date	Status Open
Notes: Coun	ty intends to apply Prog	gram Access. Public is esc	orted by staff at all times i	n this area.
Field Date:	12/18/2019 Repo	rt Date: 12/18/2019	Barrier #: 171	
Facility:	Community Correction	s Resource Center - 404	H St, Eureka	
Location:	Open Staff Work Space	9	-	
Official Respo	nsible: Karen Clower	, ADA Coordinator	<u> </u>	
Consent Decre	ee: No	Paragraph: M.51	Dwg: 1 of 1	A .//
Barrier Area:	Clear Floor Space	Remedia	tion: Required	
Barrier Type:	Clear Floor Space - Wh	eelchair Use (Stored Iten	ns)	
Barrier Description:	Clear floor space of mi	n. 30" by 48" not provide	ed at element required to b	pe accessible
Code Referen	ces: CBC 11B-305 and	2010 ADAS 305		
As Built Description:	No wheelchair space p	rovided within both cubi	cles	
Proposed Solution:	County indicated that accessible tables are p		airments will be served in o	conference room, after
As-Built Meas	: 2 Quantity:	JOB Cost Estimate:	\$0.00 BSR: 1	Necessary
X Coordinate:	N/A	Y Coordinate: N/A	Z Coordinate	e: N/A
Implementati	on: Priority 2	Phase	Date	Status Open
Notes: Coun	ty intends to apply Prog	gram Access.Public is esco	orted by staff at all times ir	this area.



Field Date:	12/18/2019 Report	Date: 12/18/2019 Barrier #: 17J	H T	
Facility:	Community Corrections	Resource Center - 404 H St, Eureka		
Location:	Open Staff Work Space 9			
Official Respo	nsible: Karen Clower, A	ADA Coordinator	3 3	
Consent Decre	ee: No P	Paragraph: M.51 Dwg: 1 of 1		
Barrier Area:	Clear Floor Space	Remediation: Required		
Barrier Type:	Clear Floor Space - Whe	elchair Use (Stored Items)		
Barrier Description:	Clear floor space of min	. 30" by 48" not provided at element requir	red to be accessible	
Code Referen	ces: CBC 11B-305 and 2	010 ADAS 305		
As Built Description:	No wheelchair space pro	ovided within second cubicle area		
Proposed Solution:	County indicated that cl accessible tables are pro	lients with mobility impairments will be serv	ved in conference room, after	
As-Built Meas	: 1 Quantity: J	JOB Cost Estimate: \$0.00 B	SR: 1 Necessary	
X Coordinate:	N/A Y	/ Coordinate: N/A Z Coo	rdinate: N/A	
Implementati	on: Priority 2	Phase Date	Status Open	
Notes: Coun	ty intends to apply Progr	am Access. Public is escorted by staff at all t	times in this area.	
Field Date:	11/13/2017 Report	Date: 8/3/2018 Barrier #: 17K		
Facility:	Community Corrections	Resource Center - 404 H St, Eureka	*	
Location:	Open Staff Work Space S	9		
Official Respo	nsible: Karen Clower, /	ADA Coordinator		
Consent Decre		Paragraph: M.51 Dwg: 1 of 1		
	ee: No P	aragraphi. WI.31 DWg. 1 0 1		
Barrier Area:	-	Remediation: Required		
	-	Remediation: Required		
	Alarms	Remediation: Required		
Barrier Type: Barrier Description:	Alarms Horn/Strobe - Staff Area	Remediation: Required areas		
Barrier Type: Barrier Description:	Alarms Horn/Strobe - Staff Area No horn/strobe in staff a	Remediation: Required areas		
Barrier Type: Barrier Description: Code Referen	Alarms Horn/Strobe - Staff Area No horn/strobe in staff a ces: CBC 11B-702.1 and Device not provided	Remediation: Required areas	s take place	
Barrier Type: Barrier Description: Code Referen As Built Description: Proposed	Alarms Horn/Strobe - Staff Area No horn/strobe in staff a ces: CBC 11B-702.1 and Device not provided Provide horn/strobe in a	Remediation: Required areas 2010 ADAS 702.1 area where programs, services and activitie	s take place	
Barrier Type: Barrier Description: Code Reference As Built Description: Proposed Solution:	Alarms Horn/Strobe - Staff Area No horn/strobe in staff a ces: CBC 11B-702.1 and Device not provided Provide horn/strobe in a	Remediation: Required areas 2010 ADAS 702.1 area where programs, services and activitie EACH Cost Estimate: \$5,500.00 B		
Barrier Type: Barrier Description: Code Reference As Built Description: Proposed Solution: As-Built Meas	Alarms Horn/Strobe - Staff Area No horn/strobe in staff a ces: CBC 11B-702.1 and Device not provided Provide horn/strobe in a :: 1 Quantity: [I	Remediation: Required a areas 2010 ADAS 702.1 area where programs, services and activitie EACH Cost Estimate: \$5,500.00 B	SR: 3 Hindrance	



Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 Barrier #: 18A		
Facility:	Community Correction	ns Resource Center - 404 H St, Eureka		
Location:	S Corridor S Corridor			
Official Respo	nsible: Karen Clower	, ADA Coordinator		
Consent Decr	ee: No	Paragraph: M.51 Dwg: 1 of 1		
Barrier Area:	Signage	Remediation: N/A		
Barrier Type:	Tactile Exit Sign - Rout	re		
Barrier Description:	Exit door to exterior th	hru exit enclosure, interior room or passageway lacks "EXIT ROUTE" sign		
Code Referen	ces: CBC 11B-216.4.1	& 11B-703 and 2010 ADAS 216.4.1		
As Built Description:	New tactile information	on provided where visual sign exists		
Proposed Solution:	Barrier removed			
As-Built Meas	: 0 Quantity:	EACH Cost Estimate: \$0.00 BSR: 2 Recommended		
X Coordinate:	N/A	Y Coordinate: N/A Z Coordinate: N/A		
Implementati	on: Priority 4	Phase Date 12/18/2019 Status Closed		
Notes:				
Field Date:	11/13/2017 Repo	rt Date: 8/3/2018 Barrier #: 18B		
Field Date: Facility:		ns Resource Center - 404 H St, Eureka		
Facility:	Community Correction S Corridor			
Facility: Location:	Community Correction S Corridor nsible: Karen Clower	ns Resource Center - 404 H St, Eureka		
Facility: Location: Official Respo Consent Decre	Community Correction S Corridor nsible: Karen Clower	ns Resource Center - 404 H St, Eureka , ADA Coordinator		
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Correction S Corridor nsible: Karen Clower ee: No	r, ADA Coordinator Paragraph: M.51 Remediation: Required		
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Correction S Corridor nsible: Karen Clower ee: No Doors or Gates	ADA Coordinator Paragraph: M.51 Remediation: Required Operation		
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Correction S Corridor nsible: Karen Clower ee: No Doors or Gates Door/Gate Hardware -	ADA Coordinator Paragraph: M.51 Remediation: Required Operation		
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Correction S Corridor nsible: Karen Clower ee: No Doors or Gates Door/Gate Hardware -	ADA Coordinator Paragraph: M.51 Remediation: Required - Operation Le with a closed fist and 2010 ADAS 404.2.7		
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built	Community Correction S Corridor nsible: Karen Clower ee: No Doors or Gates Door/Gate Hardware Hardware not operabl ces: CBC 11B-404.2.7	Remediation: Required - Operation le with a closed fist and 2010 ADAS 404.2.7 ble		
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built Description: Proposed	Community Correction S Corridor nsible: Karen Clower ee: No Doors or Gates Door/Gate Hardware - Hardware not operabl ces: CBC 11B-404.2.7 a Door knob not accessi Provide compliant har	Remediation: Required - Operation le with a closed fist and 2010 ADAS 404.2.7 ble		
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built Description: Proposed Solution:	Community Correction S Corridor nsible: Karen Clower ee: No Doors or Gates Door/Gate Hardware - Hardware not operabl ces: CBC 11B-404.2.7 a Door knob not accessi Provide compliant har : 1 Quantity:	ADA Coordinator Paragraph: M.51 Remediation: Required Operation e with a closed fist and 2010 ADAS 404.2.7 ble dware		
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built Description: Proposed Solution: As-Built Meas	Community Correction S Corridor nsible: Karen Clower ee: No Doors or Gates Door/Gate Hardware - Hardware not operabl ces: CBC 11B-404.2.7 a Door knob not accessi Provide compliant har : 1 Quantity: N/A	ns Resource Center - 404 H St, Eureka 7, ADA Coordinator Paragraph: M.51 Remediation: Required - Operation le with a closed fist and 2010 ADAS 404.2.7 ble rdware EACH Cost Estimate: \$300.00 BSR: 1 Necessary		



Field Date:	11/13/2017 Report Date: 8/3/2018 Barrier #: 18C				
Facility:	Community Corrections Resource Center - 404 H St, Eureka				
Location:	S Corridor S Corridor				
Official Respo	nsible: Karen Clower, ADA Coordinator				
Consent Decr	ee: No Paragraph: M.51 Dwg: 1 of 1				
Barrier Area:	Doors or Gates Remediation: Required				
Barrier Type:	Door Clear Width - 32"				
Barrier Description:	Door, sliding/folding door or gate clear width is not min. 32"				
Code Referen	CBC 11B-404.2.3 & 404.3.1 and 2010 ADAS 404.2.3 & 404.3.1				
As Built Description:	29-1/2" wide				
Proposed Solution:	Replace door or gate and frame				
As-Built Meas	Quantity: EACH Cost Estimate: \$2,250.00 BSR: 1 Necessary				
X Coordinate:	N/A Y Coordinate: N/A Z Coordinate: N/A				
Implementati	on: Priority 2 Phase Date Status Open				
Notes: Cou	nty intends to apply Program Access. Public is escorted by staff at all times in this area.				
Field Date:	12/18/2019 Report Date: 12/18/2019 Barrier #: 18D				
Facility:	Community Corrections Resource Center - 404 H St, Eureka				
Location:	S Corridor				
Official Respo	nsible: Karen Clower, ADA Coordinator				
Consent Decr	ee: No Paragraph: M.51 Dwg: 1 of 1				
Barrier Area:	Signage Remediation: N/A				
Barrier Type:	Room ID Sign - No Sign				
Barrier Description:	No room ID sign provided at permanent room or space				
Code Referen	ces: CBC 11B-216.2 and 2010 ADAS 216.2				
As Built Description:	Compliant tactile sign provided				
Proposed Solution:	Barrier removed				
As-Built Meas	: O Quantity: EACH Cost Estimate: \$0.00 BSR: 1 Necessary				
X Coordinate:	N/A Y Coordinate: N/A Z Coordinate: N/A				
Implementati	on: Priority 4 Phase Date 12/18/2019 Status Closed				
Notes:					



Field Date:	12/18/2019 Repo	ort Date: 12/18/2019 Barrier #: 18E				
Facility:	Community Correction	ns Resource Center - 404 H St, Eureka				
Location:	S Corridor S Corridor					
Official Respo	nsible: Karen Clower	r, ADA Coordinator				
Consent Decre	ee: No	Paragraph: M.51 Dwg: 1 of 1				
Barrier Area:	Signage	Remediation: N/A				
Barrier Type:	Room ID Sign - No Tact	tile Information				
Barrier Description:	Room ID sign provided	d for sighted people lacks tactile info for the visually impaired				
Code Referen	ces: CBC 11B-216.2 an	nd 2010 ADAS 216.2				
As Built Description:	Compliant tactile sign room	provided where visual sign exists at heater room, room 10, and janitor				
Proposed Solution:	Barriers removed					
As-Built Meas	: 0 Quantity:	EACH Cost Estimate: \$0.00 BSR: 1 Necessary				
X Coordinate:	N/A	Y Coordinate: N/A Z Coordinate: N/A				
Implementation	on: Priority 4	Phase Date 12/18/2019 Status Closed				
Notes:						
F: 115 ·						
Field Date:	11/13/2017 Repo	ort Date: 8/3/2018 Barrier #: 18F				
Field Date: Facility:		ns Resource Center - 404 H St, Eureka				
Facility:						
Facility:	Community Correction S Corridor					
Facility: Location:	Community Correction S Corridor nsible: Karen Clower	ns Resource Center - 404 H St, Eureka				
Facility: Location: Official Respo	Community Correction S Corridor nsible: Karen Clower	ns Resource Center - 404 H St, Eureka r, ADA Coordinator				
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Correction S Corridor nsible: Karen Clower	r, ADA Coordinator Paragraph: M.51 Remediation: Required				
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Correction S Corridor nsible: Karen Clower, ee: No Alarms	r, ADA Coordinator Paragraph: M.51 Remediation: Required				
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Correction S Corridor Insible: Karen Clower, Insible: Insible: Karen Clower, Insible: Insible: Karen Clower, Insible:	r, ADA Coordinator Paragraph: M.51 Remediation: Required				
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Correction S Corridor Insible: Karen Clower, Insible: Insible: Karen Clower, Insible: Insible: Karen Clower, Insible:	ns Resource Center - 404 H St, Eureka r, ADA Coordinator Paragraph: M.51 Remediation: Required e 42" - 48" n 42" and 48" high				
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference As Built	Community Correction S Corridor Insible: Karen Clower, Lee: No Alarms Fire Pull - Reach Range Fire pulls not between Lees: CBC 11B-309.3 & 62-1/2" high	ns Resource Center - 404 H St, Eureka r, ADA Coordinator Paragraph: M.51 Remediation: Required e 42" - 48" n 42" and 48" high				
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference As Built Description: Proposed	Community Correction S Corridor Insible: Karen Clower, Lee: No Alarms Fire Pull - Reach Range Fire pulls not between Lees: CBC 11B-309.3 & 62-1/2" high Replace or relocate fire	ns Resource Center - 404 H St, Eureka r, ADA Coordinator Paragraph: M.51 Remediation: Required e 42" - 48" n 42" and 48" high 11B-308 and 2010 ADAS 309.3 & 308 re pull when remodeling				
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference As Built Description: Proposed Solution:	Community Correction S Corridor Insible: Karen Clower, Insible: Insible: Karen Clower, Insible: Insible: Karen Clower, Insible: In	ns Resource Center - 404 H St, Eureka r, ADA Coordinator Paragraph: M.51 Remediation: Required e 42" - 48" n 42" and 48" high 11B-308 and 2010 ADAS 309.3 & 308 re pull when remodeling				
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Reference As Built Description: Proposed Solution: As-Built Meas	Community Correction S Corridor Insible: Karen Clower, Insible: Insible: Karen Clower, Insible: Insible: Karen Clower, Insible: Karen Clower, Insible: Karen Clower, Insible: Karen Clower, Insible: Insible: Karen Clower, Insible:	ns Resource Center - 404 H St, Eureka r, ADA Coordinator Paragraph: M.51 Remediation: Required e 42" - 48" 11B-308 and 2010 ADAS 309.3 & 308 re pull when remodeling EACH Cost Estimate: \$3,500.00 BSR: 1 Necessary				



Field Date:	11/13/2017 Repo	ort Date: 8/3/2018	Barrier #:	18G	1		
Facility:	Community Correction	ns Resource Center - 404	H St, Eureka		4		
Location:	S Corridor						
Official Respo	nsible: Karen Clowe	r, ADA Coordinator					
Consent Decr	ee: No	Paragraph: M.51	Dwg:	1 of 1			
Barrier Area:	Alarms	Remedia	ation: Requi	red			
Barrier Type:	Fire Pull - Fist Operat	on					
Barrier Description:	Fire pull actuator med	chanism is not accessible					
Code Referen	ces: CBC 11B-309.4 a	nd 2010 ADAS 309.4					
As Built Description:	Actuator not accessib	le (fist operable)					
Proposed Solution:	Replace fire pull whe	n remodeling					
As-Built Meas	: 0 Quantity	EACH Cost Estimate:	\$0.00	BSR: 1 N	lecessary		
X Coordinate:	N/A	Y Coordinate: N/A		Z Coordinate:	N/A		
Implementati	on: Priority 2	Phase	Date		Status Open		
Notes: Pro	perty Owner Responsi	ble.					
Field Date:	11/13/2017 Repo	ort Date: 8/3/2018	Barrier #:	18H			
Facility:	Community Correction	ns Resource Center - 404	H St, Eureka				
Location:	S Corridor						
Official Respo	nsible: Karen Clowe	r, ADA Coordinator					
Consent Decr	ee: No	Paragraph: M.51	Dwg:	1 of 1			
Barrier Area:	Stairways	Remedia	ation: Requi	red			
Barrier Type:	Handrail - Both Sides						
Barrier Description:	Handrail not provided	at both sides of stairway	1				
Code Referen	ces: CBC 11B-505.2 a	nd 2010 ADAS 505.2					
As Built Description:	No handrail provided	at both sides					
Proposed Solution:	Provide handrails at b	ooth sides of stairway					
As-Built Meas	S: 4 Quantity	LF Cost Estimate:	\$900.00	BSR: 2 R	ecommended		
X Coordinate:	N/A	Y Coordinate: N/A		Z Coordinate:	N/A		
Implementati	on: Priority 4	Phase	Date		Status Open		
Notes: Pro	norty Owner Bernensi	ble.Owner may want to re	otain a licons	od architect/pr	ofossional or CASD		



Field Date:	11/13/2017 Repo	rt Date: 8/3/2018	Barrier #:	181			
Facility:	Community Corrections Resource Center - 404 H St, Eureka						
Location:	S Corridor						
Official Respon	nsible: Karen Clower	, ADA Coordinator					
Consent Decre	ee: No	Paragraph: M.51	Dwg:	1 of 1			
Barrier Area:	Stairways	Remedia	ntion: Requir	ed			
Barrier Type:	Handrail Extension - To	ор					
Barrier Description:	Handrail extension do	es not extend horizontall	y above land	ng for min. 12" from first rise	er nosing		
Code Reference	ces: CBC 11B-505.10.2	2 and 2010 ADAS 505.10.	2				
As Built Description:	No extension provided	d					
Proposed Solution:	Provide handrails at bo	oth sides of stairway					
As-Built Meas	Quantity:	LF Cost Estimate:	\$0.00	BSR: 2 Recommended			
X Coordinate:	N/A	Y Coordinate: N/A		Z Coordinate: N/A			
Implementation	on: Priority 4	Phase	Date	Status Open			
		r may want to retain a licensed arc nical or structural infeasabilty is ap	•	al or CASP to determine if after remedia	ting the barrie		
Field Date:	11/13/2017 Repo	rt Date: 8/3/2018	Barrier #:	18J			
Facility:	Community Correction	ns Resource Center - 404	H St, Eureka				
Location:	S Corridor			1 American			
Official Respon	nsible: Karen Clower	, ADA Coordinator					
Consent Decre	ee: No	Paragraph: M.51	Dwg:	1 of 1			
Barrier Area:	Stairways	Remedia	ition: Requi	red			
Barrier Type:	Handrail Extension - B	ottom					
Barrier Description:	Handrail extension do	es not extend for the len	gth of one tre	ead + 12" beyond the last rise	r nosing		
Code Reference	ces: CBC 11B-505.10.3	3 and 2010 ADAS 505.10.	3				
As Built Description:	Extension not sloped f	or the length of one trea	d long				
Proposed Solution:	Provide handrails at bo	oth sides of stairway					
As-Built Meas	Quantity:	LF Cost Estimate:	\$0.00	BSR: 2 Recommended			
X Coordinate:	N/A	Y Coordinate: N/A		Z Coordinate: N/A			
Implementation	on: Priority 4	Phase	Date	Status Open			
to		ediating the barrier to the		sed architect/professional or nt possible if technical or stru			



Field Date: 11/13/2017 Report Date: 8/3/2018 Barrier #: 18K
Facility: Community Corrections Resource Center - 404 H St, Eureka
Location: S Corridor
Official Responsible: Karen Clower, ADA Coordinator
Consent Decree: No Paragraph: M.51 Dwg: 1 of 1
Barrier Area: Stairways Remediation: Required
Barrier Type: Handrail Height
Barrier Handrail gripping surface not 34"- 38" high Description:
Code References: CBC 11B-505.4 and 2010 ADAS 505.4
As Built Description: 32" handrail grip height
Proposed Provide handrails at both sides of stairway Solution:
As-Built Meas: 0 Quantity: LF Cost Estimate: \$0.00 BSR: 2 Recommended
X Coordinate: N/A Y Coordinate: N/A Z Coordinate: N/A
Implementation: Priority 4 Phase Date Status Open
Notes: Property Owner Responsible. Owner may want to retain a licensed architect/professional or CASP to determine if after remediating the barrier to the fullest extent possible if technical or structural infeasabilty is applicable.
Field Date: 11/13/2017 Report Date: 8/3/2018 Barrier #: 18L
Facility: Community Corrections Resource Center - 404 H St, Eureka
Location: S Corridor
Official Responsible: Karen Clower, ADA Coordinator
Consent Decree: No Paragraph: M.51 Dwg: 1 of 1
Barrier Area: Stairways Remediation: Required
Barrier Type: Contrasting Color - Interior
Barrier No contrasting color on top and bottom tread of interior stairway Description:
Code References: CBC 11B-504.4.1
As Built Description: Treads lack contrasting color defined as 70% contrast
Proposed Provide contrasting color on min. top and bottom tread Solution:
As-Built Meas: 2 Quantity: LF or T Cost Estimate: \$70.00 BSR: 2 Recommended
X Coordinate: N/A Y Coordinate: N/A Z Coordinate: N/A
Implementation: Priority 4 Phase Date Status Open
Notes: Property Owner Responsible.



Field Date: 12/18/2019 Report Date: 12/18/2019 Barrier #: 18M					
Facility: Community Corrections Resource Center - 404 H St, Eureka					
n: S Corridor					
Official Responsible: Karen Clower, ADA Coordinator					
Consent Decree: No Paragraph: M.51 Dwg: 1 of 1					
Barrier Area: Signage Remediation: Required					
Barrier Type: Tactile Exit Sign - Exit					
Barrier Description: Ground floor doors that exit to exterior not provided with signs stating "EXIT"					
Code References: CBC 11B-216.4.1 & 11B-703 and 2010 ADAS 216.4.1					
As Built Description: No tactile sign provided where required					
Proposed Solution: Provide compliant sign at exit side of door					
As-Built Meas: 1 Quantity: EACH Cost Estimate: \$250.00 BSR: 1 Necessary					
X Coordinate: N/A Y Coordinate: N/A Z Coordinate: N/A					
Implementation: Priority 4 Phase Date Status Open					
Notes: Property Owner Responsibility.					
Field Date: 11/13/2017 Report Date: 8/3/2018 Barrier #: 18N					
Facility: Community Corrections Resource Center - 404 H St, Eureka					
Location: S Corridor					
Official Responsible: Karen Clower, ADA Coordinator					
Consent Decree: No Paragraph: M.51 Dwg: 1 of 1					
Barrier Area: Doors or Gates Remediation: Required					
Barrier Type: Door Closer - Exterior Adjustment					
Barrier Description: Door opening force exceeds 5 lbf					
Code References: CBC 11B-404.2.9					
As Built 11 lbf Description:					
Proposed Replace or adjust existing closer Solution:					
As-Built Meas: 1 Quantity: EACH Cost Estimate: \$450.00 BSR: 1 Necessary					
As-Built Meas: 1 Quantity: EACH Cost Estimate: \$450.00 BSR: 1 Necessary X Coordinate: N/A Y Coordinate: N/A Z Coordinate: N/A					



Field Date: 11/13/2017 Report Date: 8/3/2018 Barrier #: 180
Facility: Community Corrections Resource Center - 404 H St, Eureka
Location: S Corridor
Official Responsible: Karen Clower, ADA Coordinator
Consent Decree: No Paragraph: M.51 Dwg: 1 of 1
Barrier Area: Doors or Gates Remediation: Required
Barrier Type: Door Closer - Exterior Sweep
Barrier Description: Door closer lacks min. 5 second sweep period/back check
Code References: CBC 11B-404.2.8.1 and 2010 ADAS 404.2.8.1
As Built Description: 2 second sweep
Proposed Replace or adjust existing closer Solution:
As-Built Meas: 0 Quantity: EACH Cost Estimate: \$0.00 BSR: 2 Recommended
X Coordinate: N/A Y Coordinate: N/A Z Coordinate: N/A
Implementation: Priority 2 Phase Date Status Open
Notes: Property Owner Responsibility.
Field Date: 11/13/2017 Report Date: 8/3/2018 Barrier #: 19A
Facility: Community Corrections Resource Center - 404 H St, Eureka
Location: Restroom Vestibule
Official Responsible: Karen Clower, ADA Coordinator
Consent Decree: No Paragraph: M.51 Dwg: 1 of 1
Barrier Area: Accessible Route - Interior Remediation: N/A
Barrier Type: Clear Width - 36" Wide
Barrier Accessible route clear width is not min. 36" wide Description:
Code References: CBC 11B-403.5.1 and 2010 ADAS 403.5.1
As Built Description: Accessible route 34" wide at structural element
Proposed No remediation required where barrier removal is technically infeasible Solution:
As-Built Meas: 0 Quantity: LF Cost Estimate: \$0.00 BSR: 5 Technically Infeasible
X Coordinate: N/A Y Coordinate: N/A Z Coordinate: N/A
Implementation: Priority 3 Phase Date 11/13/2017 Status Closed
Notes:



Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 E	Barrier #: 19B	7777		
Facility:	Community Correction	ns Resource Center - 404 H	St, Eureka			
Location:	Restroom Vestibule					
Official Respo	nsible: Karen Clower	, ADA Coordinator				
Consent Decr	ee: No	Paragraph: M.51	Dwg: 1 of 1			
Barrier Area:	Controls and Mechani	sms Remediation	on: N/A			
Barrier Type:	Operable Part - Clear I	loor Space (Stored Items)				
Barrier Description:	Clear floor space for p	erson using wheelchair not	provided at opera	able part		
Code Referen	ces: CBC 11B-305.3 ar	nd 2010 ADAS 305.3				
As Built Description:	Clear floor space prov	ided where furniture was re	elocated			
Proposed Solution:	Barrier removed					
As-Built Meas	: 0 Quantity:	EACH Cost Estimate:	0.00 B	SR: 2 Recommended		
X Coordinate:	N/A	Y Coordinate: N/A	Z Coo	rdinate: N/A		
Implementati	on: Priority 3	Phase	Date 12/18/20:	19 Status Closed		
Notes:						
Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 E	Barrier #: 19C			
Facility:	Community Correction	ns Resource Center - 404 H	St, Eureka			
Location:	Restroom Vestibule			9		
Official Respo	nsible: Karen Clower	, ADA Coordinator		A.		
Consent Decre	ee: No	Paragraph: M.51	Dwg: 1 of 1			
Barrier Area:	Controls and Mechani	sms Remediation	on: N/A			
Barrier Type:	Clothing Hook or Rod	- Height				
Barrier Description:	Clothing hooks not ma	ax. 48" high AFF				
Code Referen	ces: CBC 11B-308.2.1	and 2010 ADAS 308.2.1				
As Built Description:	43" high at lowest coa	t hook				
Proposed Solution:	Barrier removed					
As-Built Meas	: 0 Quantity:	EACH Cost Estimate:	0.00 B	SR: 2 Recommended		
X Coordinate:	N/A	Y Coordinate: N/A	Z Coo	rdinate: N/A		
Implementati	on: Priority 3	Phase	Date 12/18/20:	19 Status Closed		
Notes:						



Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 E	Barrier #:	19D	7777		
Facility:	Community Correction	ns Resource Center - 404 H	St, Eureka				
Location:	Restroom Vestibule						
Official Respo	nsible: Karen Clower	, ADA Coordinator					
Consent Decr	ee: No	Paragraph: M.51	Dwg:	1 of 1			
Barrier Area:	Controls and Mechani	sms Remediation	on: N/A		(Cont.)		
Barrier Type:	Operable Part - Side R	each High Unobstructed					
Barrier Description:	Operable part not at n	nin. 15" or max. 48" high					
Code Referen	ces: CBC 11B-308.3.1	and 2010 ADAS 308.3.1					
As Built Description:	Hand sanitizer dispens	er at 54-1/2" high was rem	ioved				
Proposed Solution:	Barrier removed						
As-Built Meas	: 0 Quantity:	EACH Cost Estimate: \$	0.00	BSR: 3 H	Hindrance		
X Coordinate:	N/A	Y Coordinate: N/A		Z Coordinate	: N/A		
Implementati	on: Priority 3	Phase	Date 12	/18/2019	Status Closed		
Notes:							
Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 E	Barrier #:	19E	7777		
Facility:	Community Correction	ns Resource Center - 404 H	St, Eureka				
Location:	Restroom Vestibule				A SE		
Official Respo	nsible: Karen Clower	, ADA Coordinator					
Consent Decr	ee: No	Paragraph: M.51	Dwg:	1 of 1			
Barrier Area:	Signage	Remediation	on: N/A		Total Control		
Barrier Type:	Room ID Sign - No Sigr	1					
Barrier Description:	No room ID sign provi	ded at permanent room or	space				
Code Referen	ces: CBC 11B-216.2 ar	d 2010 ADAS 216.2					
As Built Description:	Compliant tactile sign	provided at entrance door	to staff lou	inge within pul	olic circulation path		
Proposed Solution:	Barrier removed						
•	l	EACH Cost Estimate: \$	50.00	BSR: 11	Necessary		
Solution:	: 0 Quantity:	EACH Cost Estimate: \$ Y Coordinate: N/A	\$0.00	BSR: 1 N			
Solution: As-Built Meas	: 0 Quantity:						



Field Date:	12/18/2019 Report	Date: 12/18/2019 Barrier	#: 20A			
Facility:	Community Corrections	Resource Center - 404 H St, Eur	reka			
Location:	Unisex Restroom					
Official Respo	nsible: Karen Clower, A	ADA Coordinator				
Consent Decre	ee: No P	aragraph: M.51 Dv	wg: 1 of 1			
Barrier Area:	Restrooms	Remediation: N	/A			
Barrier Type:	Sign - Braille/tactile Info	rmation				
Barrier Description:	No sign with Braille/Tact	ile information provided to ide	ntify restroom			
Code Referen	ces: CBC 11B-216.2 and	ADAS 216.2				
As Built Description:	New tactile information	at wall on latch side of door				
Proposed Solution:	Barrier removed					
As-Built Meas	: 0 Quantity:	ACH Cost Estimate: \$0.00	BSR: 1 Necessary			
X Coordinate:	N/A Y	Coordinate: N/A	Z Coordinate: N/A			
Implementati	on: Priority 3	Phase Date	12/18/2019 Status Closed			
Notes:						
Field Date:	12/18/2019 Report	Date: 12/18/2019 Barrier	#: 20B			
Field Date: Facility:		Date: 12/18/2019 Barrier Resource Center - 404 H St, Eur				
Facility:	Community Corrections Unisex Restroom	Resource Center - 404 H St, Eu				
Facility: Location:	Community Corrections Unisex Restroom nsible: Karen Clower, A	Resource Center - 404 H St, Eur				
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Corrections Unisex Restroom nsible: Karen Clower, Aee: No P	Resource Center - 404 H St, Eur ADA Coordinator aragraph: M.51 Dv Remediation: N	reka wg: 1 of 1			
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Corrections Unisex Restroom nsible: Karen Clower, A	Resource Center - 404 H St, Eur ADA Coordinator aragraph: M.51 Dv Remediation: N	reka wg: 1 of 1			
Facility: Location: Official Respo Consent Decre Barrier Area:	Community Corrections Unisex Restroom nsible: Karen Clower, A ee: No P Restrooms Sign - 12" Circle/Triangle	Resource Center - 404 H St, Eur ADA Coordinator aragraph: M.51 Dv Remediation: N.	reka wg: 1 of 1			
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Corrections Unisex Restroom nsible: Karen Clower, A ee: No P Restrooms Sign - 12" Circle/Triangle	Resource Center - 404 H St, Eur ADA Coordinator aragraph: M.51 Dv Remediation: N, e at Unisex Restroom posed on 12" circle provided or	wg: 1 of 1			
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description:	Community Corrections Unisex Restroom nsible: Karen Clower, A ee: No P Restrooms Sign - 12" Circle/Triangle No 12" triangle superim	Resource Center - 404 H St, Eur ADA Coordinator aragraph: M.51 Dv Remediation: N, e at Unisex Restroom posed on 12" circle provided or	wg: 1 of 1			
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built	Community Corrections Unisex Restroom nsible: Karen Clower, A ee: No P Restrooms Sign - 12" Circle/Triangle No 12" triangle superim ces: CBC 11B-703.7.2.6.	Resource Center - 404 H St, Eur ADA Coordinator aragraph: M.51 Dv Remediation: N, e at Unisex Restroom posed on 12" circle provided or	wg: 1 of 1			
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built Description: Proposed	Community Corrections Unisex Restroom nsible: Karen Clower, Aee: No P Restrooms Sign - 12" Circle/Triangle No 12" triangle superim ces: CBC 11B-703.7.2.6. New sign provided on do Barrier removed	Resource Center - 404 H St, Europe ADA Coordinator aragraph: M.51 Dv Remediation: N, e at Unisex Restroom posed on 12" circle provided or	wg: 1 of 1			
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built Description: Proposed Solution:	Community Corrections Unisex Restroom nsible: Karen Clower, A ee: No P Restrooms Sign - 12" Circle/Triangle No 12" triangle superim ces: CBC 11B-703.7.2.6. New sign provided on do Barrier removed : O Quantity: E	Resource Center - 404 H St, Europe ADA Coordinator aragraph: M.51 Dv Remediation: N, e at Unisex Restroom posed on 12" circle provided or	wg: 1 of 1 /A n door or doorway to unisex toilet room			
Facility: Location: Official Respo Consent Decre Barrier Area: Barrier Type: Barrier Description: Code Referen As Built Description: Proposed Solution: As-Built Meas	Community Corrections Unisex Restroom nsible: Karen Clower, A ee: No P Restrooms Sign - 12" Circle/Triangle No 12" triangle superim ces: CBC 11B-703.7.2.6 New sign provided on do Barrier removed : O Quantity: E	Resource Center - 404 H St, Eur ADA Coordinator aragraph: M.51 Dv Remediation: N e at Unisex Restroom posed on 12" circle provided or BOOR EACH Cost Estimate: \$0.00 Coordinate: N/A	wg: 1 of 1 /A n door or doorway to unisex toilet room BSR: 1 Necessary			



Field Date:	12/18/2019 Repo	ort Date: 12/18/2019 B	Barrier #: 20	C	_ " } }	
Facility:	Community Correction	ns Resource Center - 404 H	St, Eureka		7	
Location:	Unisex Restroom					
Official Respo	nsible: Karen Clower	, ADA Coordinator				
Consent Decre	ee: No	Paragraph: M.51	Dwg: 1 o	f 1		
Barrier Area:	Doors or Gates	Remediatio	n: N/A			
Barrier Type:	Maneuvering Cl - Stor	ed Items				
Barrier Description:	Door/Gate lacks requi	red maneuvering clearance				
Code Referen	ces: CBC Figure 11B-4	04.2.4.1 and 2010 ADAS 404	4.2.4.1			
As Built Description:	Furniture moved that	blocked maneuvering clears	ance at push s	side of door	at entry	
Proposed Solution:	Barrier removed					
As-Built Meas	: 0 Quantity:	EACH Cost Estimate: \$	0.00	BSR: 1 N	ecessary	
X Coordinate:	N/A	Y Coordinate: N/A	Z	Coordinate:	N/A	
Implementati	on: Priority 3	Phase	Date 12/18	/2019	Status Closed	
Notes:						
Field Date:	12/18/2019 Repo	ort Date: 12/18/2019 B	Barrier #: 20	D	.	
Facility:	Community Correction	ns Resource Center - 404 H	St, Eureka	100	The same of the sa	
Location:	Unisex Restroom			1		
Official Respo	nsible: Karen Clower	, ADA Coordinator		100		
Consent Decre	ee: No	Paragraph: M.51	Dwg: 1 o	f 1		
Barrier Area:	Restrooms	Remediatio	n: N/A		7	
Barrier Type:	Clothing Hooks - Heigl	nt				
Barrier						
Description:	Clothing hooks not ma	ax. 48" high AFF				
		ax. 48" high AFF 1B-308.2.1 & 2010 ADA 603	3.4			
		1B-308.2.1 & 2010 ADA 603	3.4			
Code Referen	ces: CBC 11B-603.4, 1	1B-308.2.1 & 2010 ADA 603	3.4			
Code Reference As Built Description: Proposed	CBC 11B-603.4, 1 Lower hook installed a	1B-308.2.1 & 2010 ADA 603 at 43" high		BSR: 2 R	ecommended	
Code Reference As Built Description: Proposed Solution:	Ces: CBC 11B-603.4, 1 Lower hook installed a Barrier removed : Quantity:	1B-308.2.1 & 2010 ADA 603 at 43" high	0.00	BSR: 2 R		
Code Reference As Built Description: Proposed Solution: As-Built Meas	Ces: CBC 11B-603.4, 1 Lower hook installed a Barrier removed O Quantity:	1B-308.2.1 & 2010 ADA 603 at 43" high EACH Cost Estimate: \$	0.00	Coordinate:		



Field Date: 12/18/2019 Report Date: 12/18/2019 Barrier #: 20E						
Facility: Community Corrections Resource Center - 404 H St, Eureka	Community Corrections Resource Center - 404 H St, Eureka					
Location: Unisex Restroom	Unisex Restroom					
Official Responsible: Karen Clower, ADA Coordinator	A					
Consent Decree: No Paragraph: M.51 Dwg: 1 of 1						
Barrier Area: Restrooms Remediation: N/A						
Barrier Type: Lavatory - Drain Pipes						
Barrier Description: Hot water and drainpipes accessible under lavatory not insulated or covered						
Code References: CBC 11B-606.5 and 2010 ADAS 606.5						
As Built New insulation provided Description:						
Proposed Barrier removed Solution:						
As-Built Meas: 0 Quantity: EACH Cost Estimate: \$0.00 BSR: 2 Recommended						
X Coordinate: N/A Y Coordinate: N/A Z Coordinate: N/A						
Implementation: Priority 3 Phase Date 12/18/2019 Status Closed						
Notes:						
Field Date: 12/18/2019 Report Date: 12/18/2019 Barrier #: 20F						
Facility: Community Corrections Resource Center - 404 H St, Eureka						
Location: Unisex Restroom	action .					
Official Responsible: Karen Clower, ADA Coordinator						
Consent Decree: No Paragraph: M.51 Dwg: 1 of 1	1					
Barrier Area: Restrooms Remediation: N/A						
Barrier Type: Lavatory - Centerline						
Barrier Description: Lavatory adjacent to wall not min. 18" to the centerline of fixture						
Code References: CBC 11B-606.6						
As Built Fixture moved to provide 18" OC Description:						
Proposed Barrier removed Solution:						
As-Built Meas: 0 Quantity: JOB Cost Estimate: \$0.00 BSR: 2 Recommended						
As-Built Meas: 0 Quantity: JOB Cost Estimate: \$0.00 BSR: 2 Recommended X Coordinate: N/A Y Coordinate: N/A Z Coordinate: N/A						



Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 E	Barrier #	: 20G		
Facility:	Community Correction	ns Resource Center - 404 H	St, Eure	ka		
Location:	Unisex Restroom					
Official Respo	nsible: Karen Clower	, ADA Coordinator			M C HEL	
Consent Decr	ee: No	Paragraph: M.51	Dwg	g: 1 of 1		
Barrier Area:	Restrooms	Remediation	on: N/A	\		
Barrier Type:	WC - Rear Grab Bar Lo	cation				
Barrier Description:	Rear grab bar not cen	ered 12" from wall and 24"	on the	other side of W(
Code Referen	ces: CBC 11B-604.5.2	and 2010 ADAS 604.5.2				
As Built Description:	Grab bar moved to 12	" OC				
Proposed Solution:	Barrier removed					
As-Built Meas	: 0 Quantity:	JOB Cost Estimate: \$	0.00	BSR: 3	Hindrance	
X Coordinate:	N/A	Y Coordinate: N/A		Z Coordinate	e: N/A	
Implementati	on: Priority 3	Phase	Date	12/18/2019	Status Closed	
Notes:						
Field Date:	12/18/2019 Repo	rt Date: 12/18/2019 E	Barrier #	: 20H	16 360	
Facility:	Community Correction	ns Resource Center - 404 H	St, Eure	ka		
Location:	Unisex Restroom					
Official Respo	nsible: Karen Clower	, ADA Coordinator				
Consent Decr	ee: No	Paragraph: M.51	Dwg	g: 1 of 1		
Barrier Area:	Restrooms	Remediation	on: N/A	1		
Barrier Type:	WC - Rear Grab Bar Ab	ove Tank				
Barrier Description:	Rear grab bar mounte	d higher than 36" AFF at tar	nk-type	toilet		
Code Referen	ces: CBC 11B-604.5 &	609.4 and 2010 ADAS 604.5	5.2 & 60	9.4		
As Built Description:	Grab bar moved to pro	ovide 2" between bar and to	ank			
Proposed Solution:	Barrier removed					
As-Built Meas	: 0 Quantity:	JOB Cost Estimate: \$	0.00	BSR: 3	Hindrance	
X Coordinate:	N/A	Y Coordinate: N/A		Z Coordinate	e: N/A	
Implementati	on: Priority 3	Phase	Date	12/18/2019	Status Closed	
Notes:						



Field Date: 1	2/18/2019 Report Date: 12/18/2019 Barrier #: 201			
Facility:	Community Corrections Resource Center - 404 H St, Eureka			
Location: U	Unisex Restroom			
Official Respons	sible: Karen Clower, ADA Coordinator			
Consent Decree	No Paragraph: M.51 Dwg: 1 of 1			
Barrier Area: R	estrooms Remediation: N/A			
Barrier Type: Toilet Paper Dispenser - Centerline				
Barrier Centerline of toilet tissue dispenser not within 7" to 9" toilet seat front edge Description:				
Code References: CBC 11B-604.7 and 2010 ADAS 604.7				
As Built 9 Description:	" OC from rim			
Proposed B Solution:	arrier removed			
As-Built Meas:	0 Quantity: EACH Cost Estimate: \$0.00 BSR: 3 Hindrance			
X Coordinate:	N/A Y Coordinate: N/A Z Coordinate: N/A			
Implementation	n: Priority 3 Phase Date 12/18/2019 Status Closed			
Notes:				

COST ESTIMATES



SUMMARY REPORT

Cost Estimate Total	\$126.370.00		
Cost Estimate - Priority 1:	\$15,560.00	% of Total Cost Estimate:	12.31%
Cost Estimate - Priority 2:	\$89,900.00	% of Total Cost Estimate:	71.14%
Cost Estimate - Priority 3:	\$18,440.00	% of Total Cost Estimate:	14.59%
Cost Estimate - Priority 4:	\$2,470.00	% of Total Cost Estimate:	1.95%

